May 10, 2021



Wood Environment & Infrastructure Solutions, Inc. Big Shanty Road NW, Kennesaw, GA 30144 T: 770-421-3400

www.woodplc.com

Albi Balliu Senior Project Manager City of Key West Engineering Department 1300 White Street, Key West, FL, 33040

Subject Key West Diesel Plant Structural Visual Assessment Update

Wood Project No. 600774

Site Name Key West Diesel Plant

Site Address 101-111 Geraldine St, Key West, FL 33040

Dear Ms. Balliu:

Wood Environment & Infrastructure Solutions, Inc. (Wood) is pleased to submit this report as an addendum to the original report submitted by Wood titled Structural Visual Assessment Key West Diesel Plant dated July 27, 2018. This report presents the updated new findings and recommendations, field notes recorded during our site visit to the Key West Diesel Plant (KWDP) on March 22, 2021, photolog, and updated Opinion of Probable Construction Cost estimate (cost estimate). Our services were performed in general accordance with the Terms and Conditions of the Continuing Services Contract between the City of Key West and Wood Environment & Infrastructure Solutions, Inc. dated April 16, 2018.

1. Executive Summary

This report supplements the findings and recommendations, photos, and construction cost estimate prepared by Wood for the report Structural Visual Assessment Key West Diesel Plant dated July 27, 2018. The intent of our March 22, 2021 field visit, during which we gathered field notes and associated photos, was to identify possible new structural defects associated with the buildings or defects already included in the original assessment report that show signs of further deterioration/damage. The recommendations presented are based on the objective to present costing for repairs which will keep the asset stable and water-tight during the hurricane season. The recorded field notes, photolog, and updated cost estimate are attached.

The following is a summary of the estimated repair costs for all buildings for which a detailed breakdown is provided in Appendix C. The basis for the Stack Wall Repair is to restore the asset to a stable and water-tight condition. The basis for the Steel Wall Repair assumes the current building use is changed and the current Florida Existing Building Code and Florida Building Code editions are used as the basis for the structural repairs.

- Stack Wall Repair = \$2,762,383
- Steel Wall Repair = \$3,793,044

This report update is subject to the scope, limitations and assumptions included in this report.

2. Document Review

Wood engineers reviewed readily available information on the buildings included in the original report to become familiar with the project. Information which Wood reviewed included the condition of the buildings, findings and recommendations, and the cost estimate.

We used Wood's July 27, 2018 report as a baseline for determining the location of new structural defects and the identifying defects which were showing signs of exacerbation and propagation.

3. Site Visit

Wood Engineer James Vincent and Tirrell Day performed a site visit on March 22, 2021. Mr. Vincent and Mr. Day visually observed the structural components that were exposed and accessible. Observations were made from the ground, and an elevated equipment platform. No architectural finishes were removed during the site visit.

4. Building Findings and Recommendations

The KWDP was previously visually assessed by Wood. Based on the assessment, the report, Structural Visual Assessment Key West Diesel Plant dated July 27, 2018 was submitted to the City of Key West. This original report has been reviewed, and its drawings are included herein with updated recorded field notes as part of this report (See Appendix A) to establish the updated building findings and recommendations. No material testing, or structural analysis has been done. The updated findings and recommendations are based on the site visit findings and industry standard repairs.

Based on our visual assessment and site visit of the facility, the following sections include the updated building findings and recommendations. The recommendations are provided to ensure that the structure remains stable and water-tight and is not meant to address all existing deficiencies associated with the existing structure.

It is Wood's understanding that the City may consider restoring the existing structure. Based on this and depending on level of restoration and final occupancy use, additional material testing is recommended for the facility (wall samples, geotechnical, etc.) accompanied by a comprehensive structural analysis.

Refer to Appendix A and B for the drawings with field notes of each of the building plans and elevations, and photos. Refer to Appendix C for the updated cost estimate.

Building I Updated Findings and Recommendations

- Entryway to east of building is spalling & missing section of concrete at base, exposed rebar, & missing bricks. The missing concrete needs to be replaced and restored to its original condition, and missing bricks replaced.
- Additional exterior cracks located at exterior concrete base on north side of building, typical.
 Patch/repair of those cracks is necessary.
- Interior brick areas showing signs of deterioration. Restoring or even replacing the deteriorating bricks is recommended.
- Concrete slab on grade is typically in poor condition, and severely cracked and fragmented in multiple isolated areas. Replacement of at least the severely damaged areas and more is required.

Building II Updated Findings and Recommendations

- Exterior east side of building showing vegetation growth on wall which suggests on-going cracking and other damage to the bricks and joint mortar where it is located. Removal of vegetation, and restoration or replacement of the bricks and repointing of the masonry mortar joints is needed.
- Noted wind girt ends at interior column connection showing severe deterioration/missing cross-section. Based on this the affected areas need to be cleaned from corrosion and repainted, if the corrosion damage is excessive repair of the elements would be necessary.
- Additional vegetation growth on the interior north wall. Signs of water intrusion are visible
 along with mildew. Joint mortar is deteriorating such that bricks are beginning to displace
 where vegetation is growing. Removal of vegetation, and restoration or replacement of the
 bricks and repointing of the masonry mortar joints is needed.
- The southwest corner of the building is in poor condition where cracks in bricks and water damage are prevalent adjacent to a corroding steel platform. Removal of corrosion and repainting of the platform is recommended.
- Large area of severely damaged/missing roof on east half of building. Replace roof as indicated in the original recommendation.
- Large broken concrete sections with corroding exposed rebar was noted supporting the main center equipment and platform. These concrete areas need to be repaired or replaced to original conditions.

Building III Updated Findings and Recommendations

- Several large holes located in the east interior brick wall. Refill with bricks and mortar to provide wall stability and capacity.
- Damaged/corroded/displaced embed angles at corner edges of the concrete slab and floor trenches is typical throughout. Repair, removal, or replacement of the embedded angles is necessary if intended to reuse.
- Concrete slab and floor trenches generally in very poor/broken condition. Repair or replacement of the cracked areas is necessary.
- Northwest area of roof and supporting joists are showing signs of water-damage / deteriorating wood. Repair or replacement is necessary.
- Corrosion noted at column base plates continues to be exposed to moisture and exterior conditions due to opening in roof and has likely continued to deteriorate.

Building IV Updated Findings and Recommendations

• Upper north wall is missing. Construction of new wall is required.

- Very large hole in west brick wall shared with Building III is at least currently partially shored with plywood as temporary support. Refill with bricks and mortar to restore full stability is required.
- Corrosion noted at structural steel members continues to be exposed to moisture and exterior conditions due to opening in roof and has likely continued to progress.

Building V Updated Findings and Recommendations

• Corroded pipes penetrating west wall. Repair or replace pipes if function is still required.

5. Qualification of Report

Wood performed a visual structural assessment of the buildings' roof and its framing members, platforms, floor and walls of the KWDP. The site visit was focused on assessing and recording any possible new deficiency associated with the structural components and members of the buildings since the report dated 2018. Observations were made from the ground, and an elevated equipment platform. No architectural finishes were removed during the site visit.

The recommendations presented are based on the objective to present repairs which will keep the asset stable and water-tight during the hurricane season. Performance of a comprehensive structural analysis is beyond Wood's scope of services.

The Opinion of Probable Construction Costs is made on the basis of Wood's judgment, as experienced and qualified professionals generally familiar with the construction industry. However, since Wood has no control over the cost of labor, materials, equipment, or services furnished by others, or over the construction contractor's methods of determining prices, or over competitive bidding or market conditions, Wood cannot, and does not, guarantee that proposals, bids, or actual construction cost will not vary from the Opinion of Probable Construction Costs prepared herein. We have attempted to consider all relevant aspects of the work and site conditions, based on information made available to us at this stage of the project. All costs are based on sources noted in Appendix C.

Closing

Wood appreciates the opportunity to be of service to you and the City of Key West and look forward to contributing to the success of this project. Should you have any questions, please contact the undersigned

Sincerely,

Wood Environment & Infrastructure Solutions, Inc.

James Vincent, P.E.

Senior Engineer - Structural

Tirrell Day, P.E.

Senior Engineer – Structural Registered, Florida P.E.

No. 82160


Attachments: Appendix A – Field Notes from March 22, 2021


Appendix B - Photolog from March 22, 2021

Appendix C – Opinion of Probable Construction Cost

APPENDIX A

Field Notes

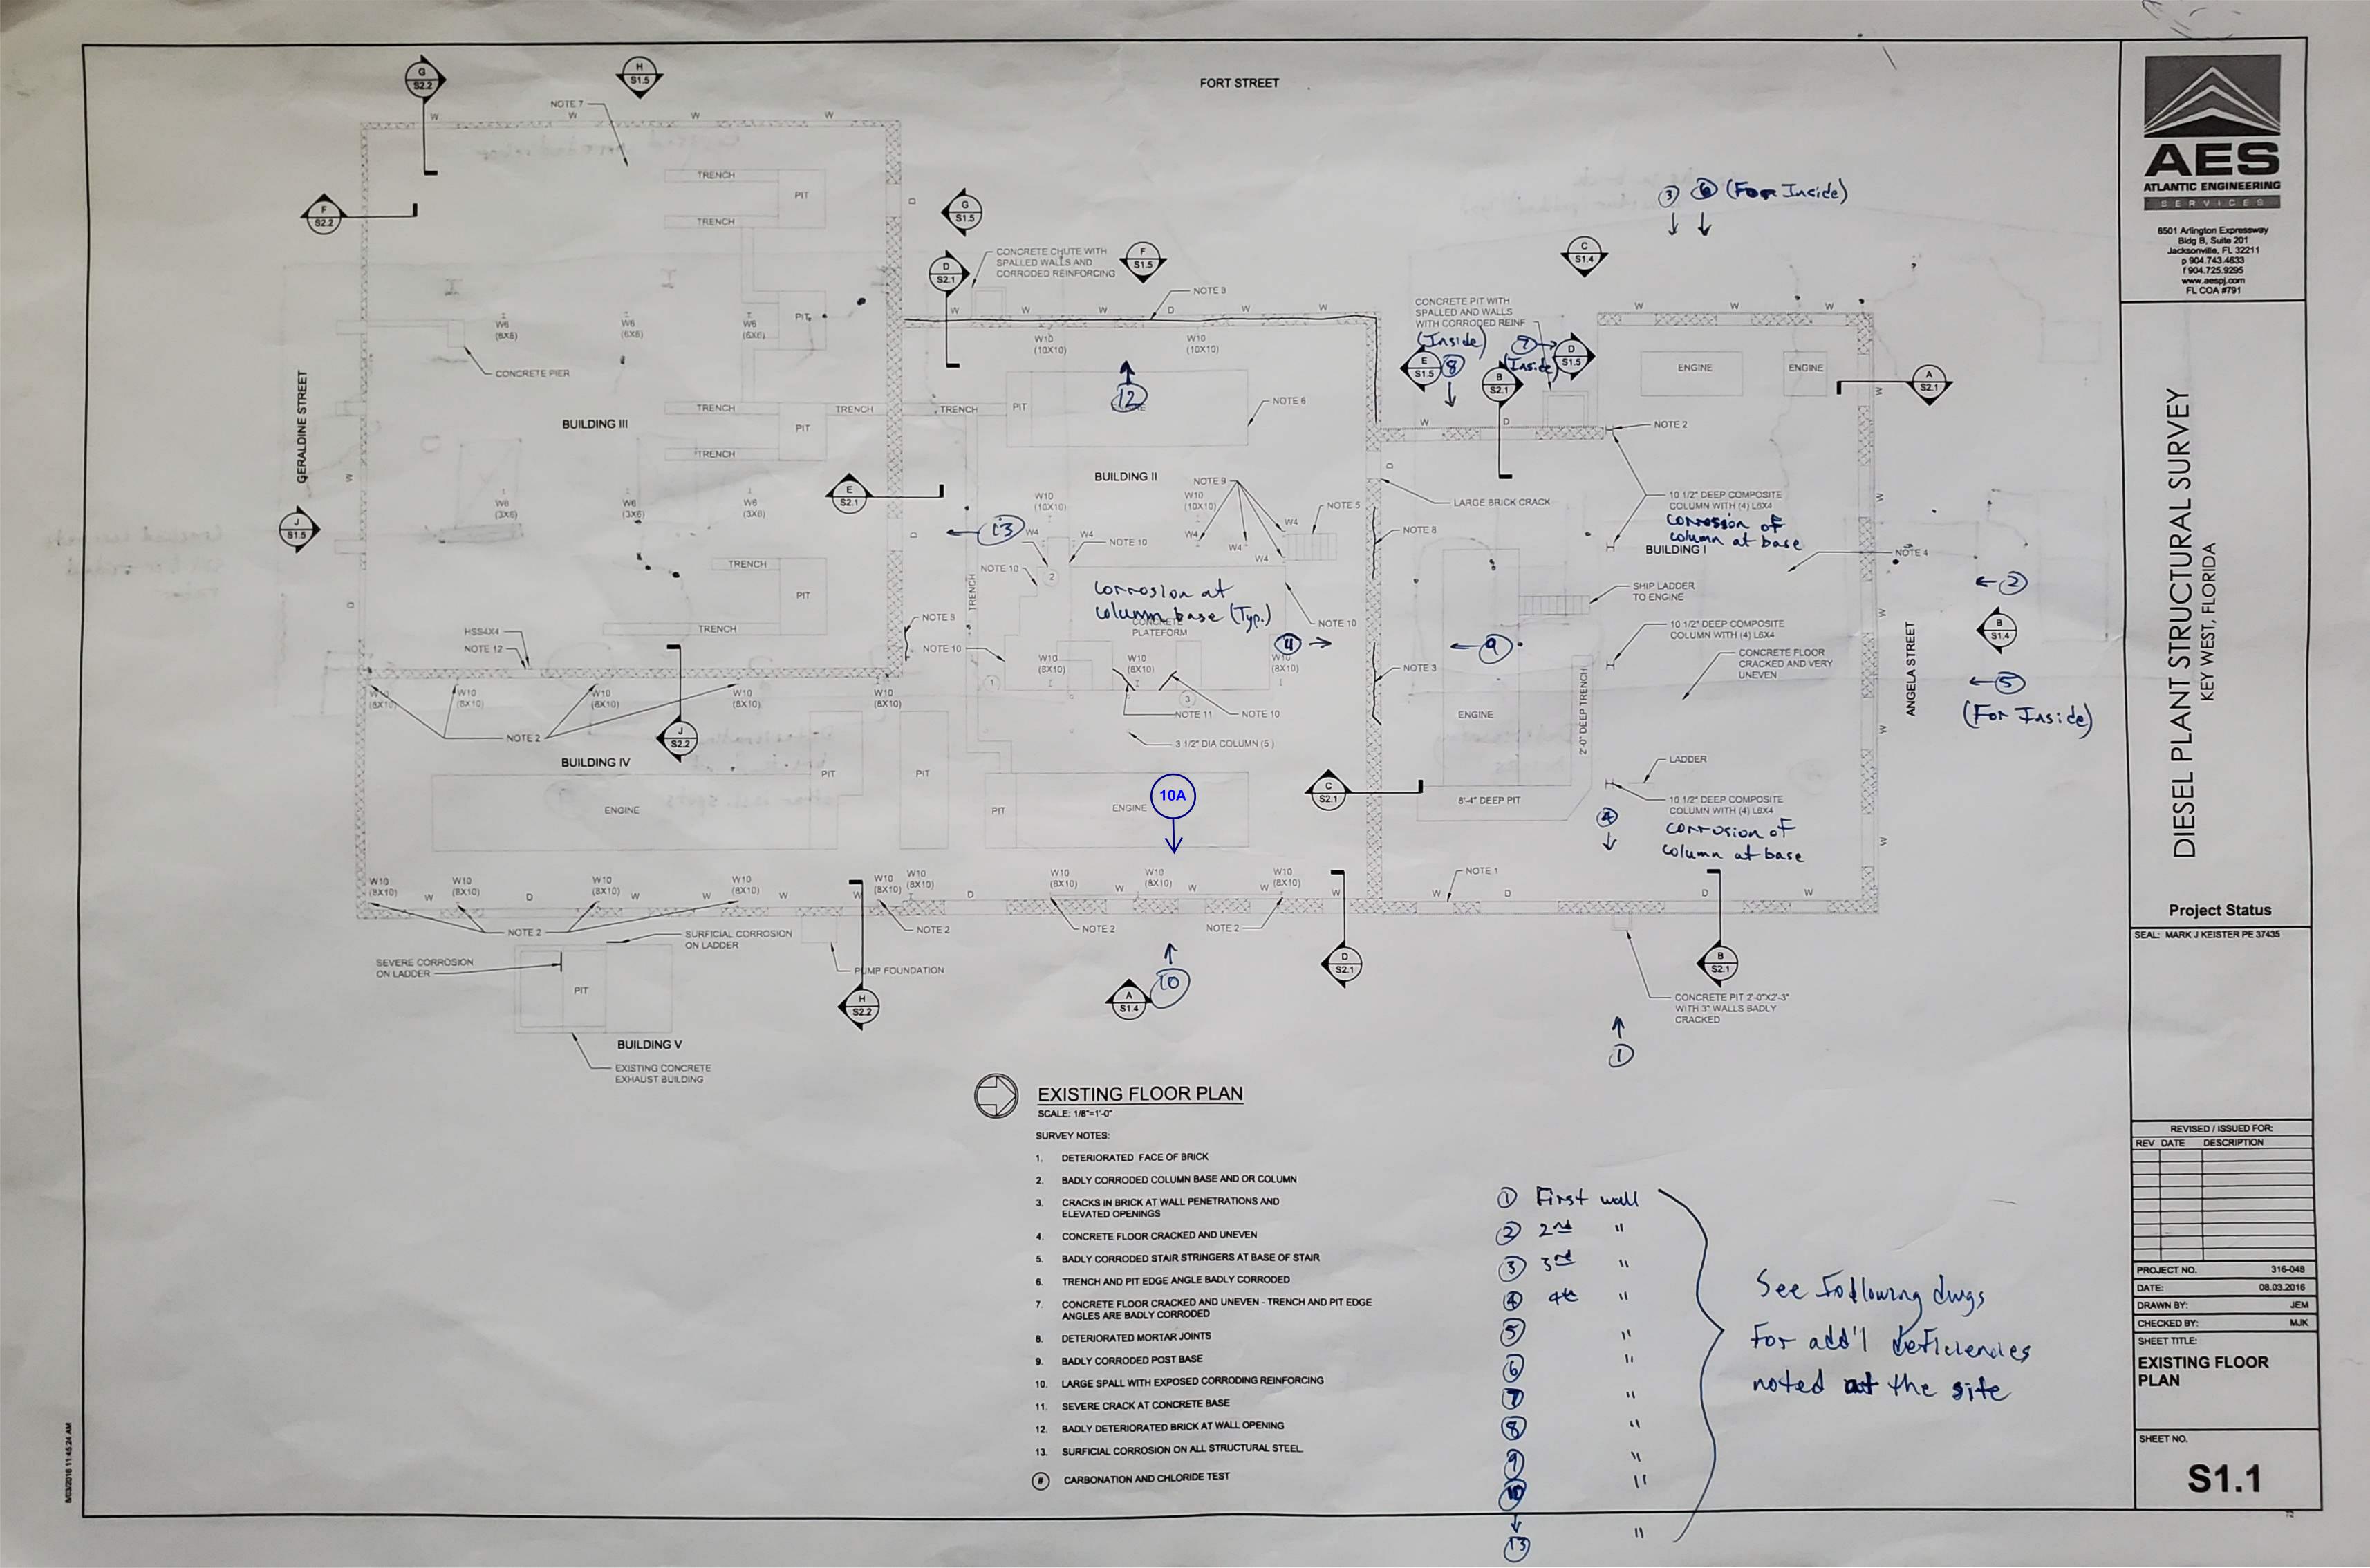

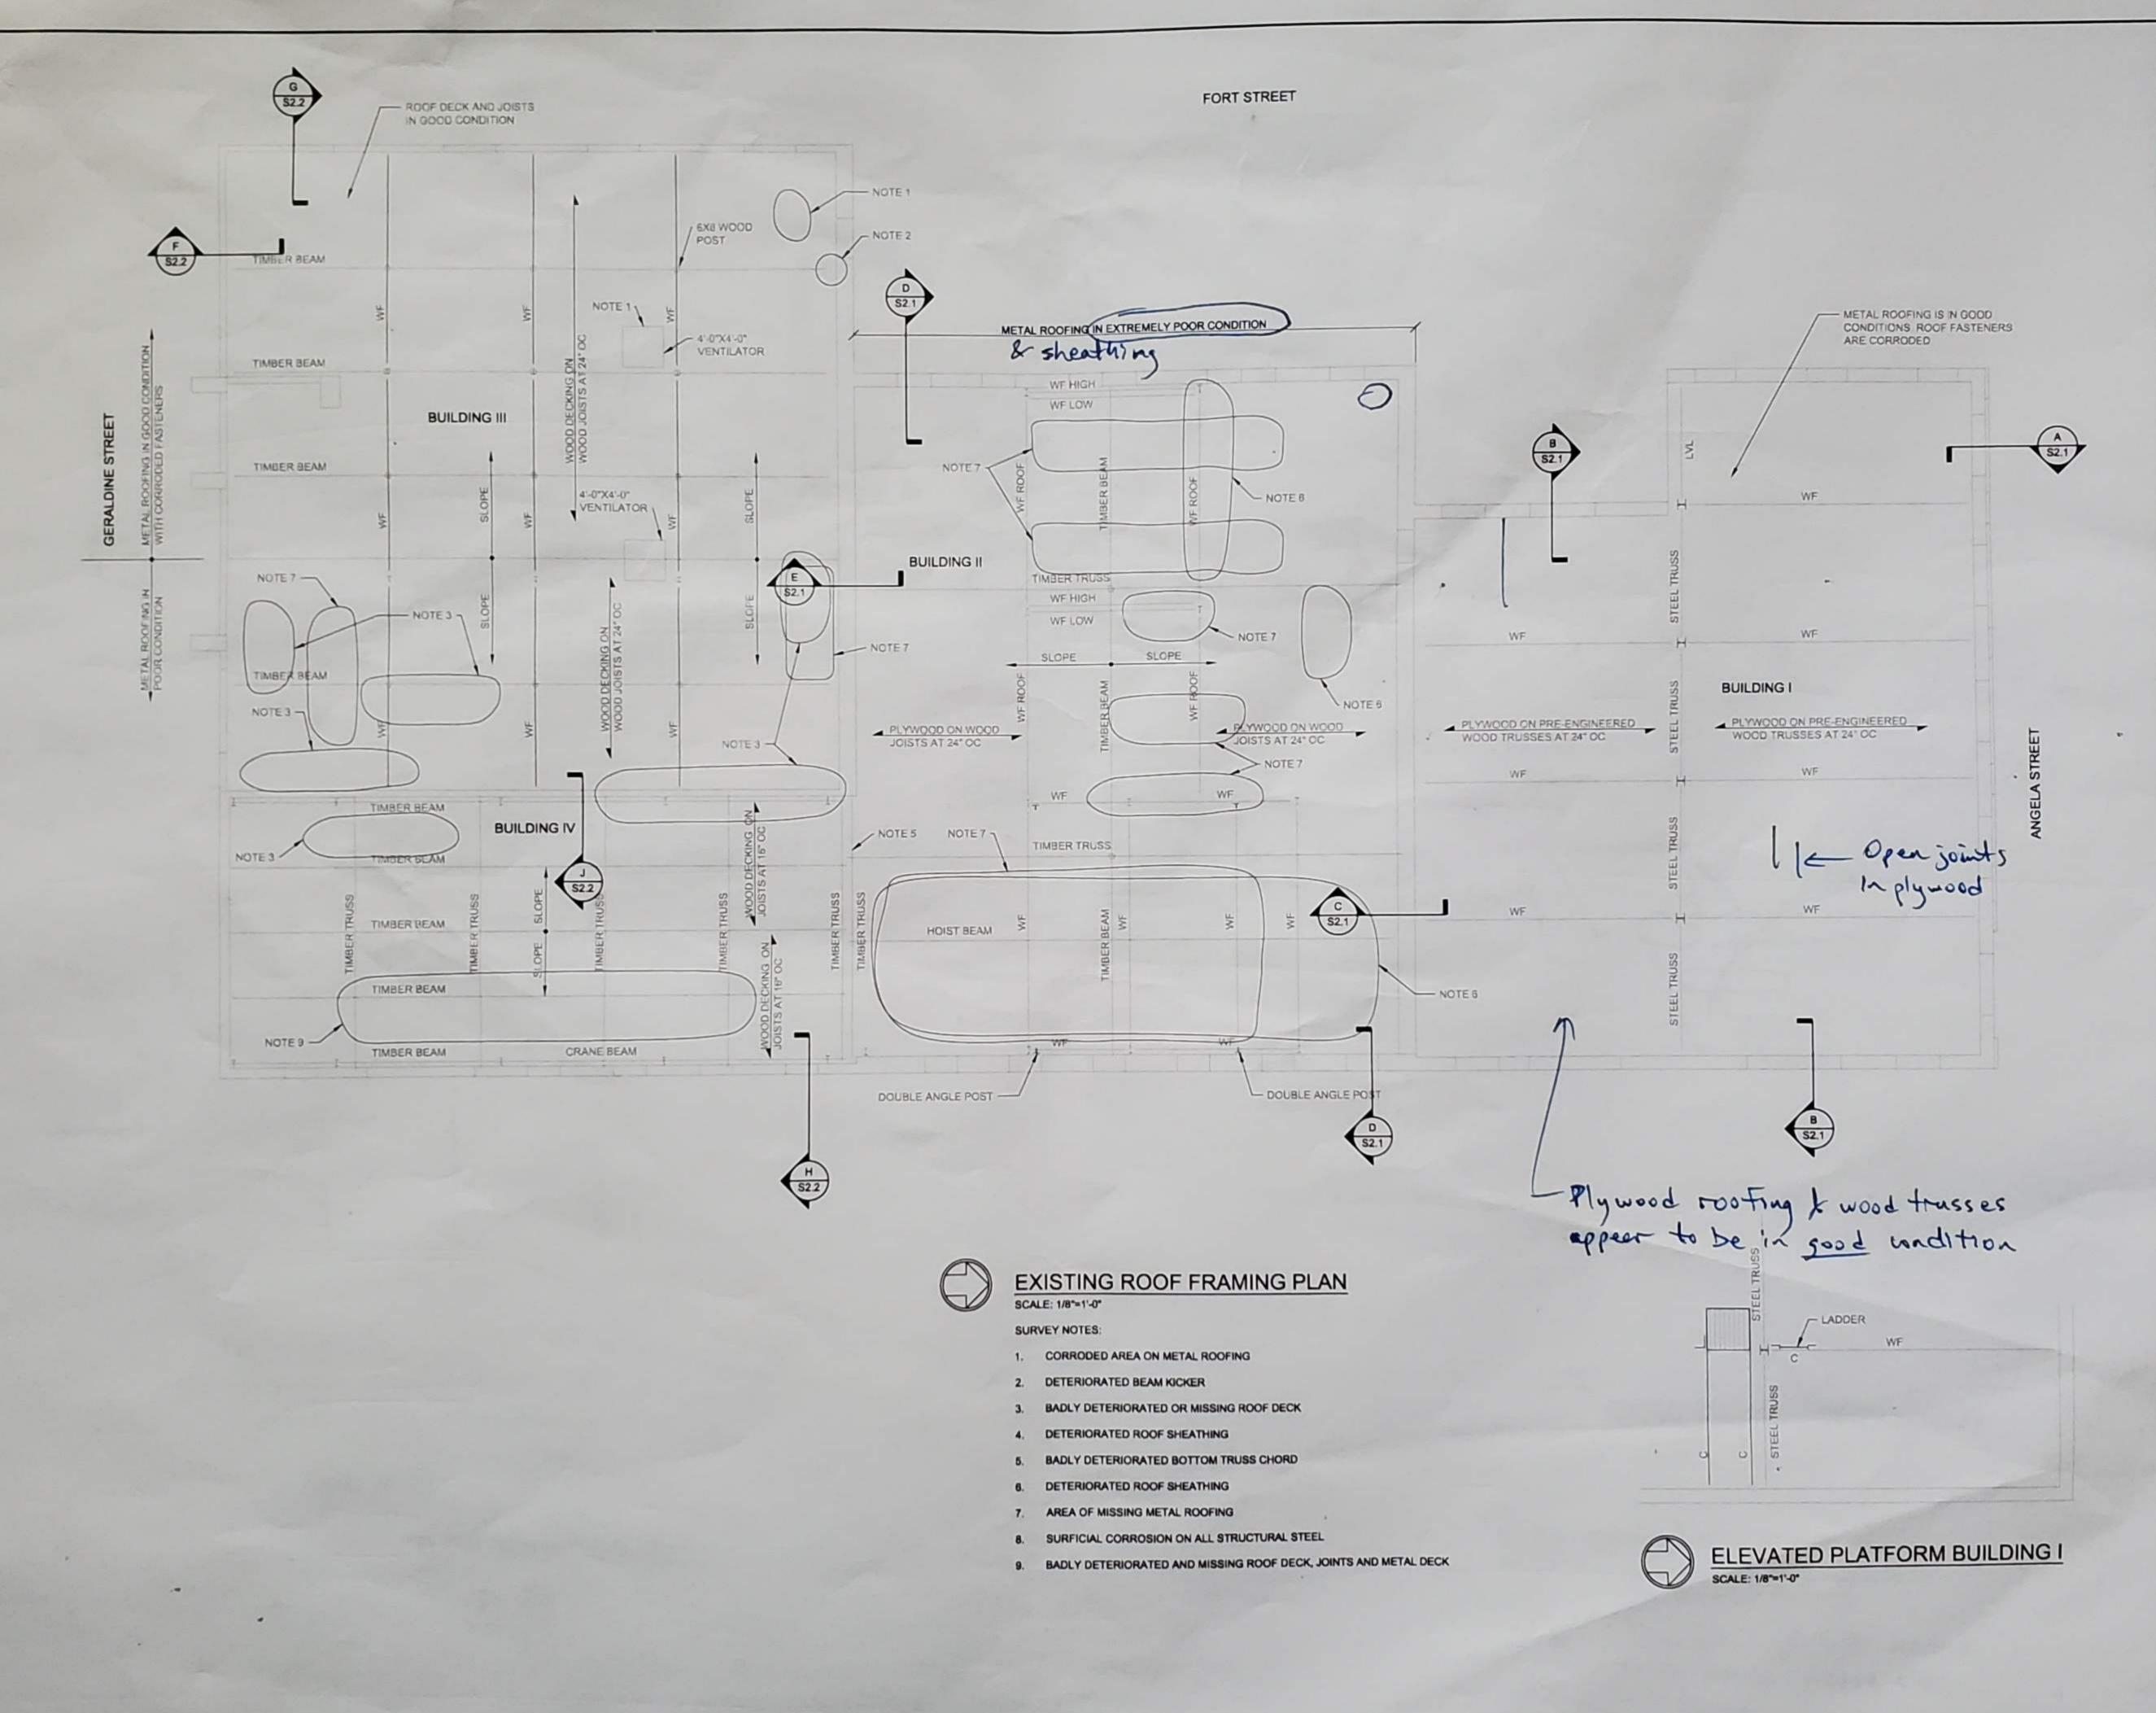

AES ATLANTIC ENGINEERING SERVICES

> 6501 Arlington Expressway Bldg B, Suite 201 Jacksonville, FL 32211 p 904.743.4633 f 904.725.9295 www.aespj.com FL COA #791

DIESEL PLANT STRUCTURAL SURVEY

Project Status

SEAL: MARK J KEISTER PE 37435

REVISED / ISSUED FOR:

PROJECT NO. 316-048

PROJECT NO. 316-048

DATE: 08.03.2016


DRAWN BY: JEM

CHECKED BY:

SHEET TITLE:

EXISTING ROOF FRAMING PLAN

SHEET NO.

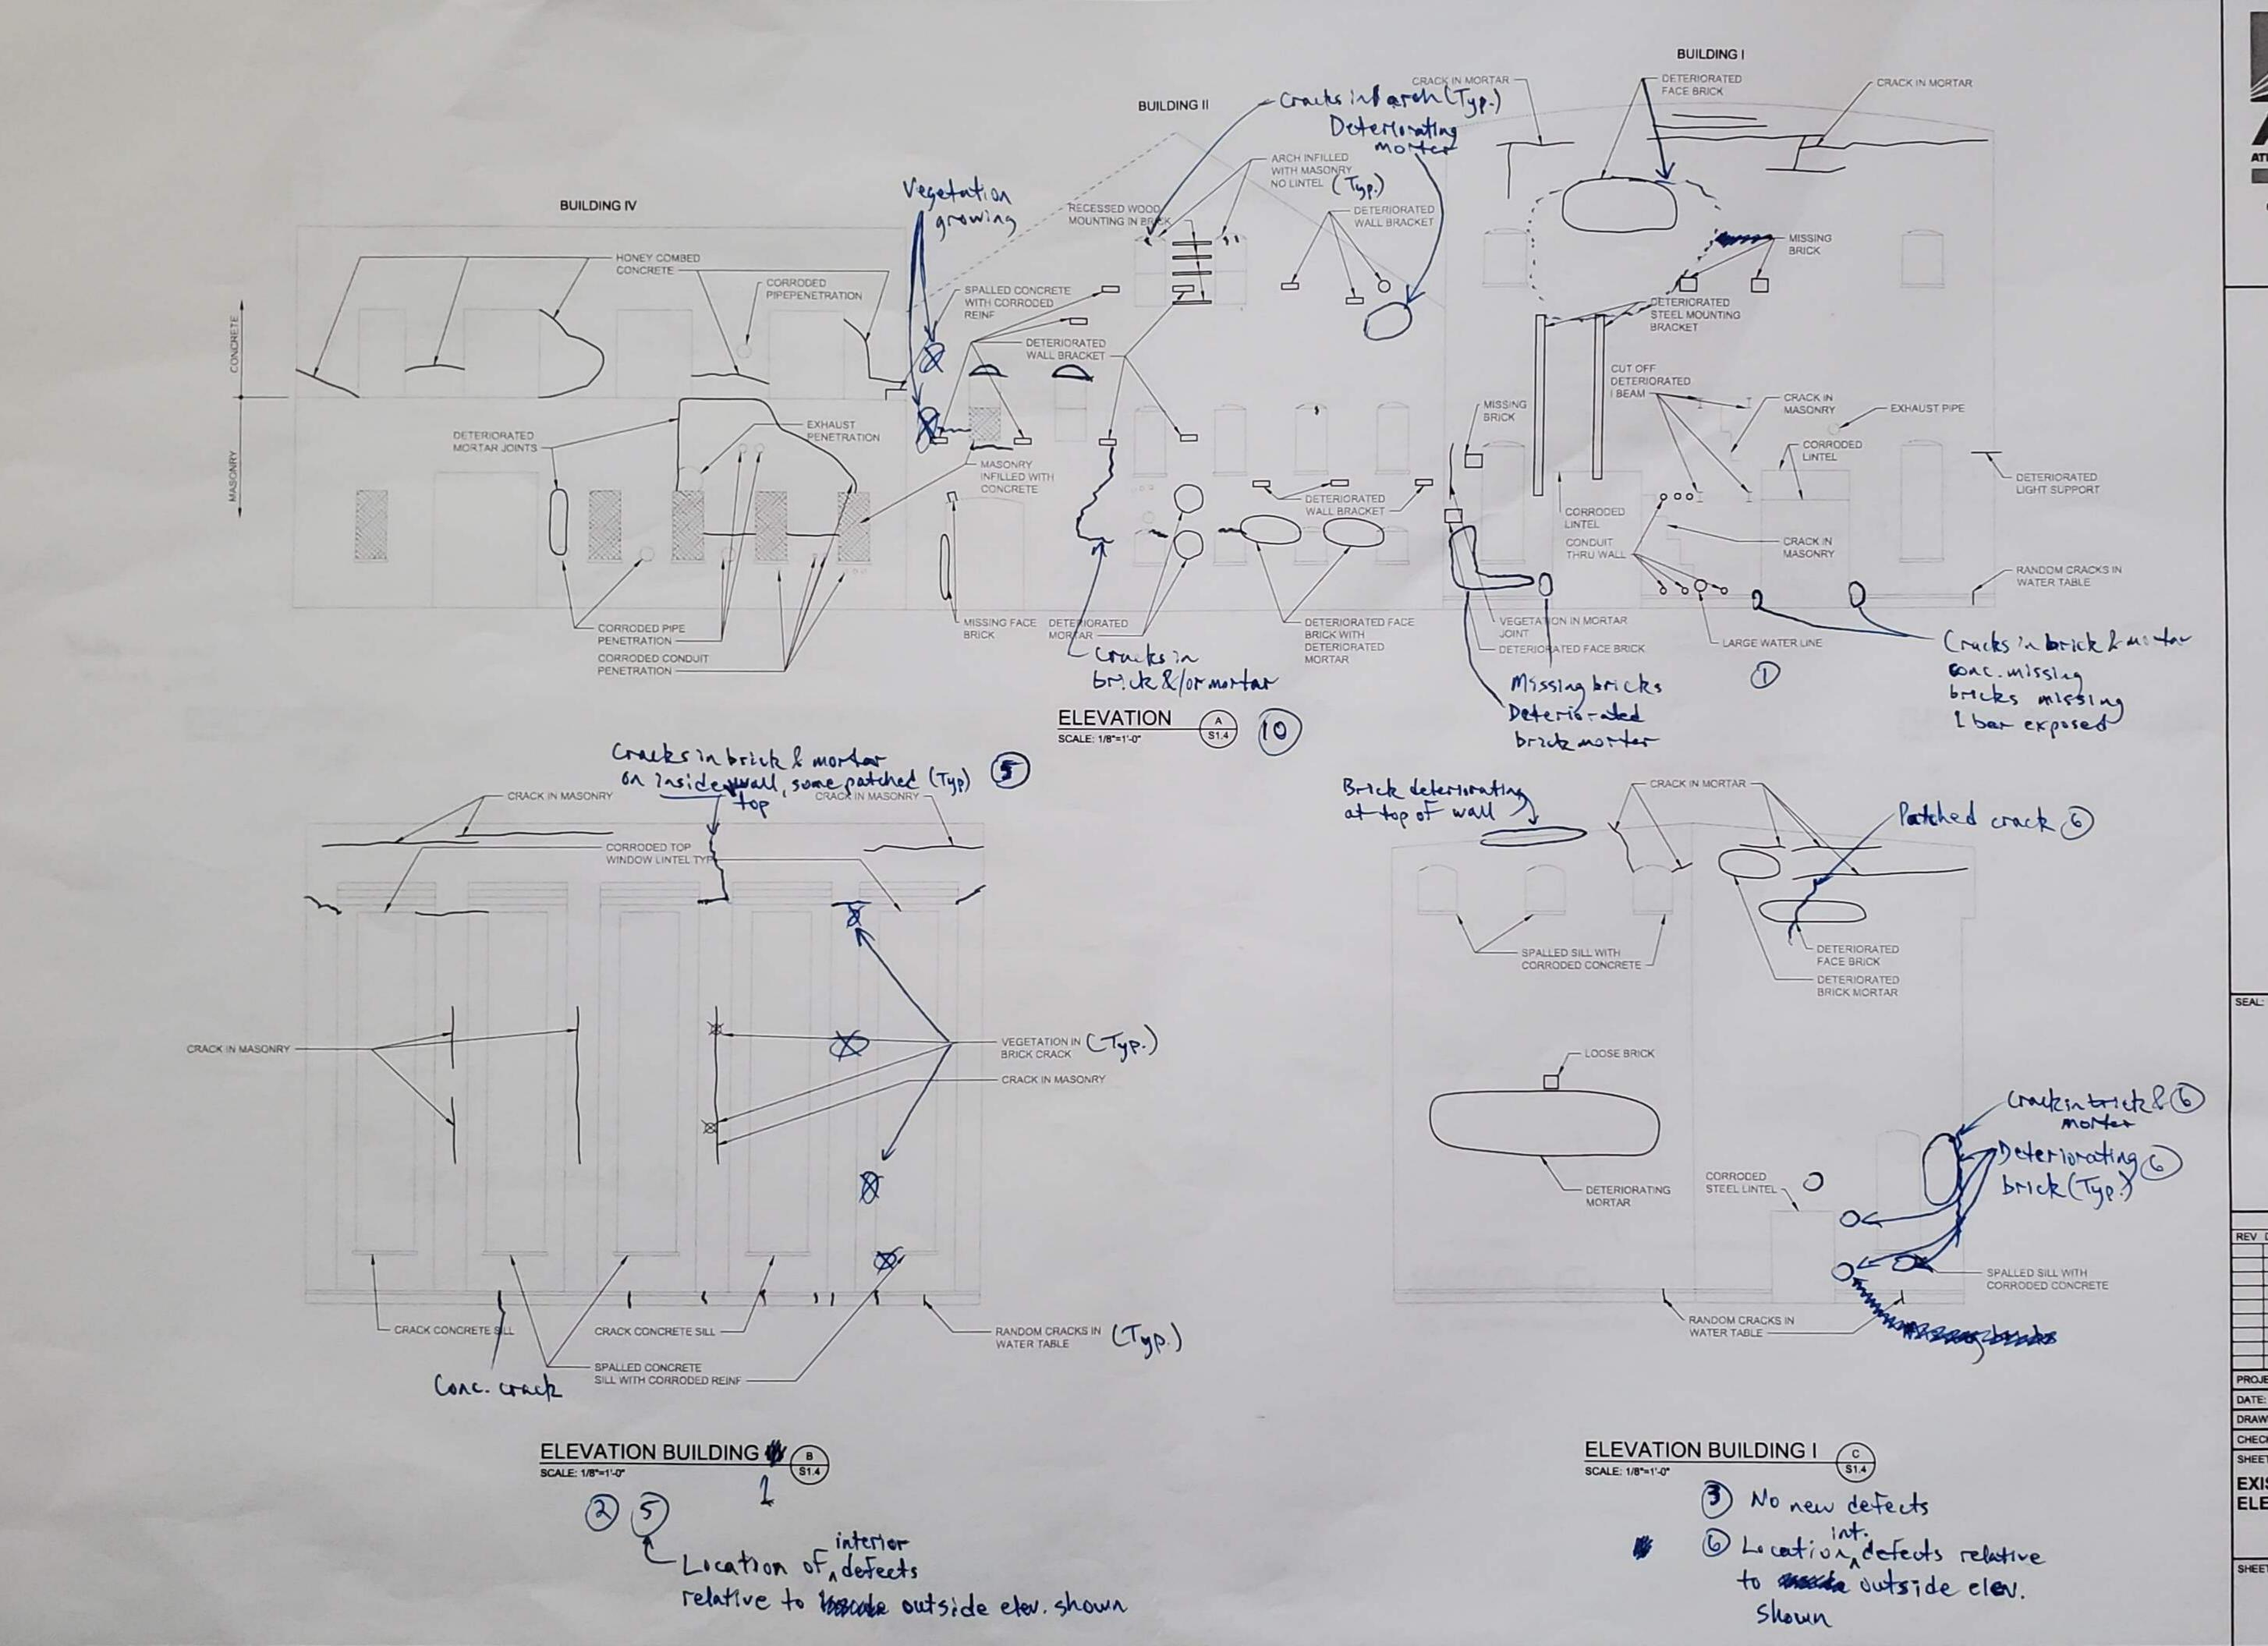

SERVICES

6501 Arlington Expressway Bidg B, Suite 201 Jacksonville, FL 32211 p 904.743.4633 f 904.725.9295 www.aespj.com FL COA #791

SURVEY ESEL PLANT STRUCTURAL KEY WEST, FLORIDA $\overline{\Box}$

Project Status

SEAL: MARK J KEISTER PE 37435

REVISED / ISSUED FOR: REV DATE DESCRIPTION


PROJECT NO.

316-048 08.03.2016

CHECKED BY: SHEET TITLE

EXISTING ELEVATIONS

SHEET NO.

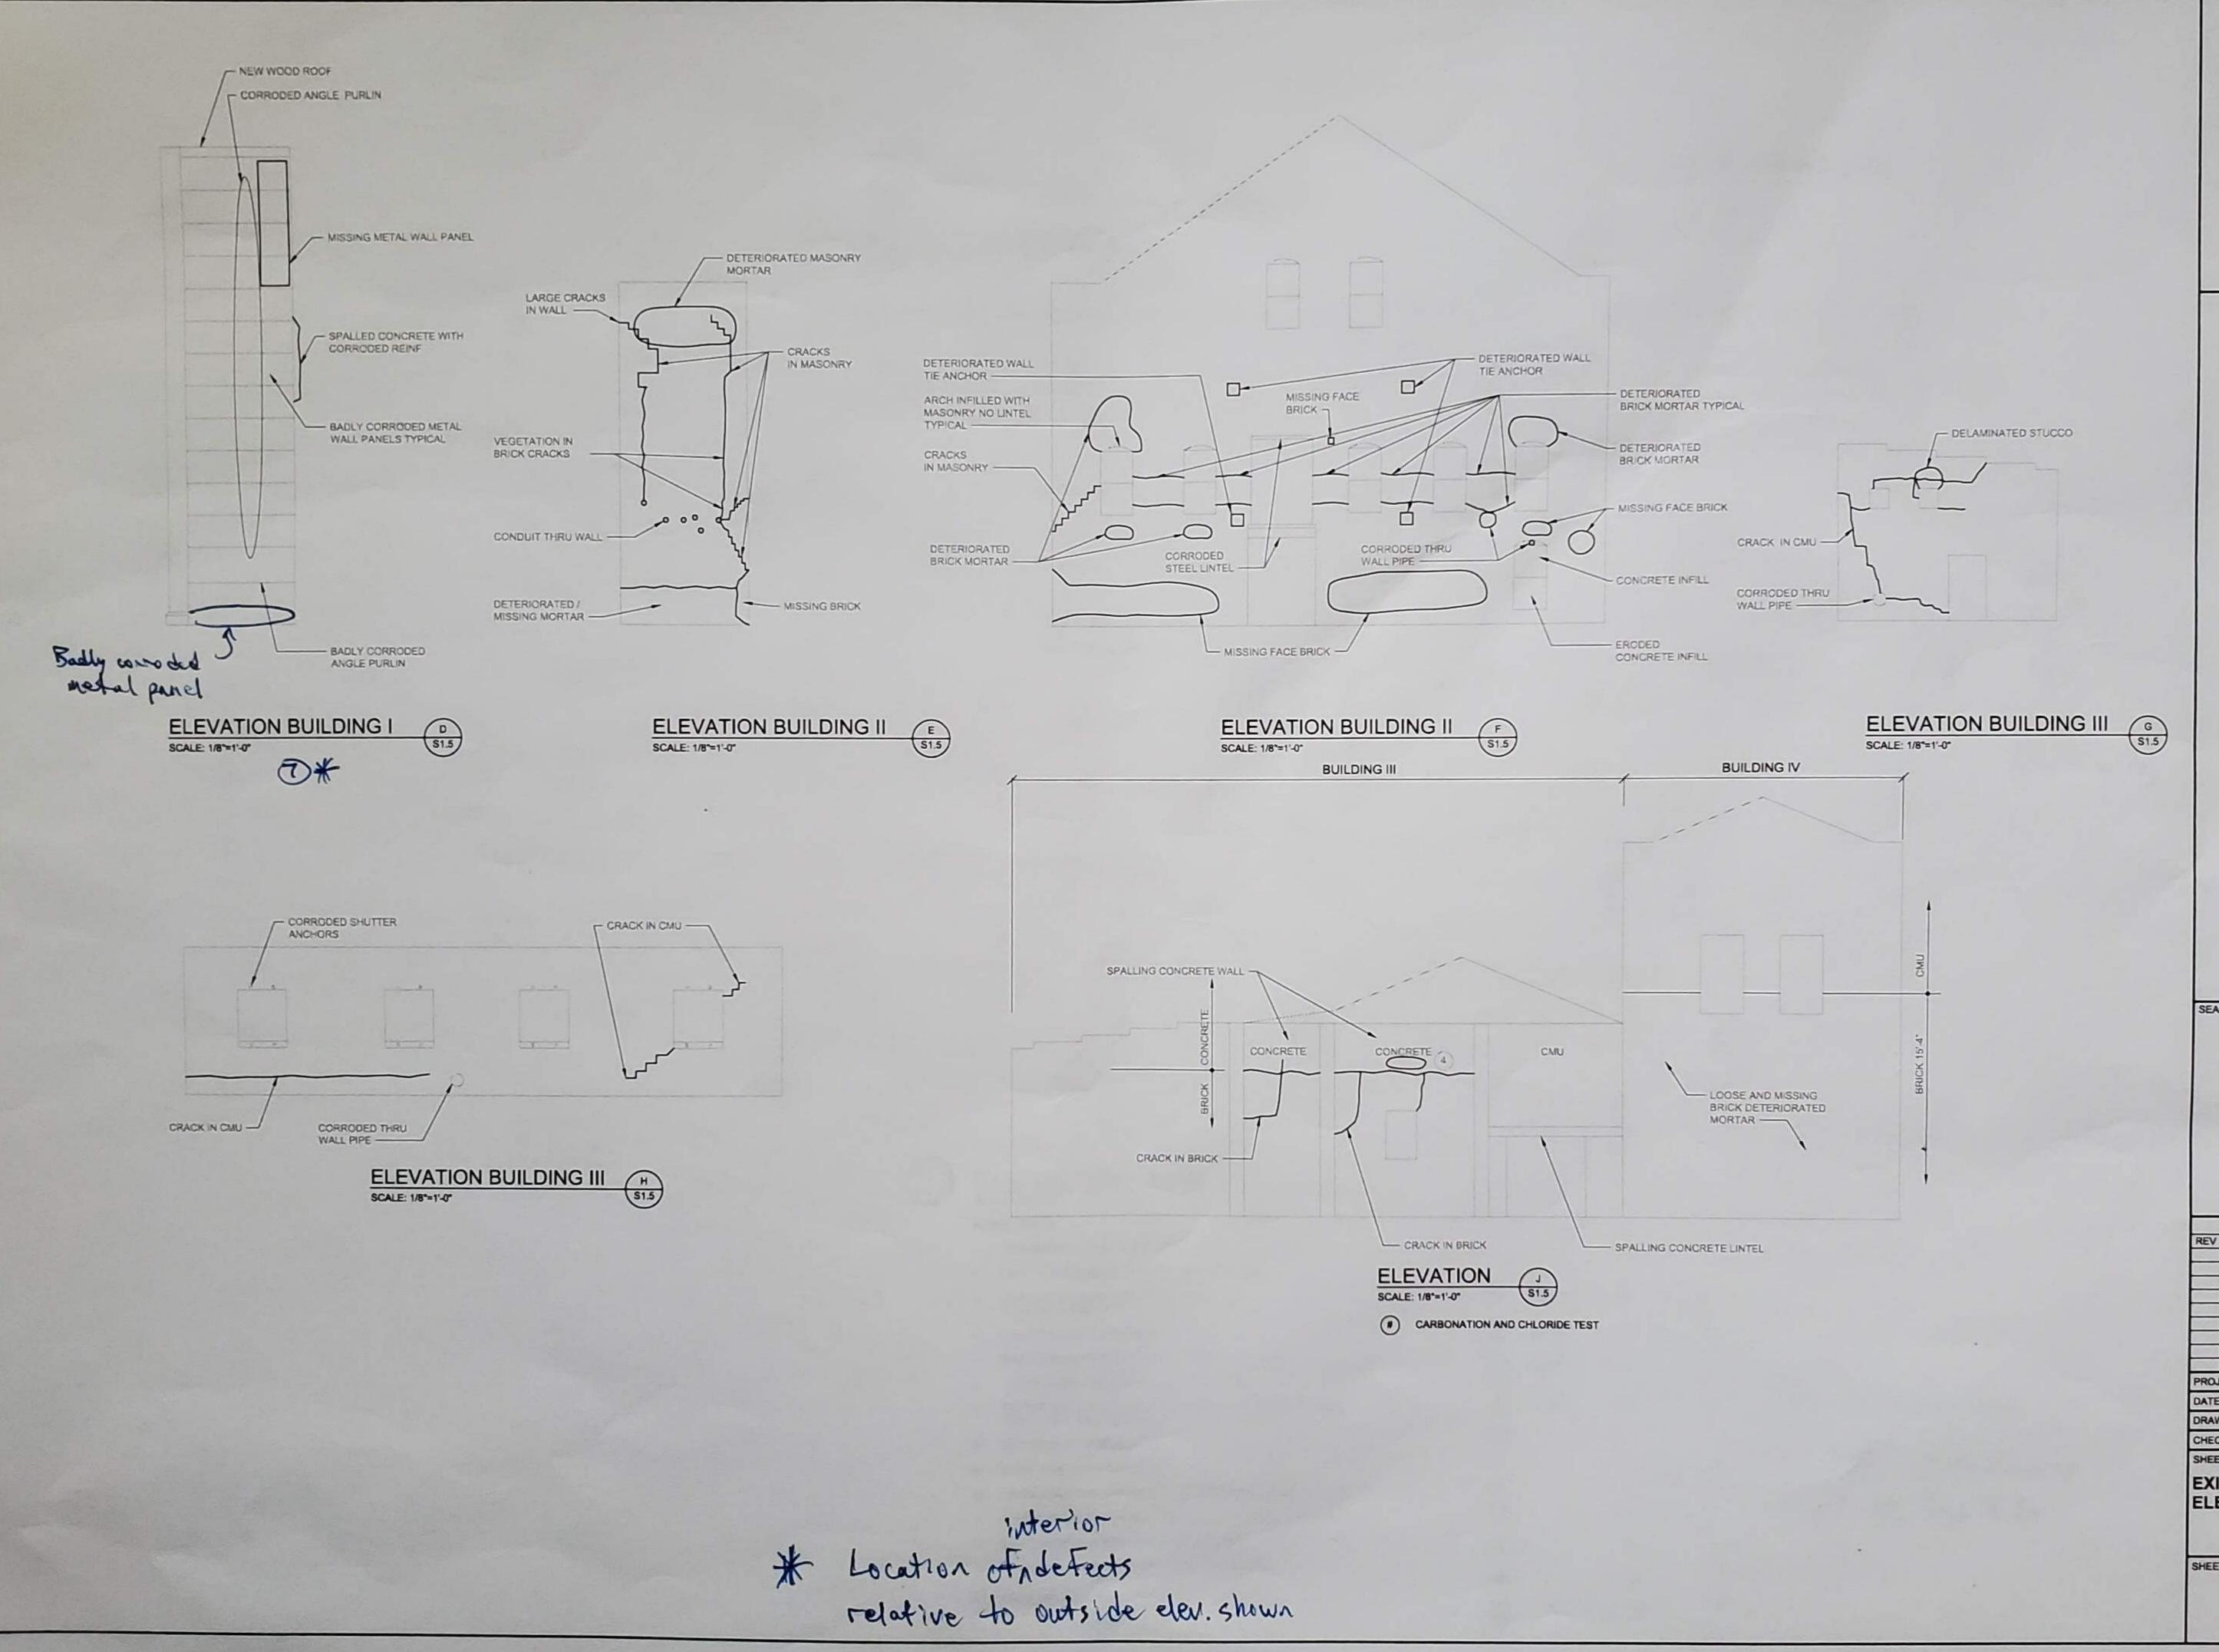

AES ATLANTIC ENGINEERING SERVICES

6501 Arlington Expressway
Bidg B, Suite 201
Jacksonville, FL 32211
p 904.743.4633
1 904.725.9295
www.aespj.com
FL COA #791

DIESEL PLANT STRUCTURAL SURVEY

Project Status

SEAL: MARK J KEISTER PE 37435


REVISED / ISSUED FOR:
REV DATE DESCRIPTION


ROJECT NO. 316-048
ATE: 08.03.2016

CHECKED BY: M.

EXISTING ELEVATIONS


SHEET NO.

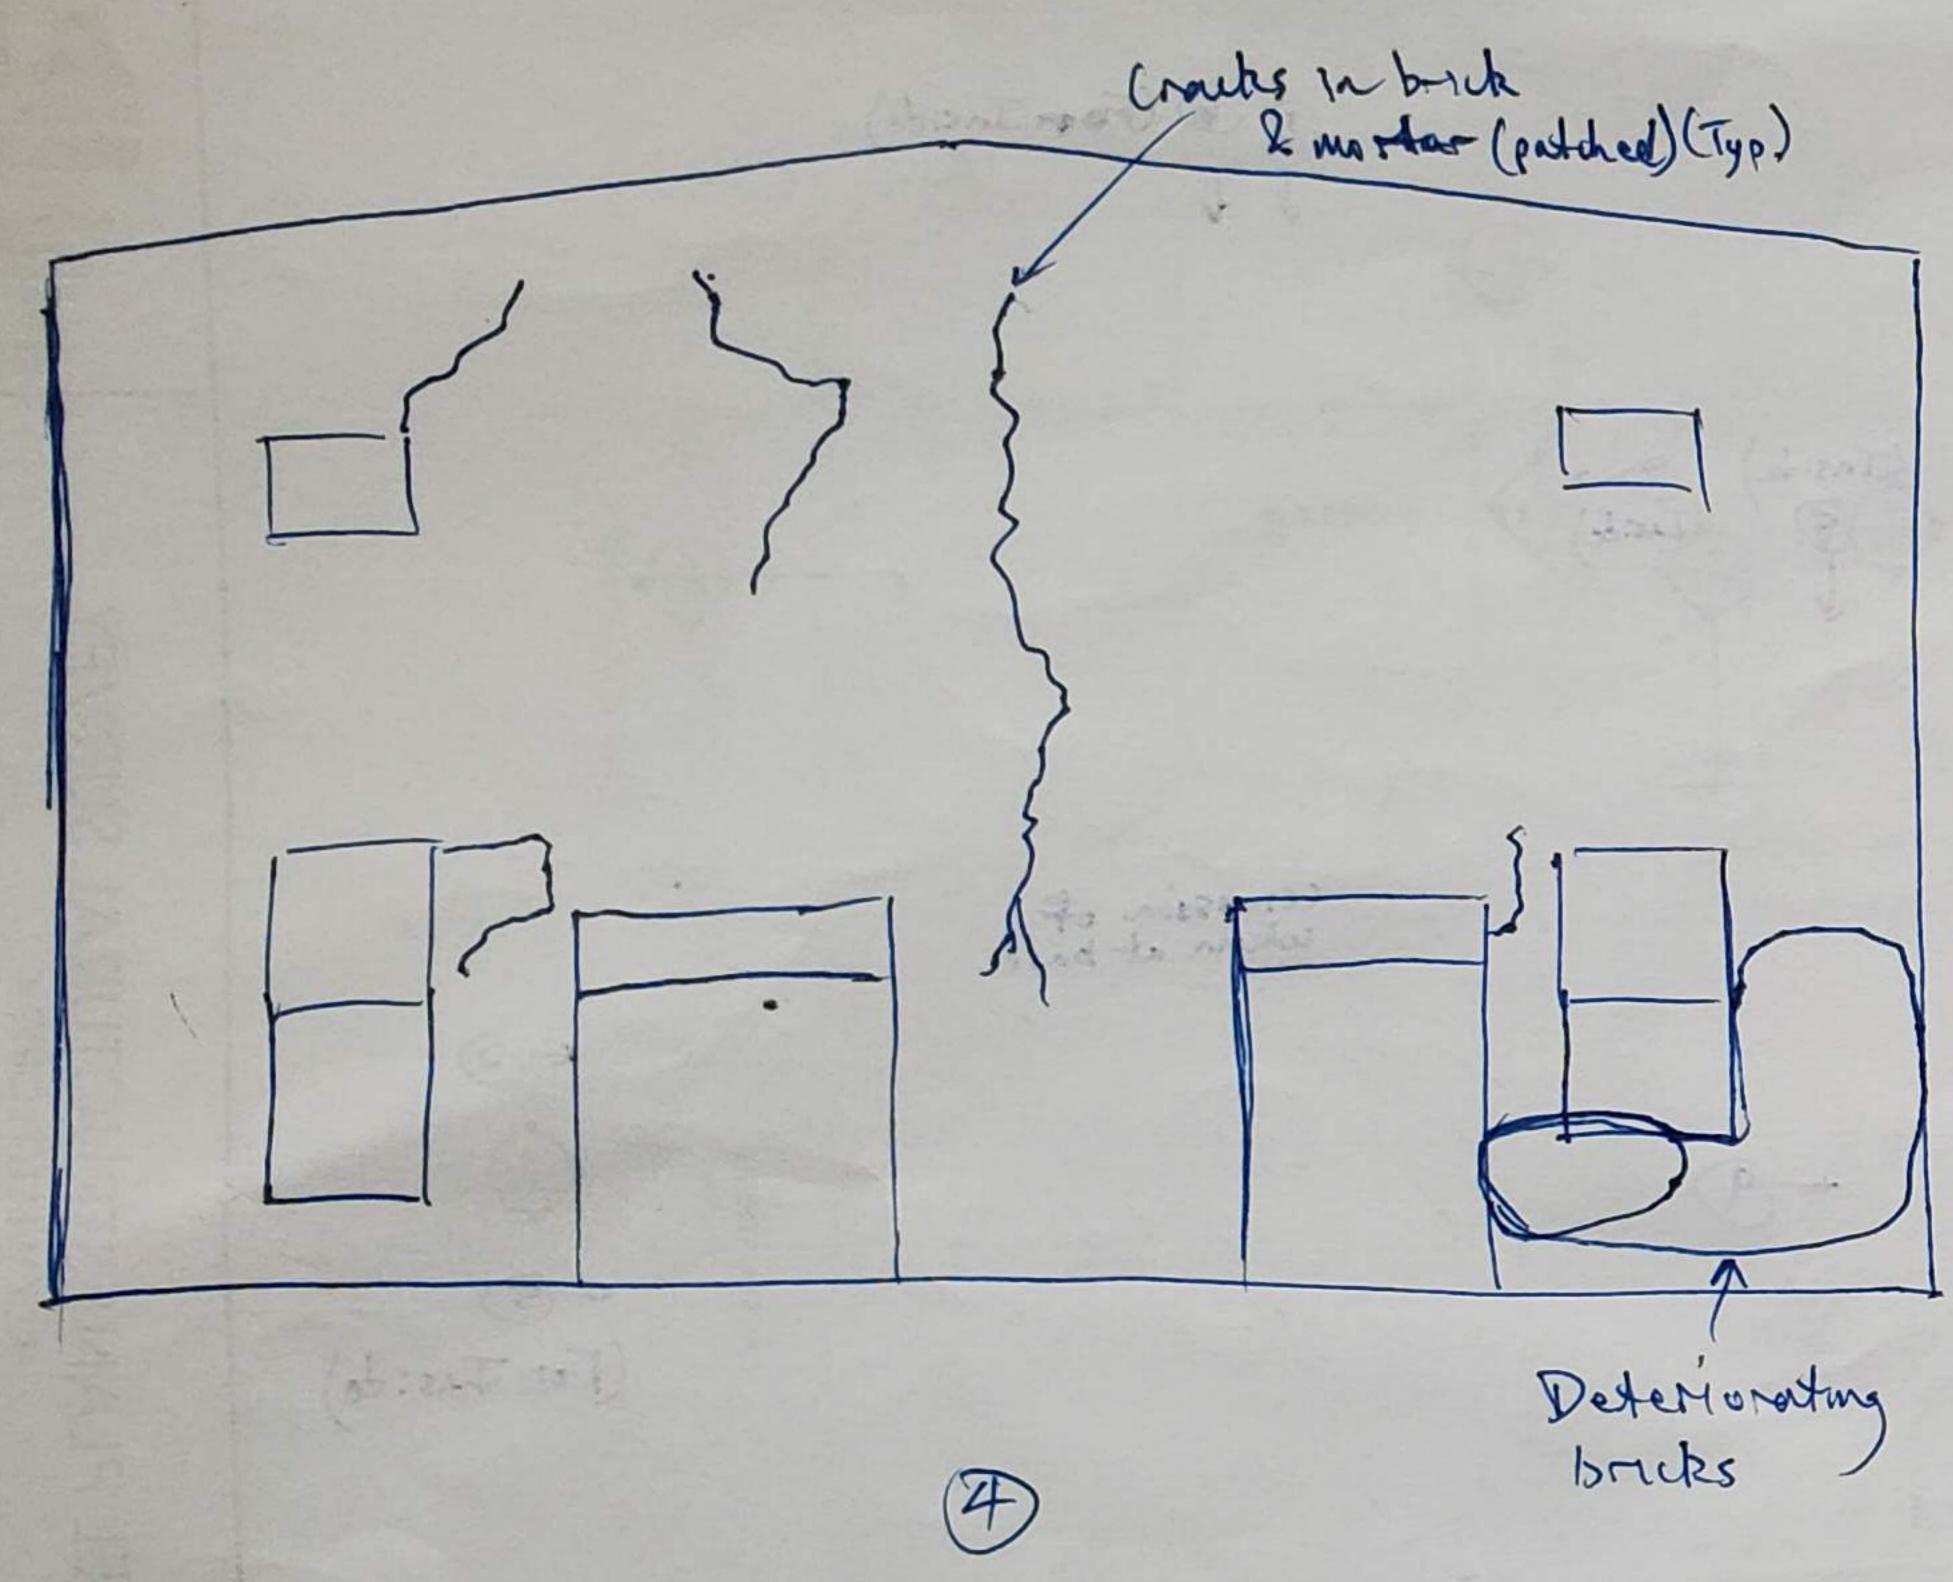


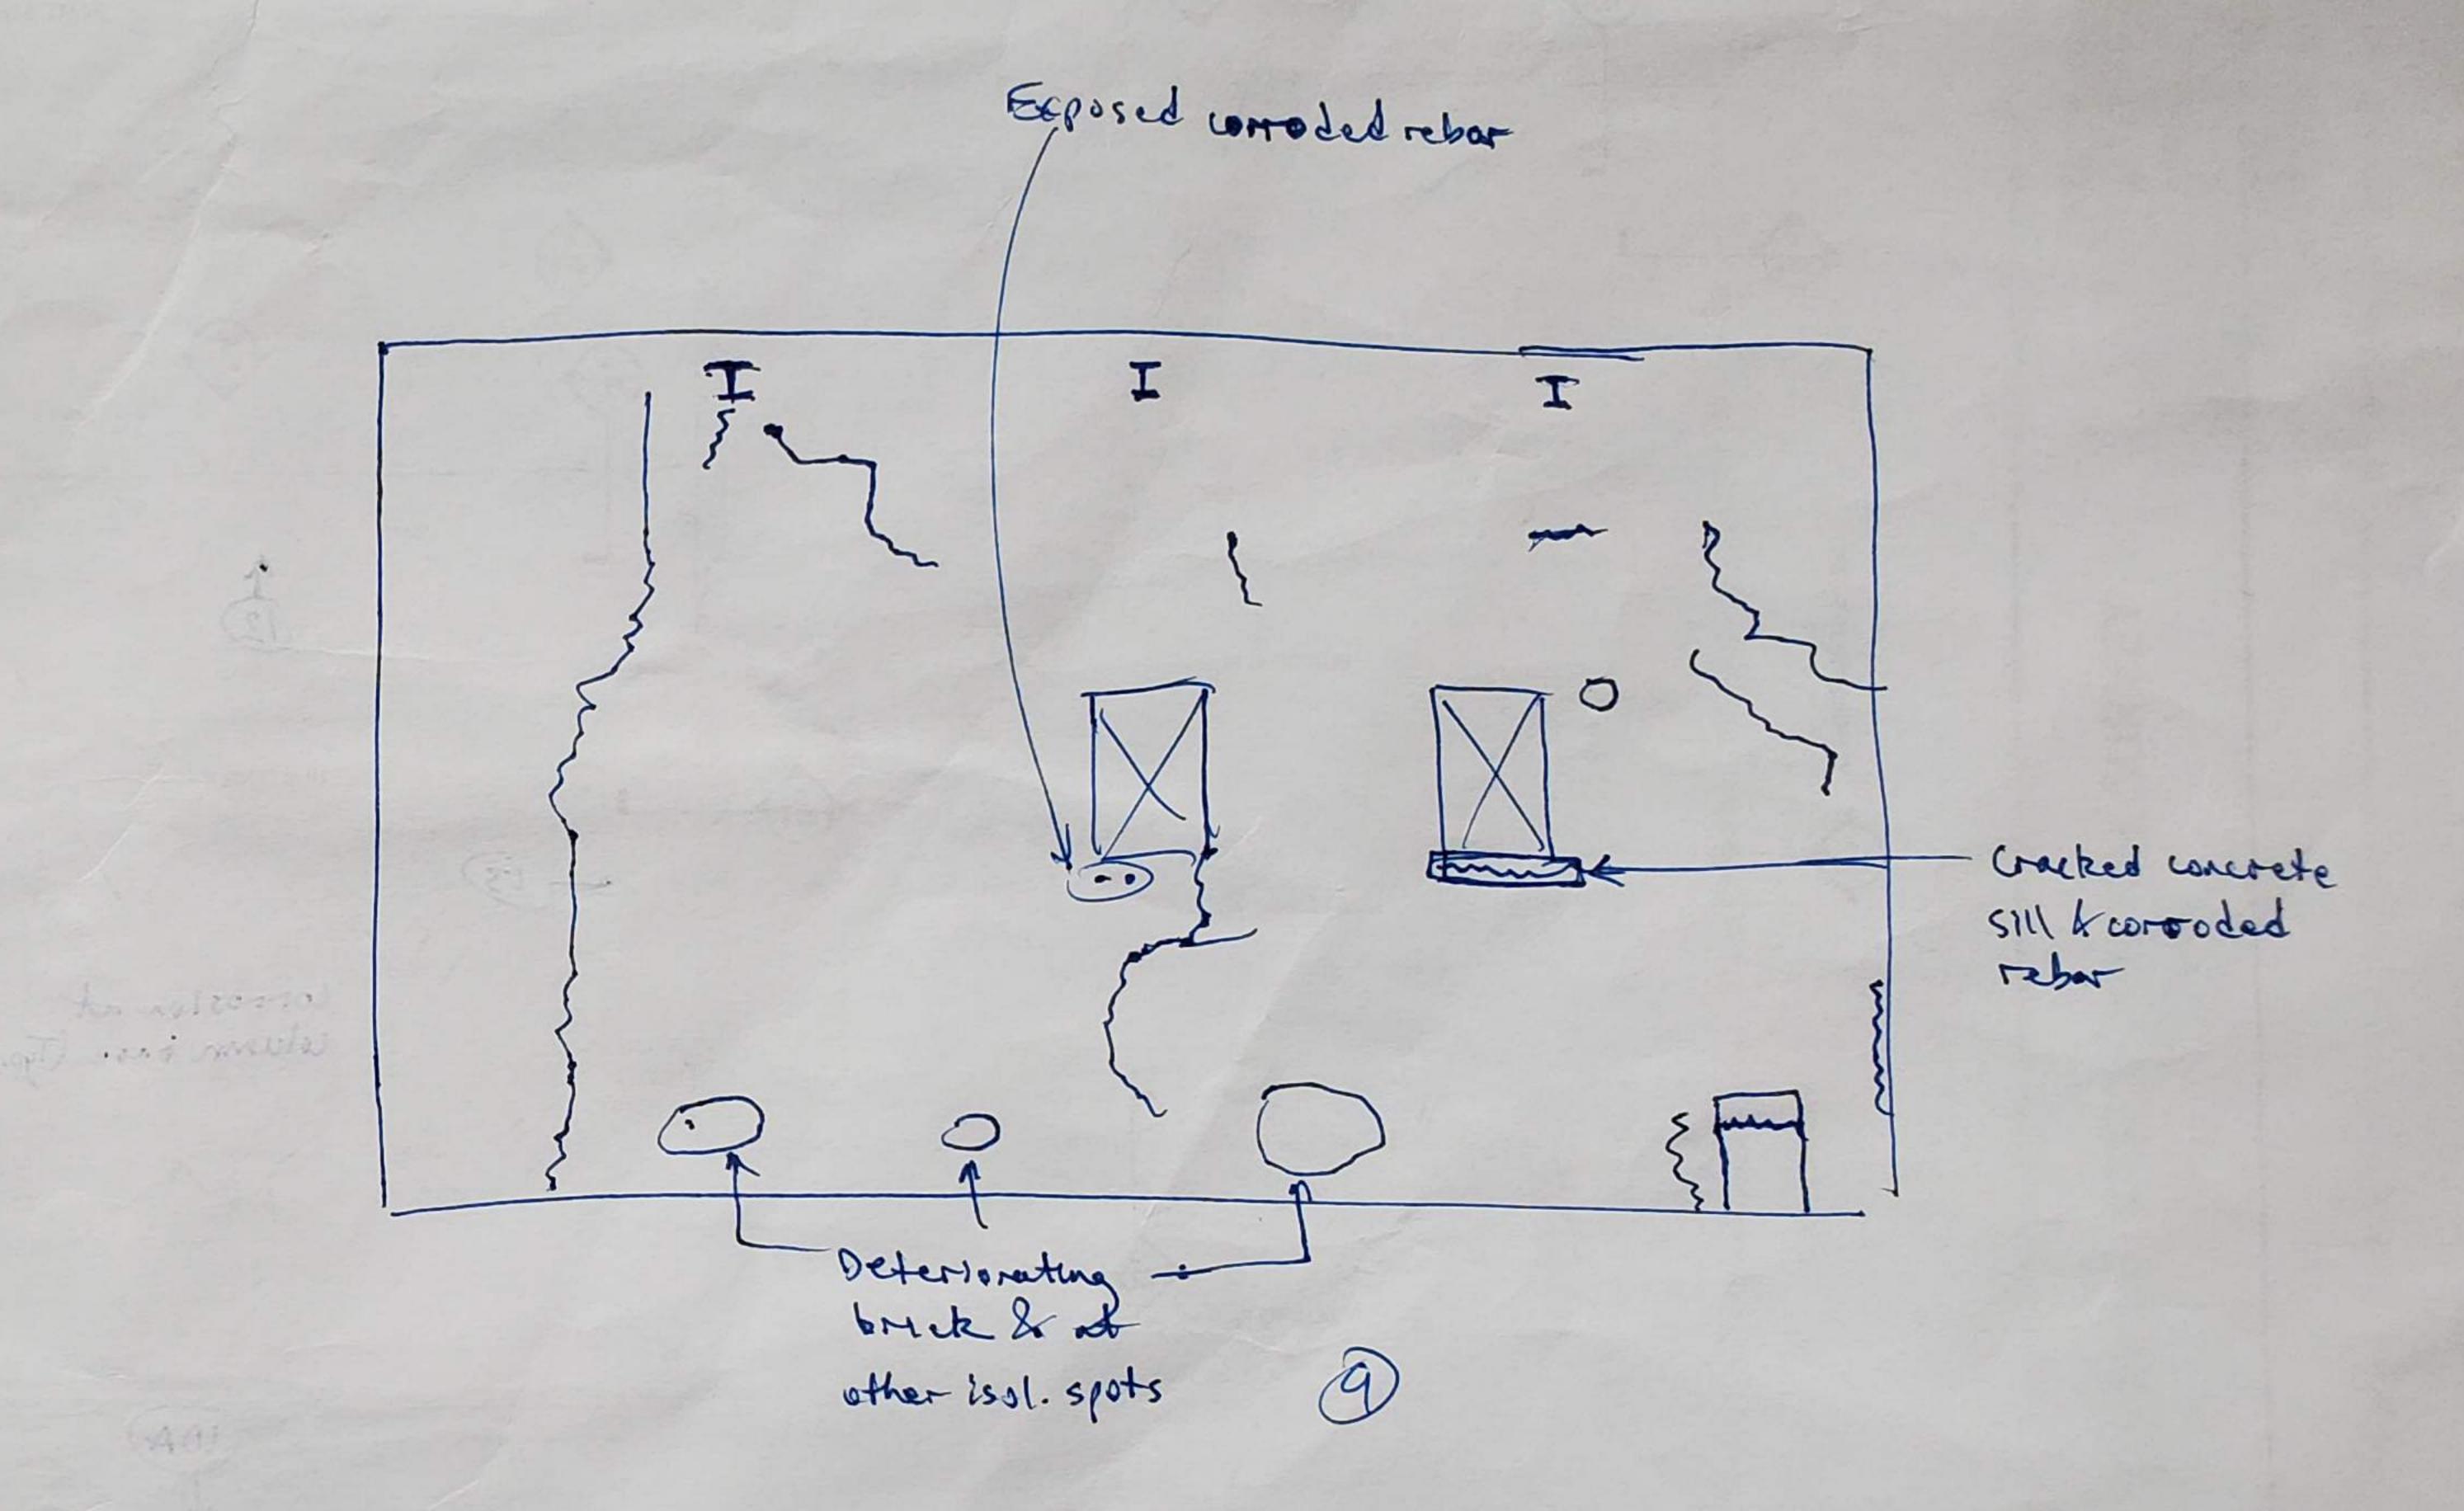



The same of


The Brick and were patchwork in poor condition throughout

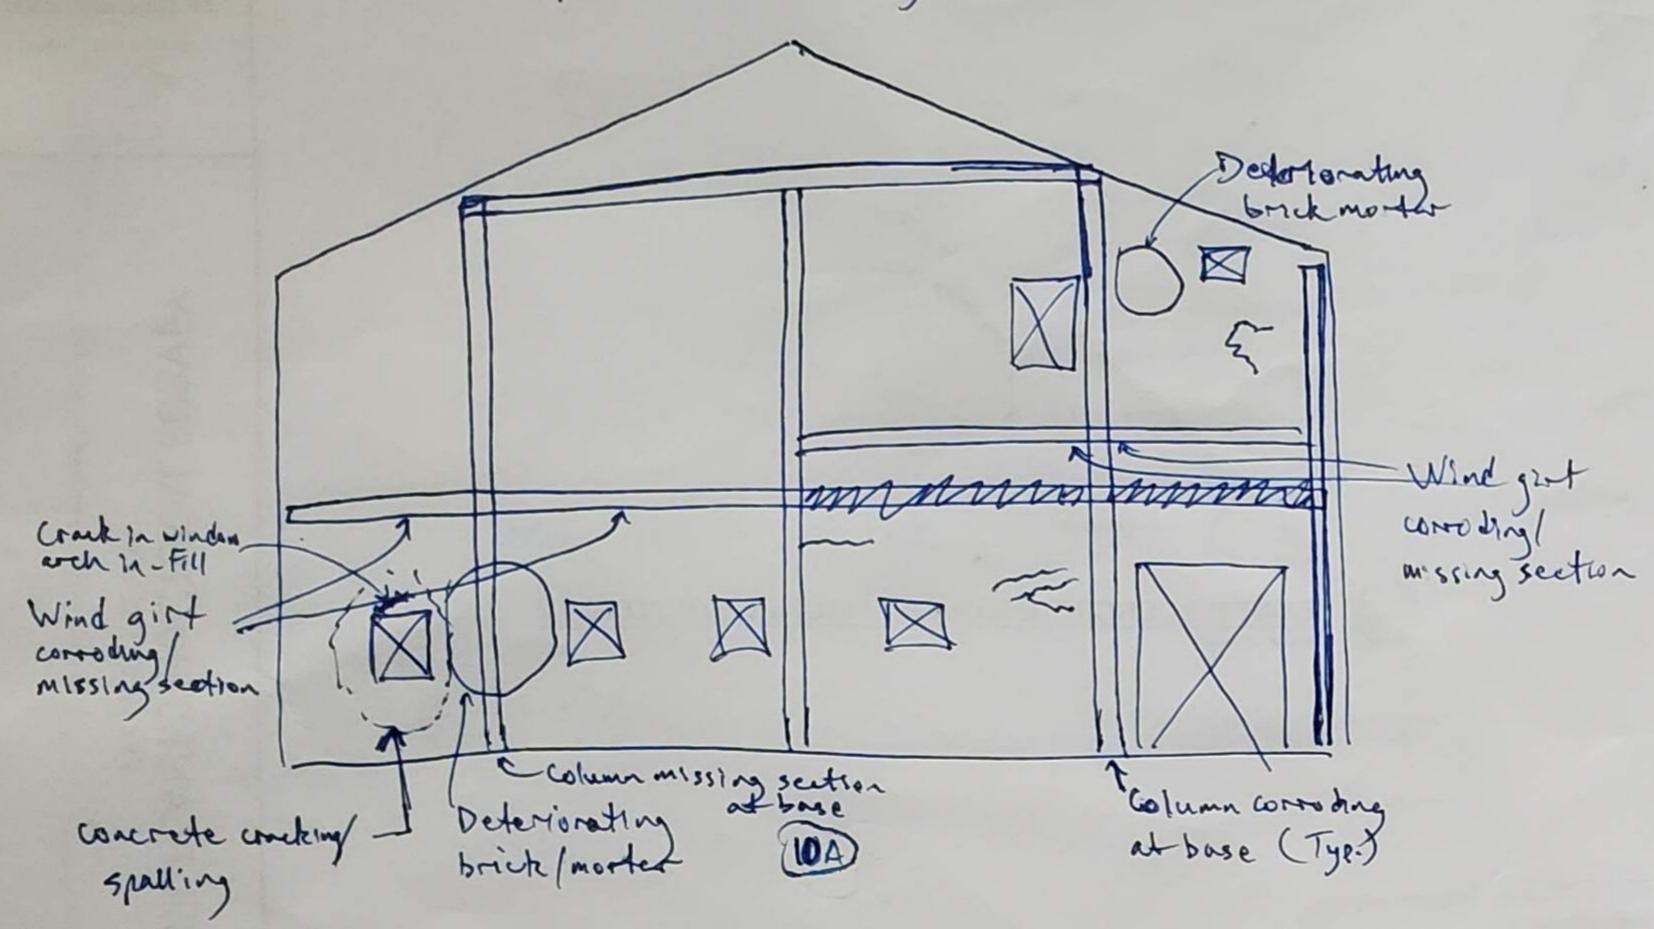

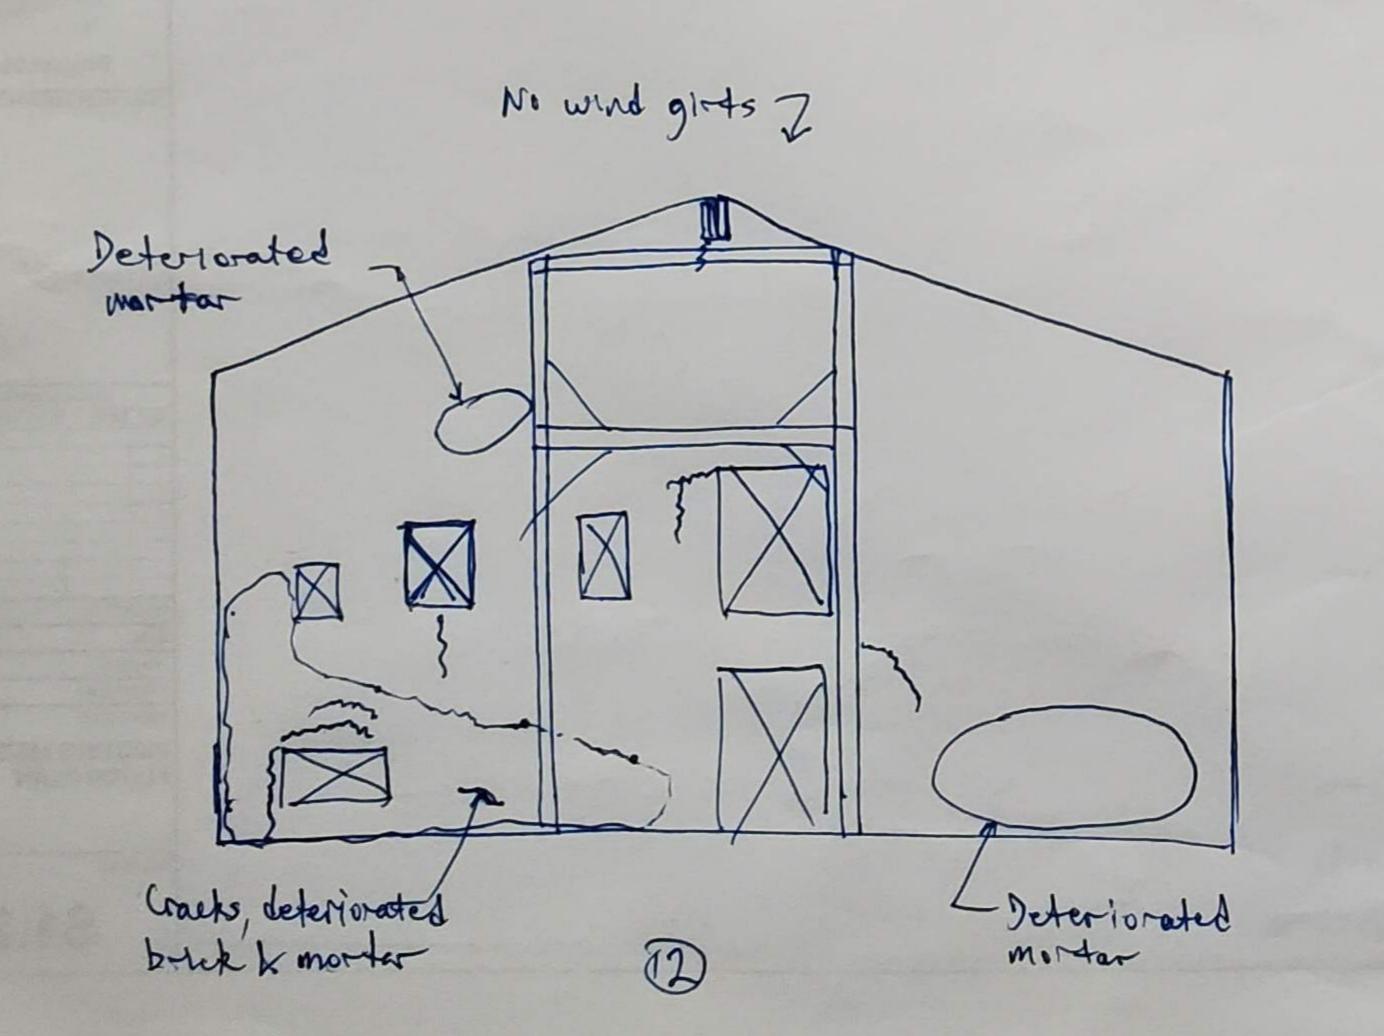

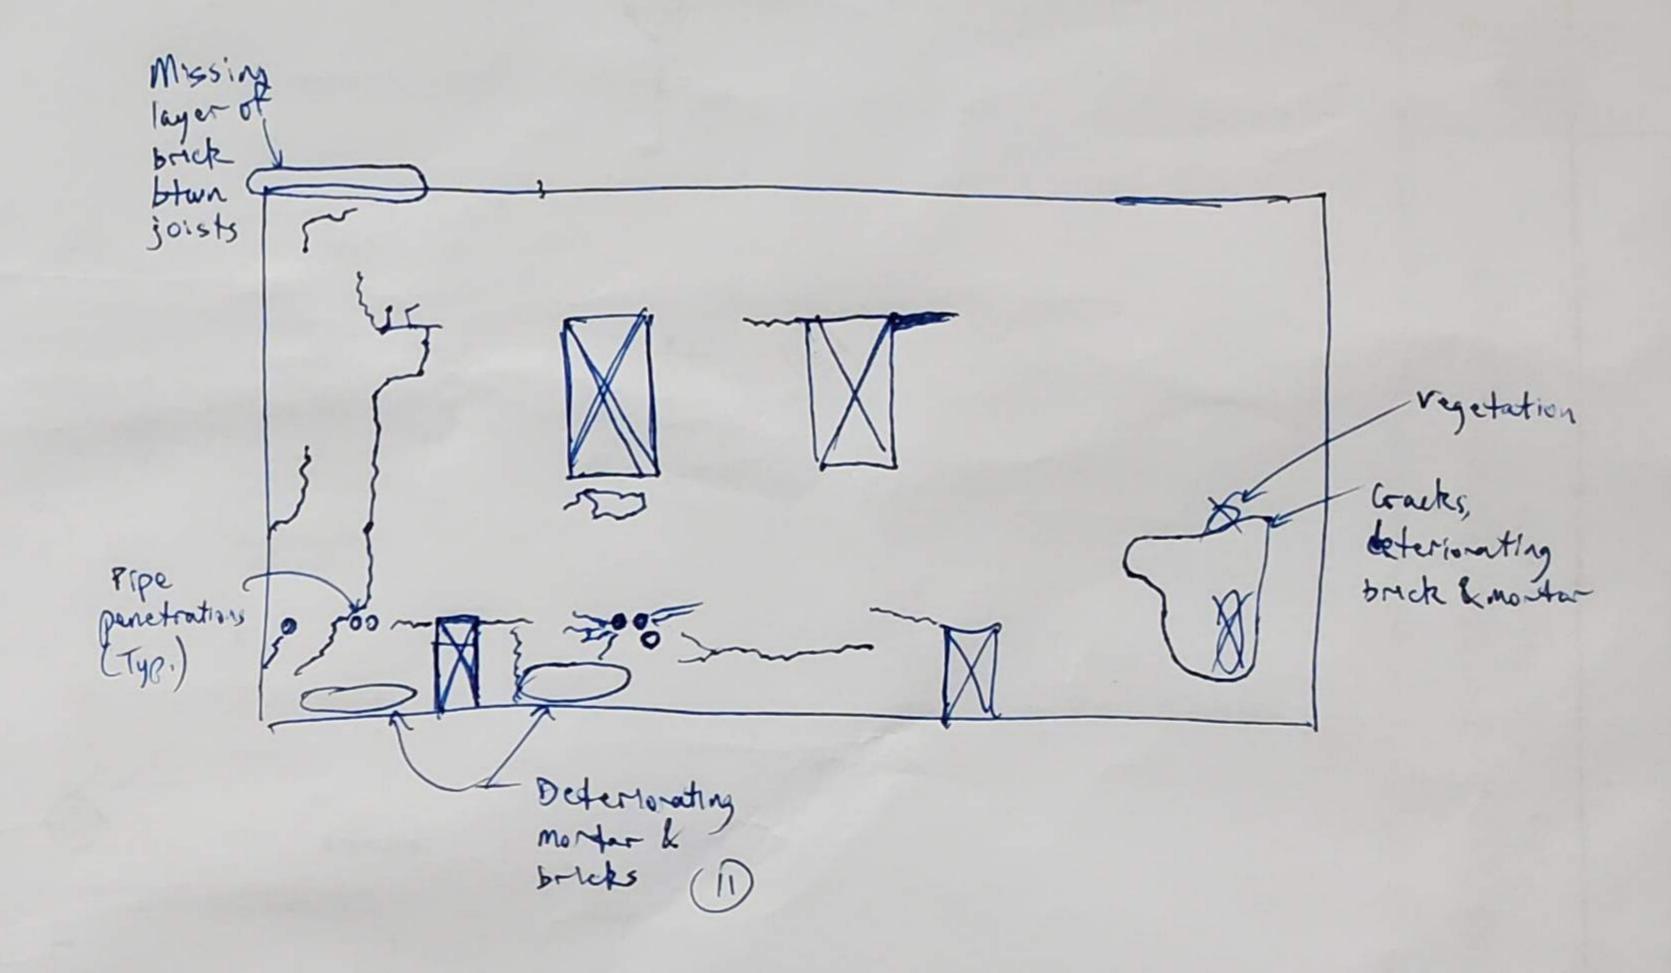

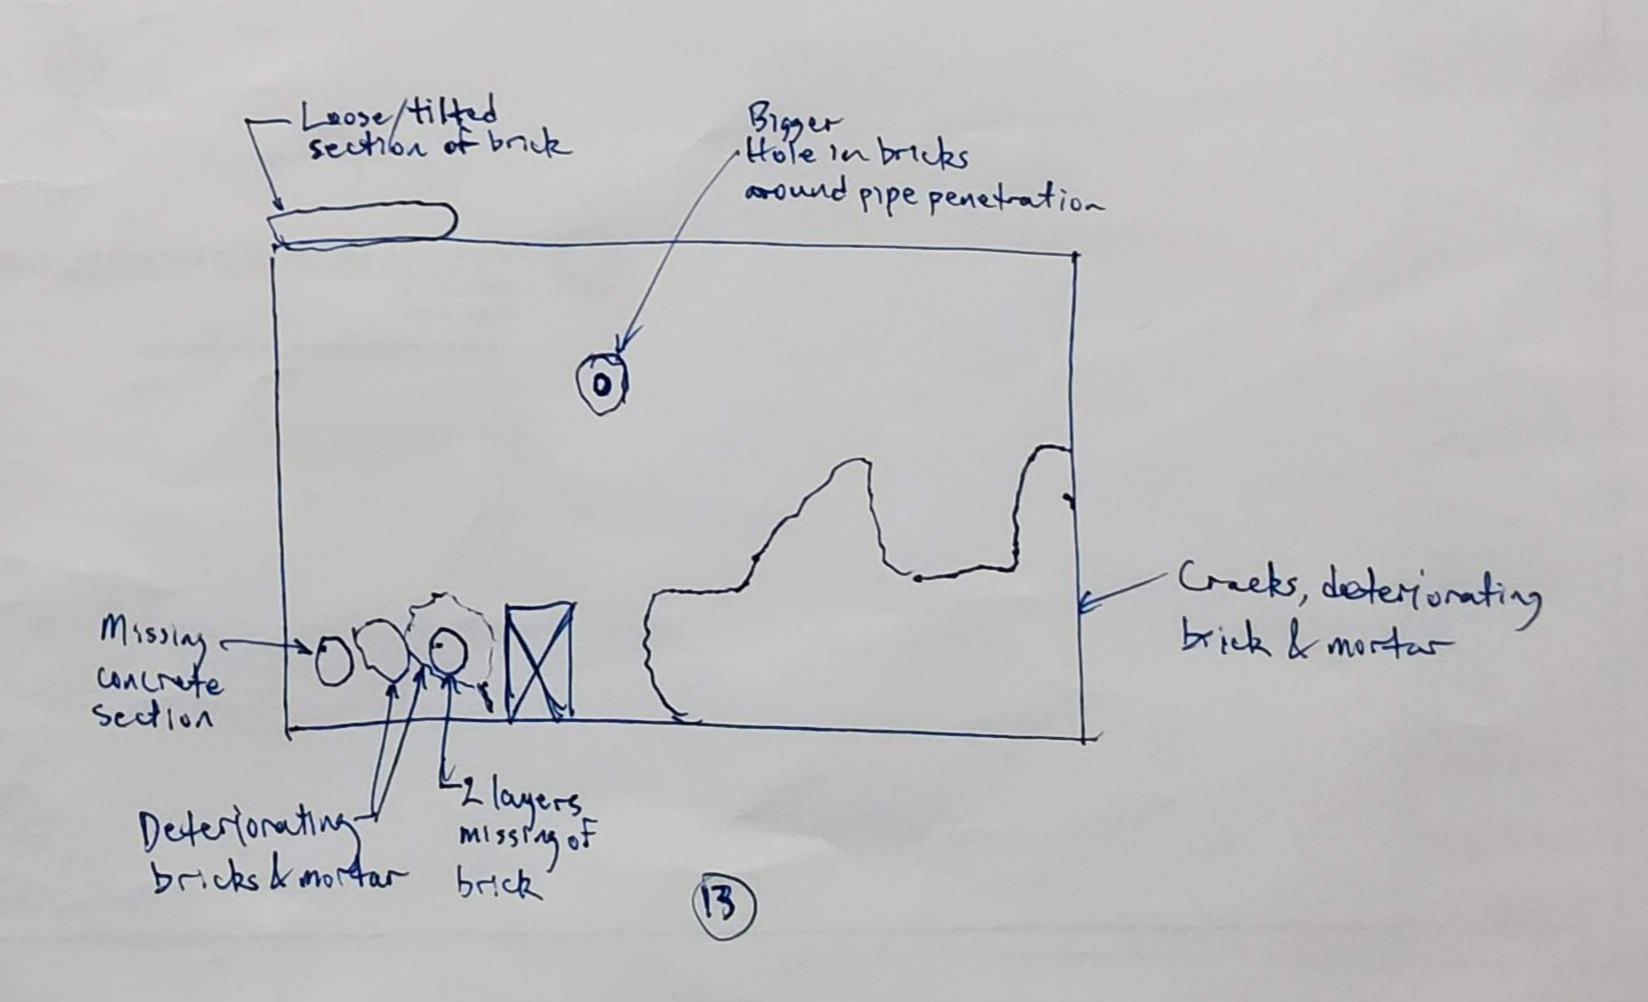

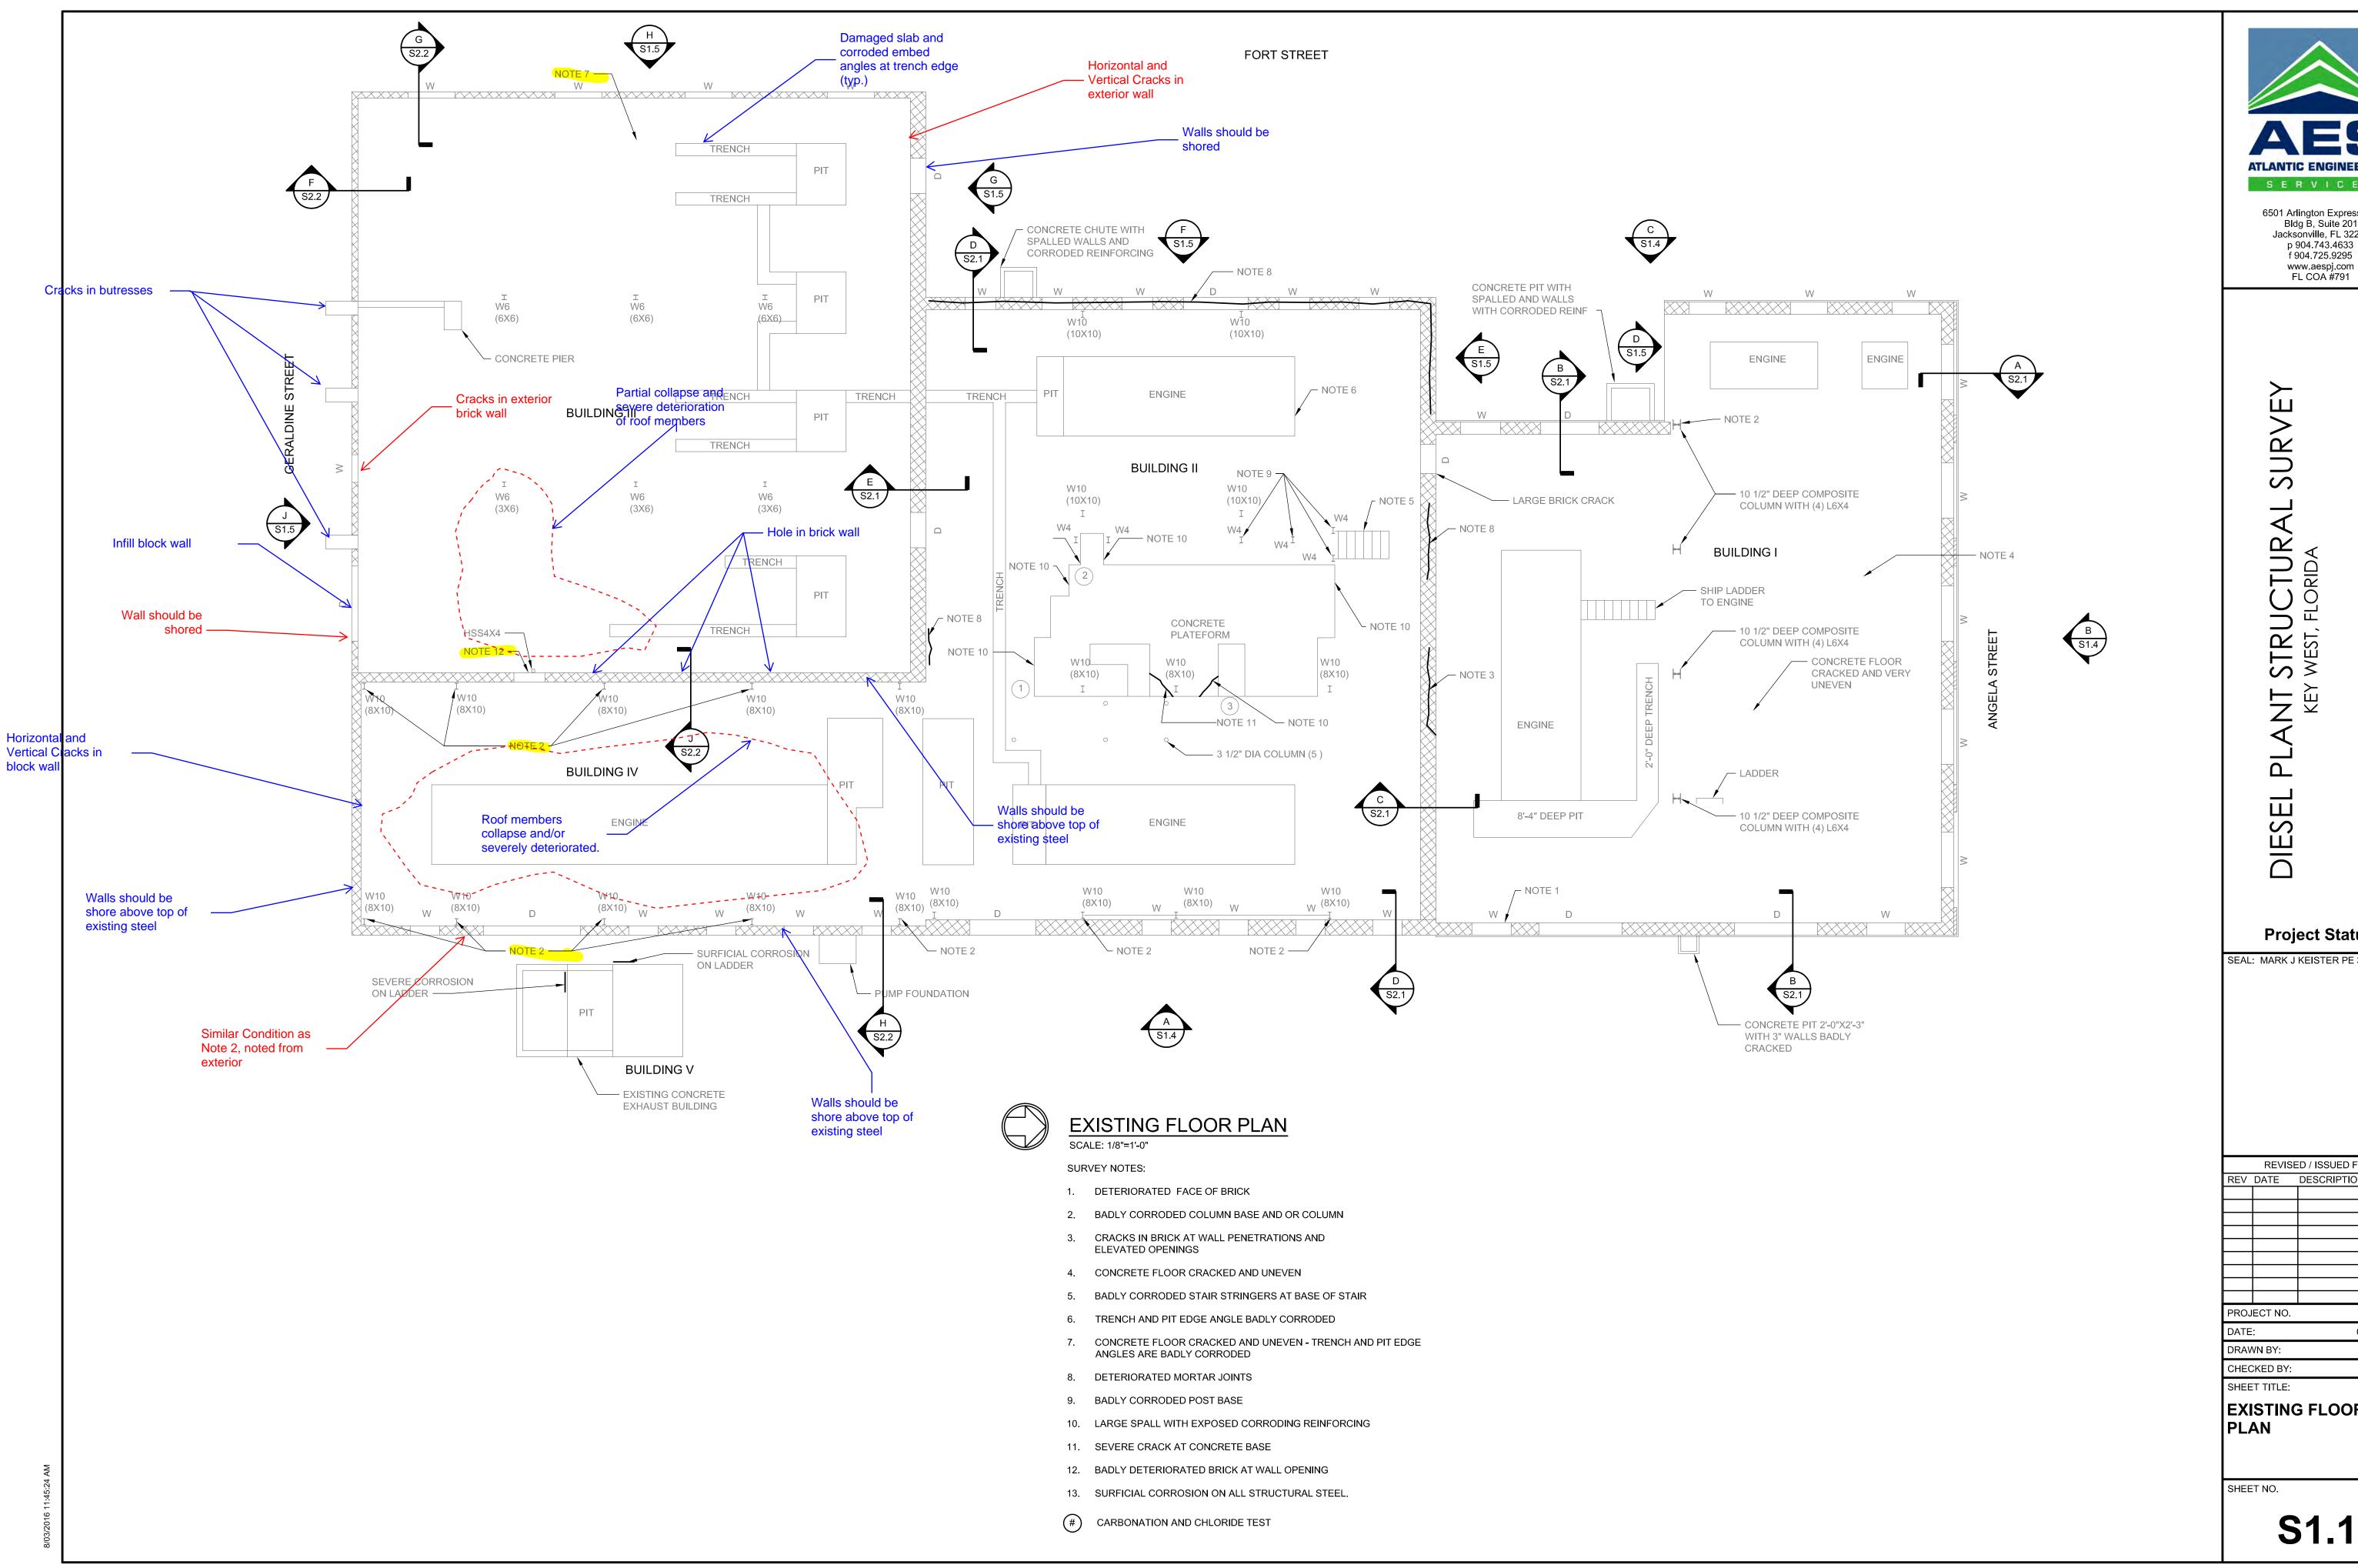

6501 Arlington Expressway Bldg B, Suite 201 Jacksonville, FL 32211 p 904.743.4633 f 904.725.9295

Project Status


SEAL: MARK J KEISTER PE 37435

REVISED / ISSUED FOR: REV DATE DESCRIPTION

316-048

08.03.2016 MJK

EXISTING FLOOR

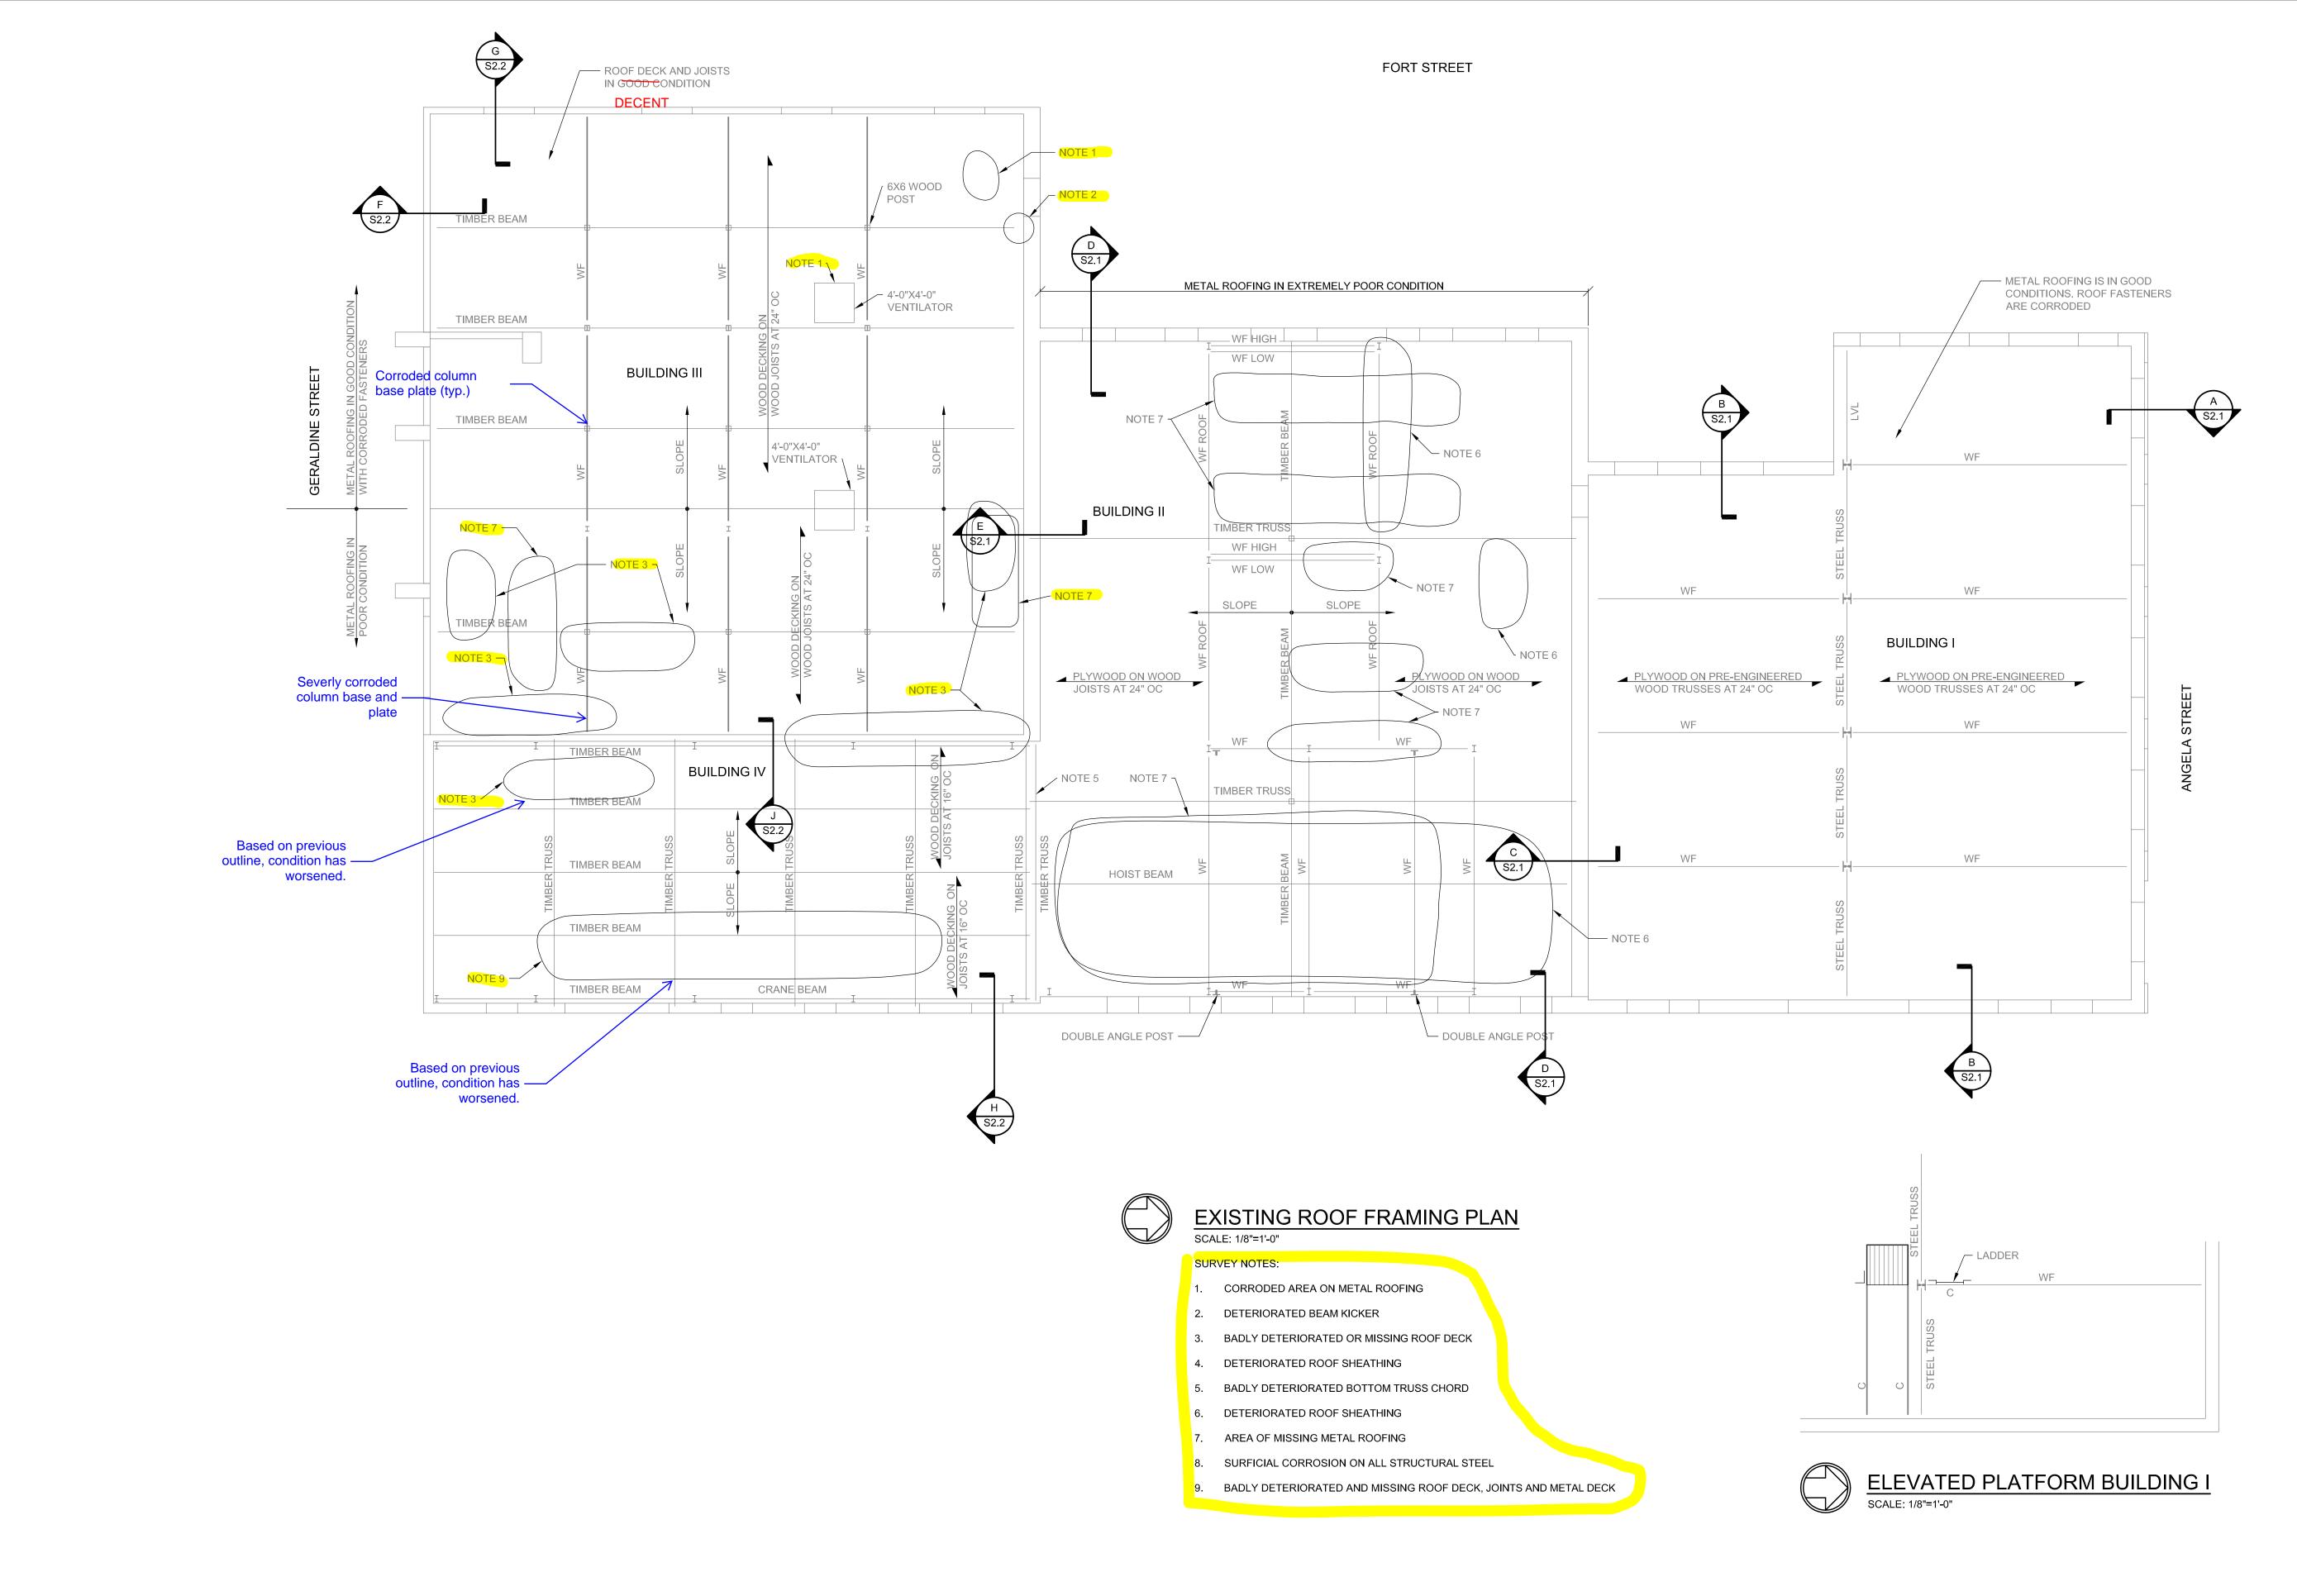

AES
ATLANTIC ENGINEERING
SERVICES

6501 Arlington Expressway

6501 Arlington Expressway Bldg B, Suite 201 Jacksonville, FL 32211 p 904.743.4633 f 904.725.9295 www.aespj.com FL COA #791

DIESEL PLANT STRUCTURAL SURVEY

Project Status

SEAL: MARK J KEISTER PE 37435

REVISED / ISSUED FOR:

REV DATE DESCRIPTION

PROJECT NO. 316-048
DATE: 08.03.2016

DATE: 08.03.2016

DRAWN BY: JEM


CHECKED BY: MJK

SHEET TITLE:

EXISTING ROOF

FRAMING PLAN

CUEETNO

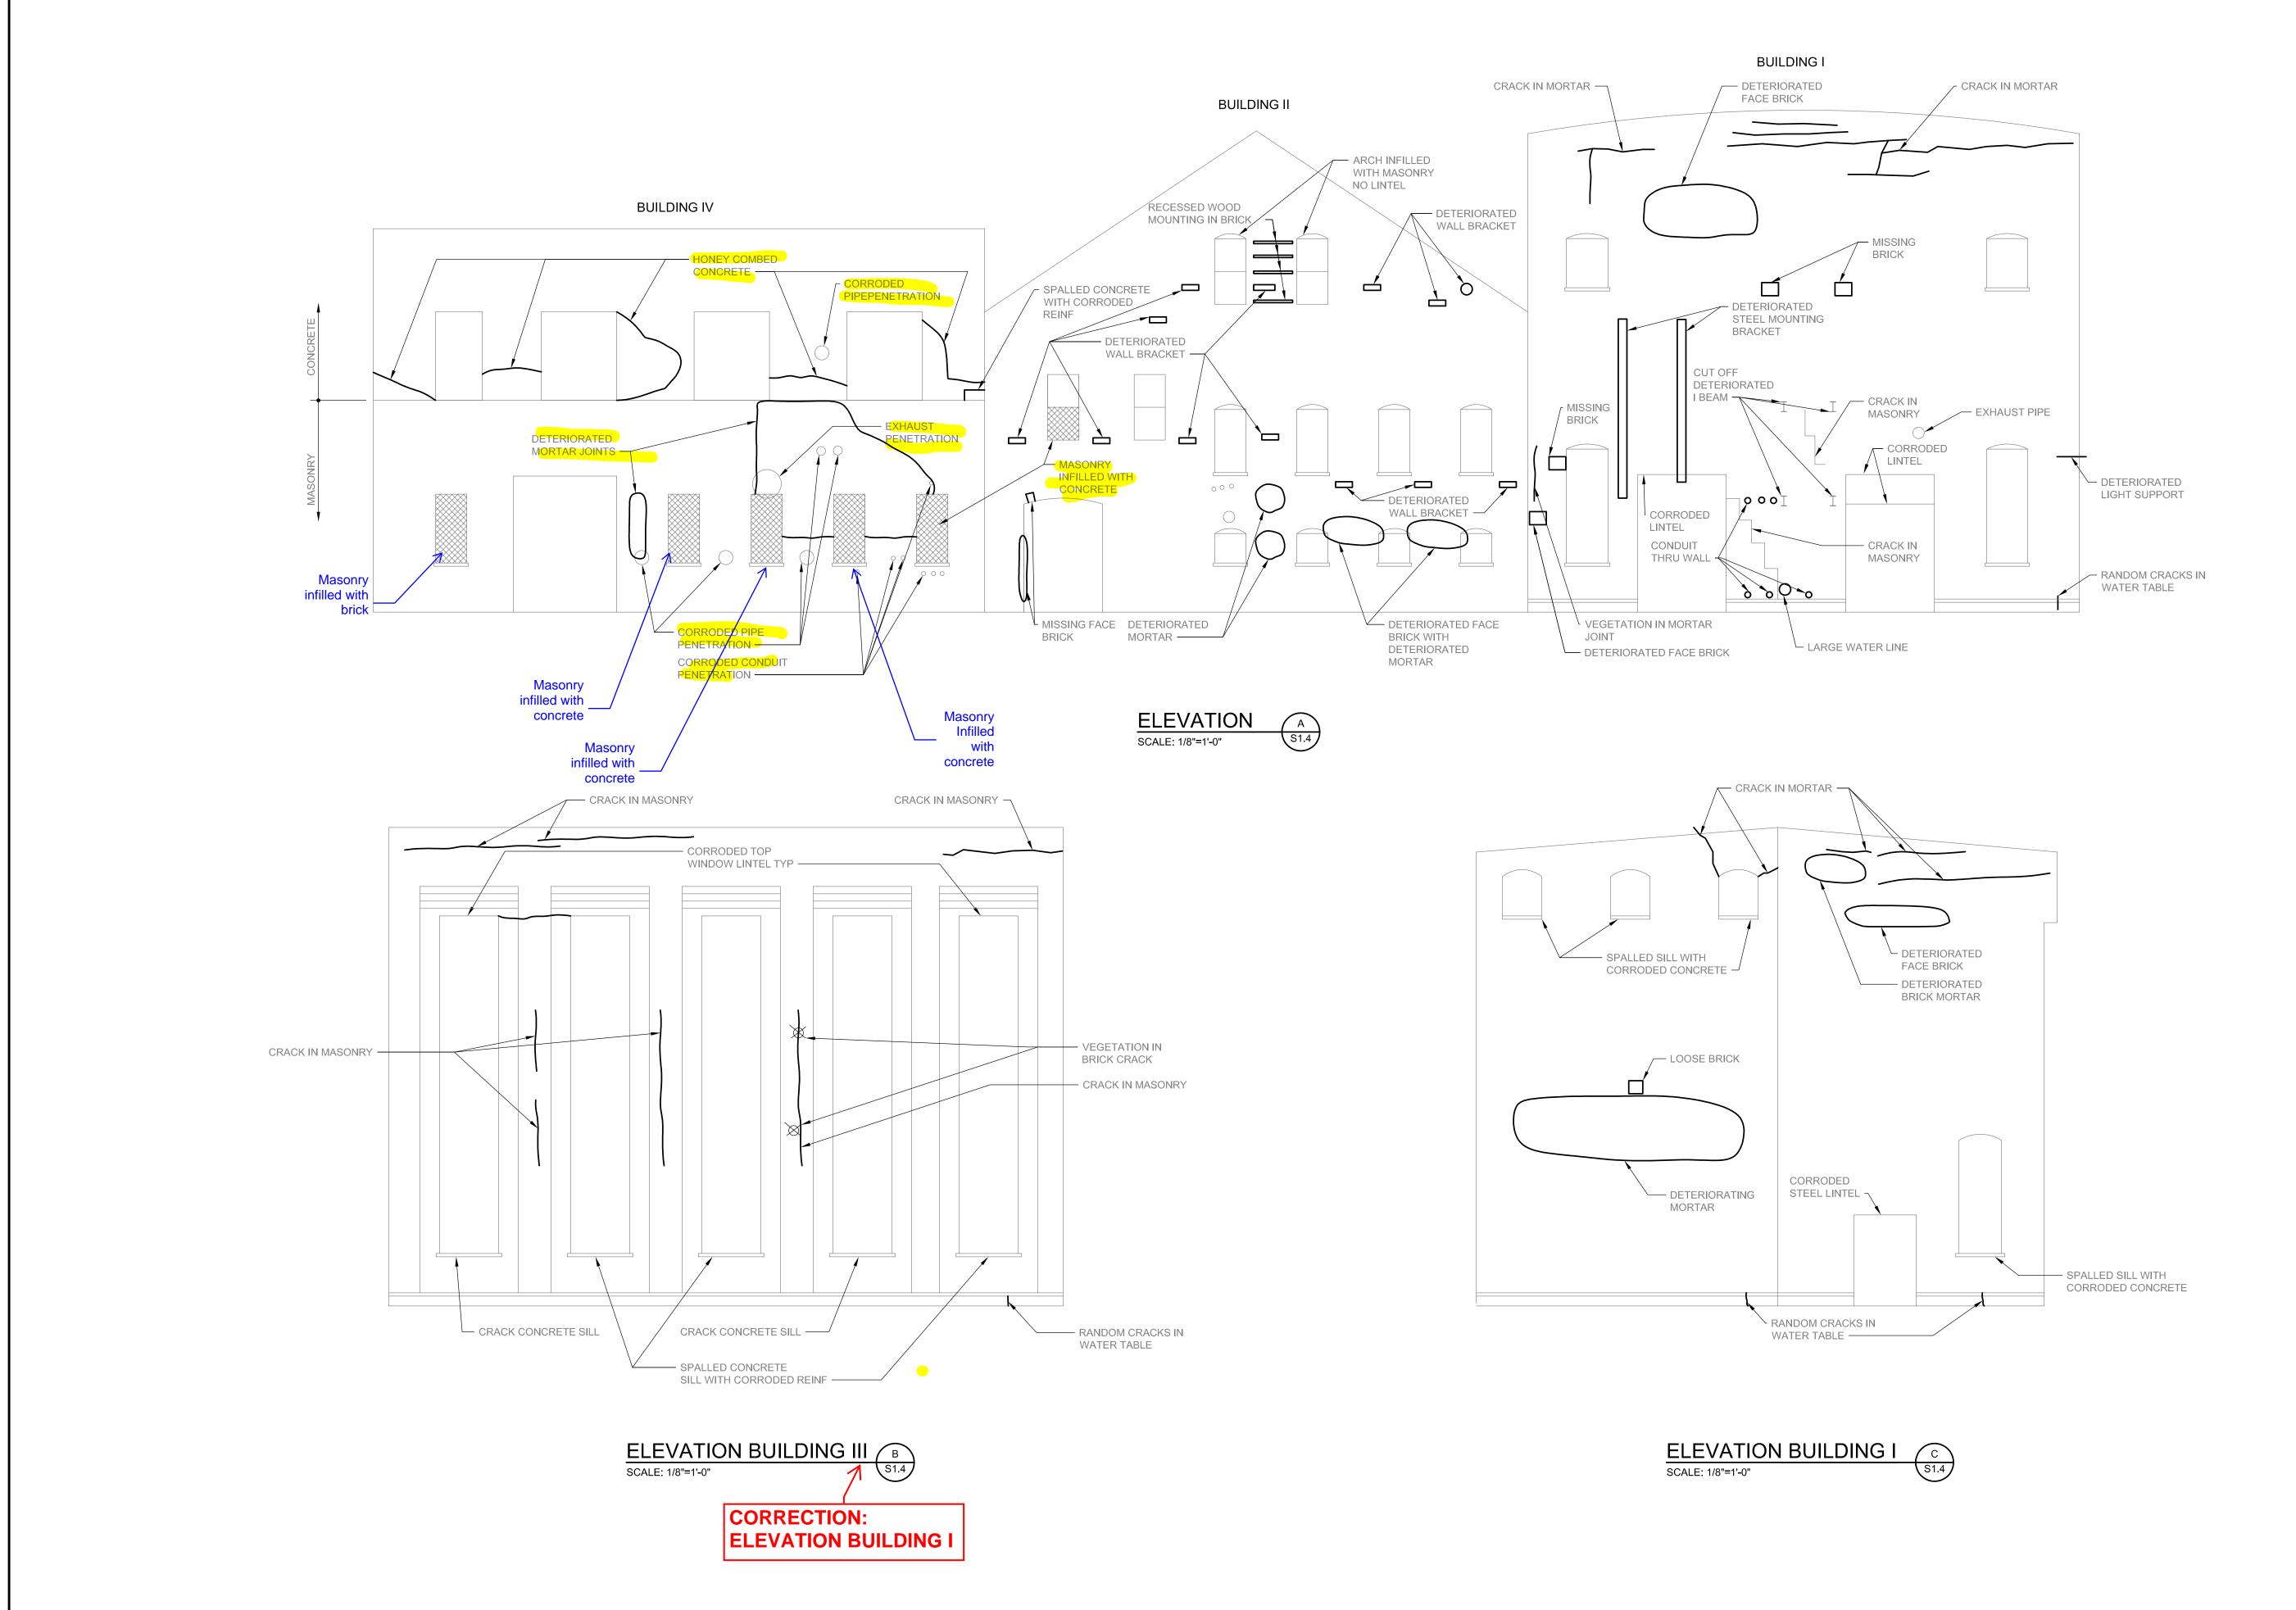



6501 Arlington Expressway
Bldg B, Suite 201
Jacksonville, FL 32211
p 904.743.4633
f 904.725.9295
www.aespj.com
FL COA #791

DIESEL PLANT STRUCTURAL SURVEY
KEY WEST, FLORIDA

Project Status

SEAL: MARK J KEISTER PE 37435

REVISED / ISSUED FOR:

REV DATE DESCRIPTION

PROJECT NO. 316-048
DATE: 08.03.2016

DATE: 08.03.2016


DRAWN BY: JEM


CHECKED BY: MJK


SHEET TITLE:

EXISTING ELEVATIONS

SHEET NO.

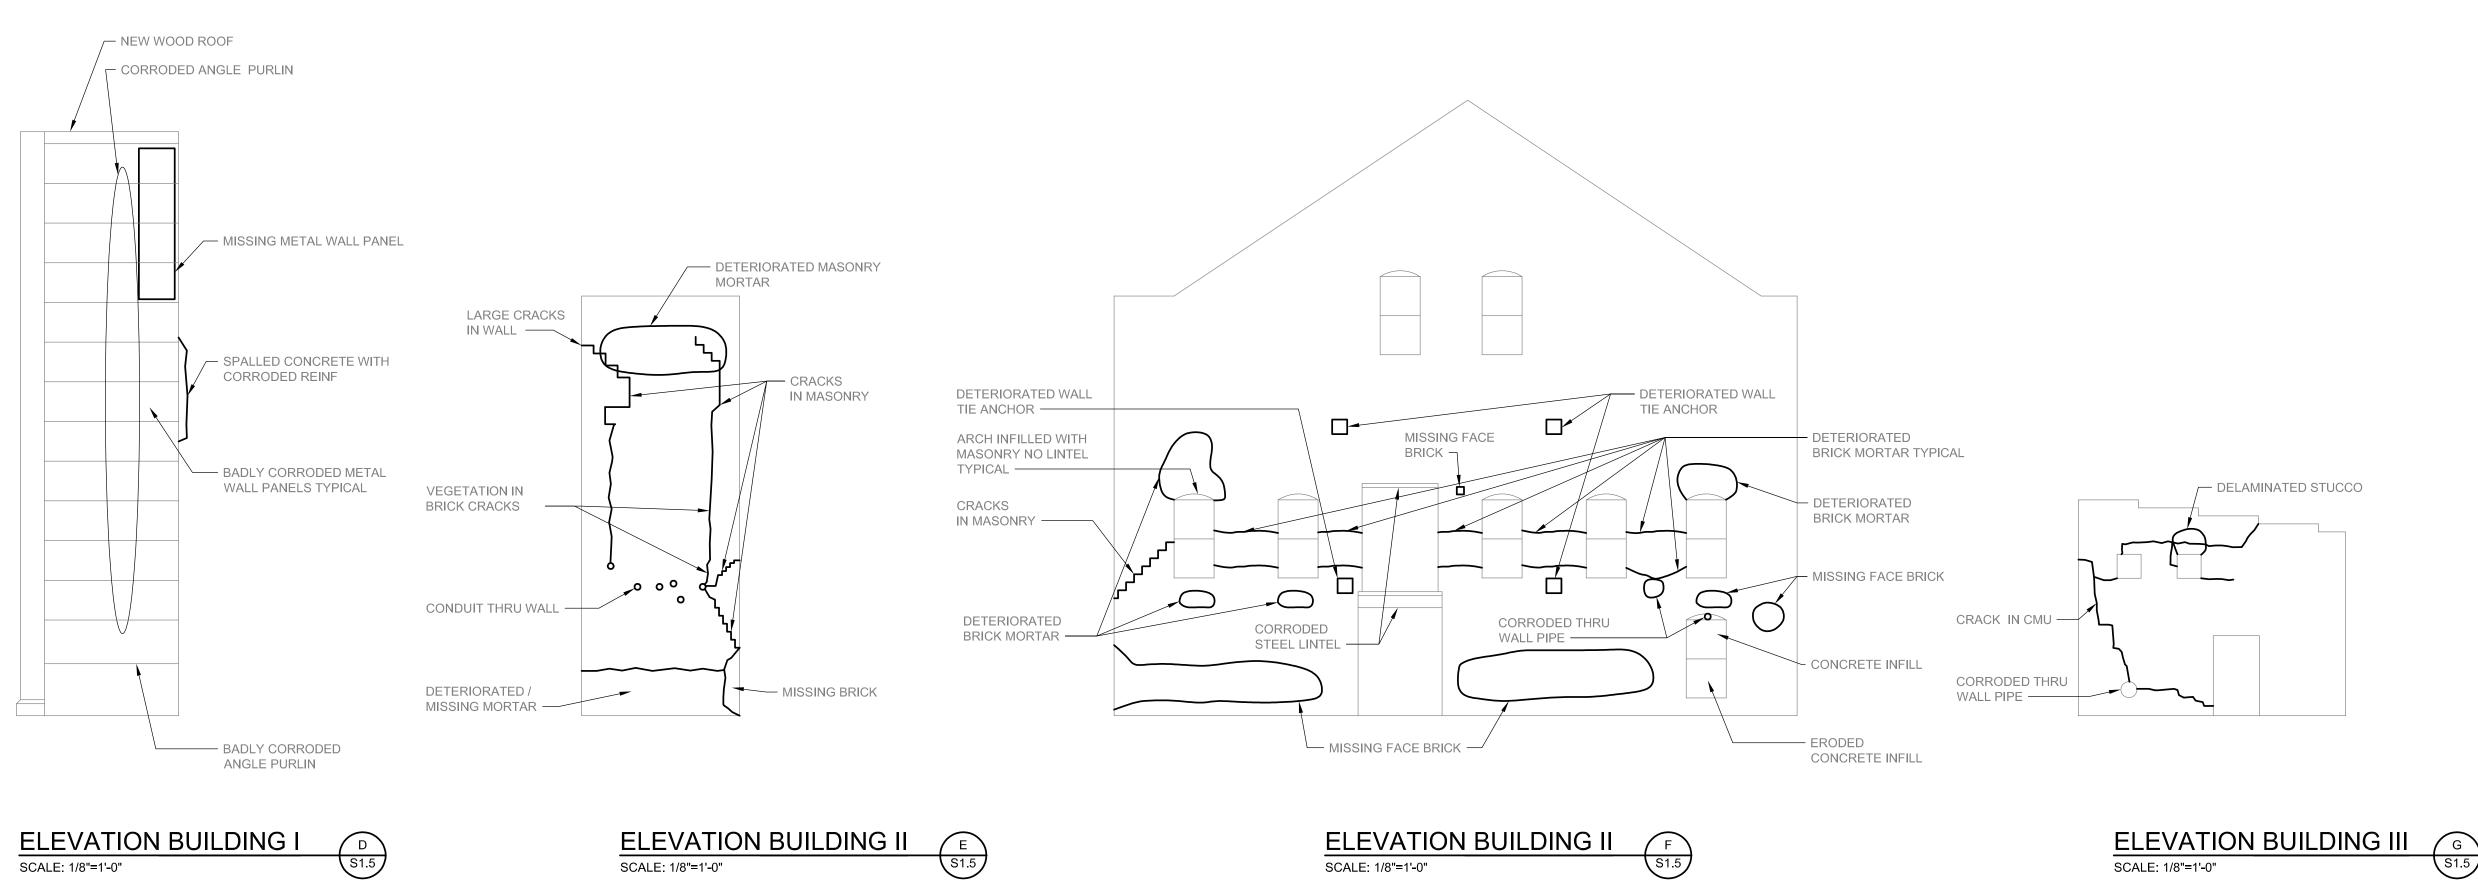

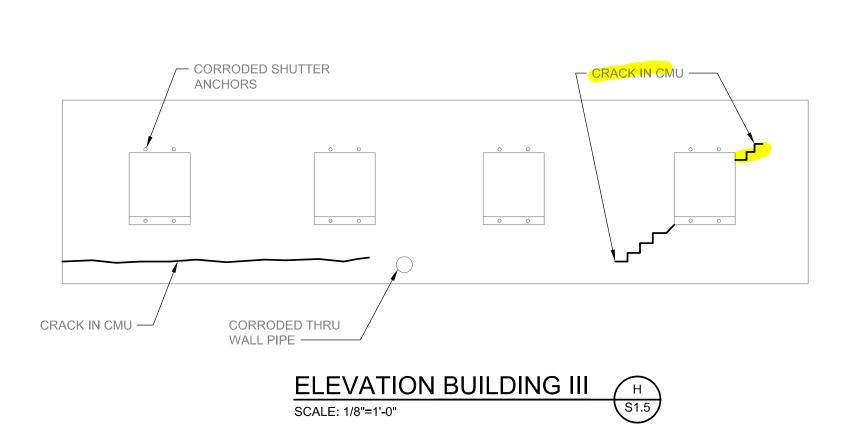

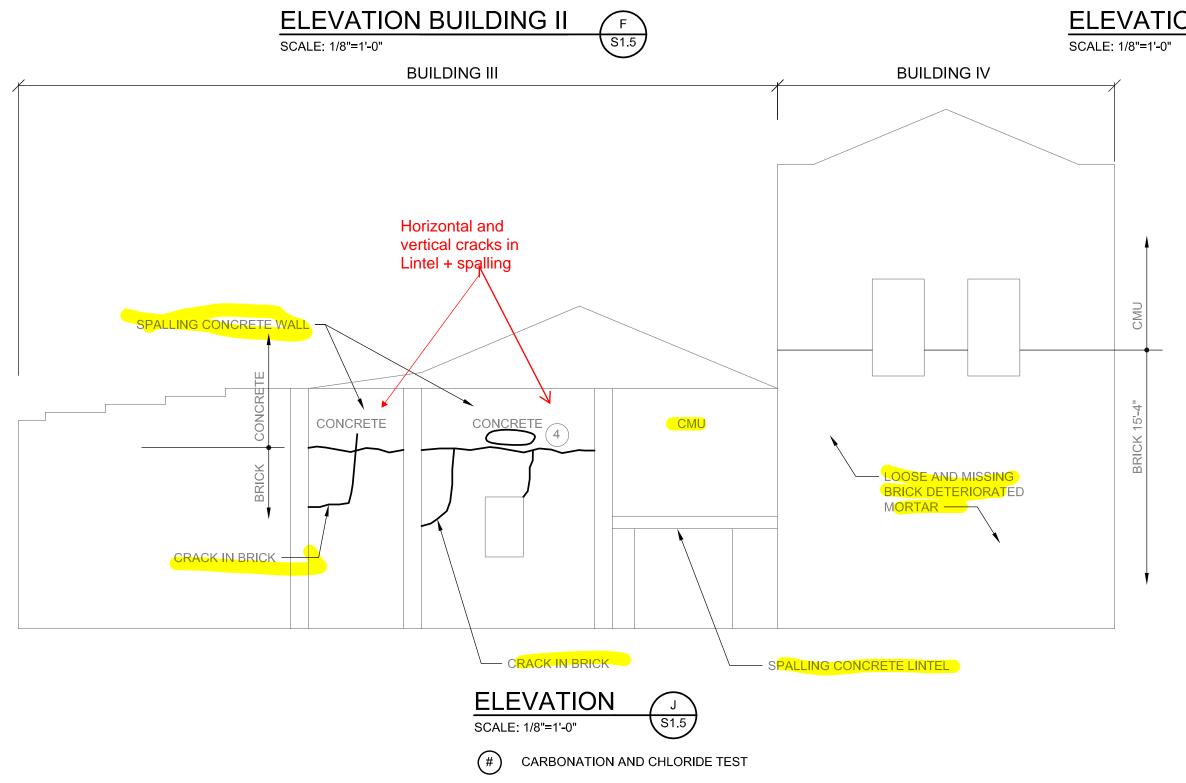

ATLANTIC ENGINEERING
SERVICES

6501 Arlington Expressway
Bldg B, Suite 201
Jacksonville, FL 32211
p 904.743.4633

f 904.725.9295

www.aespj.com FL COA #791

" STRUCTURAL SURVEY
Y WEST, FLORIDA

П

DIESEL

Project Status

SEAL: MARK J KEISTER PE 37435

REVISED / ISSUED FOR:

REV DATE DESCRIPTION

PROJECT NO. 316-048

DATE: 08.03.2016

DRAWN BY: JEM

CHECKED BY: MJK

CHECKED BY: SHEET TITLE:

EXISTING ELEVATIONS

CUEET NO

APPENDIX B

Photolog

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 01



Comments:

Entryway to east of building showing spalling missing section of concrete at base, exposed rebar, & missing bricks.

Photo No. 02



Comments:

Additional exterior cracks located at exterior concrete base on north side of building. Typical.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 03



Comments:

Interior brick area showing signs of deterioration.

Photo No. 04



Comments:

View of interior south wall showing patched and unpatched cracks throughout.



By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 05



Comments:

Concrete sill with missing section located at interior wall opening with wide crack traveling between each exposed rebar

Photo No. 06



Comments:

Large crack traveling through brick and joint mortar originating from roof beam bearing elevation.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 07



Comments:

Bottom of interior steel column that is severely corroded/missing section.

Photo No. 08



Comments:

View of severely broken/damaged concrete slab area.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 09



Comments:

Exterior east side of building showing vegetation growth on wall that suggests on-going cracking and other damage to the bricks and joint mortar where this is located.

Photo No. 10



Comments:

Interior wind girt on east wall showing deteriorating conditions.



By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 11



Comments:

Additional wind girt ends at column showing severe deterioration/missing section.

Photo No. 12



Comments:

One of the worstcondition bottom of interior steel columns with missing section.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 13



Comments:

Additional vegetation growth on the interior north wall. Signs of water intrusion are visible along with mildew. Joint mortar is deteriorating such that some bricks are beginning to displace where vegetation is occurring.

Photo No. 14



Comments:

Large wide cracks traveling through bricks and joint mortar.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 15



Comments:

View of badly damaged corner of building where cracks in bricks and water damage are prevalent along with corroding steel platform

Photo No. 16



Comments:

View of large area of severely damaged/missing roof where daylight is entering on east half of building. Photolog: Building **II** Key West Diesel Plant Project Number: 600744 wood.

 May 10, 2021

 By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 17



Comments:

View of waterdamaged roof joists, plywood, and sheathing on the west half of the building.

Photo No. 18



Comments:

Broken concrete section with corroding rebar exposed supporting the center equipm't/platform.



By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021


Photo No. 19



Comments:

Another typical condition of the concrete equipment base badly cracked and concrete broken off.

Photo No. 20

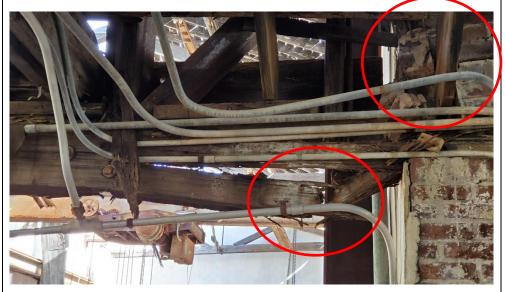

Comments:

View of a main wooden girder/truss bottom chord ruptured by brick wall where uppermost portion of bricks have shifted.



By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 21



Comments:

An example of one of the concrete buttresses located on the exterior south wall with multiple cracks running laterally.

Photo No. 22



Comments:

Multiple large cracks in the plaster usually a sign of damage to the brick behind it.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 23



Comments:

View showing large holes located in the east interior brick wall, in addition to the broken parts from the wooden roof fallen on the floor.

Photo No. 24



Comments:

Typical condition of damaged/ displaced embed angles at corner edges of concrete slab and floor trenches.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 25



Comments:

General view showing very poor condition of concrete slab and floor trenches.

Photo No. 26



Comments:

Appears to be a topping slab severely damaged/missing.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 27



Comments:

Bottom of interior steel column severely corroded and missing section.

Photo No. 28



Comments:

Close-up view of large 1/4" wide crack in exterior wall.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 29



Comments:

General view of area of roof showing signs of water-damage / deteriorating wood with rusted large pipe in foreground.

Photo No. 30




Comments:

Addition view of wooden roof with daylight entering through joints between the boards, and further deteriorating wood in the isolated spot where water is also running down side of interior wall.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 31

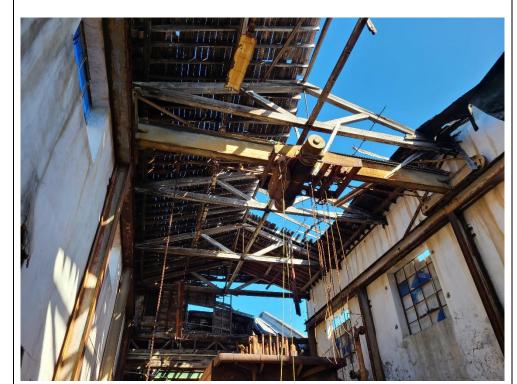

Comments:

General view of large area of missing roof and missing upper north wall.

Photo No. 32




Comments:

Typical condition of rusted/corroded steel interior framing, in addition, to large hole in brick wall to Building 3 at bottom.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 33

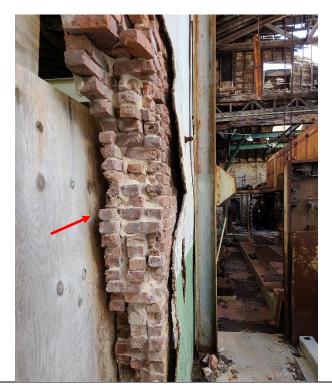

Comments:

Closer view of opening in brick wall with temporary wooden support.

Photo No. 34



Comments:

Timber end roof truss damaged, as are the others to some degree, where bottom chord appears to be ruptured where it connected to the top chord at the end.

wood.

By: J. Vincent Date: 15APR2021 Reviewed: T. Day Date: 15APR2021

Photo No. 35



Comments:

View of west wall adjacent to Bldg. 4, in addition to rusted pipe penetrating wall at the bottom of the photo.

Photo No. 36



Comments:

Isolated cracks in concrete wall, in addition to 2nd rusted pipe penetrating wall.

APPENDIX C

Opinion of Probable Construction Cost Estimate

PROJECT INFORMATION BASIS OF ESTIMATE

Date: 5/10/2021 Client: Albi Balliu

Senior Project Manager

City of Key West Engineering Department 1300 White Street, Key West, FL, 33040

Client Project #:

Project: Key West Diesel Plant **Location:** 101-111 Geraldine St

Key West, FL 33040

Estimate Date: 5/6/2021

Prepared By: James E. Hoy, CPE

Reviewed by:

Company: Wood Environment & Infrastructure Solutions

Address: Big Shanty Road NW City, State Zip: Kennesaw, GA 30144





BACKGROUND SUPPORTING MATERIAL (Scope of Work):

The brick structures were built as a gas plant in 1884 and were the first large scale source of power in Key West. Electric power was in its infancy during the late 1800s. In the early years of gas plant operations, the goal of a utility gas works was to produce the greatest amount of illuminating gas from coal. At the present time the facility is closed. The City is in the process of evaluation and determination for possible repair alternatives.

The building complex consists of four (4) interconnected buildings and a small structure (Building 5).

Cost estimates have been developed to support Structural Visual Assessment on the KEY WEST DIESEL PLANT 7/27/2018 and Structural Visual Assessment on the KEY WEST DIESEL PLANT update 5/10/2021

The cost estimate explores the cost to make the facility safe and weather tight.

BUDGET AND PROGRESS BUDGET:

	Stac	k Wall Repair	;	Steel Wall Repair
Building 1	\$	518,673	\$	821,682
Building 2	\$	762,160	\$	999,879
Building 3	\$	956,736	\$	1,247,945
Building 4	\$	462,135	\$	660,859
Building 5	\$	62,680	\$	62,680
Total	\$	2 762 383	\$	3 793 044

SOURCE OF COST DATA:

- 1. The cost estimate is based upon drawings and information supplied by the Client, Architects, Engineers. The architects, engineers, have made a site visit to the project location.
- 2. Material Unit Costs are based on multiple sources including in-house, estimating publications, estimating programs such as R. S. Means 2021, and National Estimator 2021.
- Craft rates and crew mixes are developed with assistance from multiple sources including in-house, estimating programs such as R. S. Means 2021 and National Estimator 2021. Commercial and industrial wage rates to satisfy Davis Bacon Wage Rate requirements.
- 4. Equipment costs based on latest rental rates from multi-sources including in-house, estimating programs such as R. S. Means 2021 and National Estimator 2021.

- 5. Overtime and night differential pay has not been considered or included within this cost estimate.
- 6. The majority of material deliveries are assumed to occur during normal working hours.
- Estimate preparation is based upon project being a best value award to the responsive trade contractors and suppliers with no unusual contract requirements.
- 8. Items that may change the estimated construction costs include but are not limited to:
 - a. Additions, deletions or modifications to the project work without repricing
 - b. Unforeseen phasing requirements
 - c. Restrictive technical specifications or excessive contract conditions
 - d. Any specified items which cannot be obtained from at least three (3) alternate sources
 - e. A no-competitive bid situation
 - f. Bids requested subsequent to the estimates validity date
- 9. Relocation and storage of tenant equipment stored on the deck are not included in this estimate.
- 10. This project is a tax-exempt project for materials, labor and equipment.
- 11. It is expected that some contractors will be from Orlando, Naples or Fort Myers.
- 12. The construction market has enforced COVID 19 protocols by providing a full time COVID officer, enforcing tool wipedowns, social distancing, PPE gear.
- 13. Historic Windows are included in the project scope.

ESTIMATE ASSUMPTIONS:

- 1. It is assumed that the CLIENT will select a Construction Manager that will subcontract appropriate and skilled subcontractors. The prime contractor will supply onsite supervision and management.
- 2. It is assumed that this will be executed during fair weather months.
- 3. Excludes Fire Alarm.

MAJOR CHANGES FROM PREVIOUS ESTIMATE:

- 1. Report Update from 2018 to 2021.
- 2. Mild inflation has occurred from 2018-2021. Strong inflation is expected in the 2nd quarter of 2021.

DESCRIPTION OF MARK-UP & ADD-ONS:

Sales Tax	0%
General Requirements for Subcontractors	18.9%
General Conditions & Supervision	10.00%
General Requirements	4.0%
G&A	1.5%
General Liability	0.4%
Profit	3.0%
General Requirements for Prime Contractor	20.9%
General Conditions & Supervision	10.00%
General Requirements	4.0%
G&A	1.5%
General Liability	0.4%
Profit	5.0%
Contingency	10.0%
Architectual/Engineering Fees	8.0%

OTHER COMMENTS:

The first quarter of 2021 has experienced dramatic increases in building material prices.

Excludes Fire Alarm.

Wood Environment & Infrastructure Solutions

Big Shanty Road NW Kennesaw, GA 30144

Project: Key West Diesel Plant

Subject Location: Key West, FL

Client: City of Key West Engineering Department

Prepared By: wood.

Design Excluding Structure Steel Wall Reinforcing

					Desigi	· ·	Acidaling Office	<i>a</i> . C	oteer Wall Kellin	010	sing .		
			Building 1		Building 2		Building 3		Building 4		Building 5		Total
Building Squar	e Feet		3,425		3,657		3,720	Π	1,620		170		12,592
•				_	· · · · · · · · · · · · · · · · · · ·		•		· · ·				
Division 1 - General Conditions		se	e G&A/GC below	s	ee G&A/GC below	S	ee G&A/GC below	;	see G&A/GC below	S	see G&A/GC below	sec	e G&A/GC below
Division 2 - Existing Conditions		\$	45,659	\$	46,482	\$	46,706	\$	39,251	\$	12,104	\$	190,202
Division 3 - Concrete		\$	4,414	\$	4,649	\$	5,975	\$	2,452	\$	2,769	\$	20,260
Division 4 - Masonry		\$	124,552	\$	122,864	\$	111,797	\$	63,299	\$	-	\$	422,511
Division 5 - Metals		\$	-	\$	•	\$	-	\$	-	\$	-	\$	-
Division 6 - Wood & Plastics		\$	-	\$	124,815	\$	125,002	\$	64,454	\$	-	\$	314,271
Division 7 - Thermal & Moisture Protection	1	\$	19,800	\$	75,942	\$	88,800	\$		\$	3,514	\$	229,972
Division 8 - Doors & Windows		\$	85,643		57,070	\$	173,484	\$	36,267	\$	-	\$	352,464
Division 9 - Finishes		\$	-	\$	-	\$	-	\$		\$	-	\$	-
Division 10 - Specialties		\$	441	\$	441	\$	441	\$	441	\$	441	\$	2,205
Division 11 - Equipment		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 12 - Furnishings		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 13 - Special Construction		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 14 - Conveyors		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 21 - Sprinkler		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 22 - Plumbing		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 23 - Mechanical - HVAC		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 26 - Electrical		\$	27,206	\$	27,206	\$	27,206	\$,	\$	9,512	\$	118,338
Division 31 - Earthwork		\$	2,881	\$	1,627	\$	1,954	\$	363	\$	403	\$	7,228
Division 32 - Exterior Improvements		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 33 - Utilities		\$	10,000	\$	10,000		10,000		,	\$	10,000	\$	50,000
Sub Total		\$	320,596	\$	471,097	\$	591,366	\$	285,650	\$	38,743	\$	1,707,451
General Requirements for Subcontractors	18.9%	\$	60.593	\$	89.037	\$	111.768	\$	53.988	\$	7.322	\$	322,708
General Requirements for Prime Contractor	20.9%	\$	67.005		98,459		123,596		,	\$	8,097	•	356,857
Contingency	10%	\$	32,060		47.110		59.137		,		3.874	\$	170,745
Sub-total		\$	480,252		705,703		885,867		-,		58,037	т .	2,557,762
Architectural & Engineering Service	8%	\$	38,420		56,456		70,869				4,643		204,621
Probable Project Cost		\$	518,673	\$	762,160	\$	956,736	\$	462,135	\$	62,680	\$	2,762,383
Cost per Square F	inot		\$151 44		\$208 41		\$257 19		\$285.27		\$368.70		\$219.38

Cost per Square Foot \$151.44 \$208.41 \$257.19 \$285.27 \$368.70 \$219.38

wood. Summary

Design Including Structure Steel Wall Reinforcing

			Building 1		Building 2		Building 3		Building 4		Building 5		Total
Building Square	e Feet		3,425		3,657		3,720		1,620		170		12,592
Division 1 - General Conditions		see	e G&A/GC below	S	ee G&A/GC below	Se	ee G&A/GC below	S	ee G&A/GC below	se	ee G&A/GC below	see	e G&A/GC below
Division 2 - Existing Conditions		\$	45,659	\$	46,482	\$	46,706	\$	39,251	\$	12,104	\$	190,202
Division 3 - Concrete		\$	4,414	\$	4,649	\$	5,975	\$	2,452	\$	2,769	\$	20,260
Division 4 - Masonry		\$	124,552	\$	122,864	\$	111,797	\$	63,299	\$	-	\$	422,511
Division 5 - Metals		\$	187,292	\$	146,936	\$	179,998	\$	122,833	\$	-	\$	637,059
Division 6 - Wood & Plastics		\$	=	\$	124,815	\$	125,002	\$	64,454	\$	-	\$	314,271
Division 7 - Thermal & Moisture Protection		\$	19,800	\$	75,942	\$	88,800	\$	41,916	\$	3,514	\$	229,972
Division 8 - Doors & Windows		\$	85,643	\$	57,070	\$	173,484	\$	36,267	\$	-	\$	352,464
Division 9 - Finishes		\$	=	\$	-	\$	-	\$		\$	-	\$	-
Division 10 - Specialties		\$	441	\$	441	\$	441	\$	441	\$	441	\$	2,205
Division 11 - Equipment		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 12 - Furnishings		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 13 - Special Construction		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 14 - Conveyors		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 21 - Sprinkler		\$	=	\$	-	\$	-	\$		\$	-	\$	=
Division 22 - Plumbing		\$	-	\$		\$		\$		\$	-	\$	-
Division 23 - Mechanical - HVAC		\$	=	\$	-	\$	-	\$		\$	-	\$	=
Division 26 - Electrical		\$	27,206	\$	27,206	\$	27,206	\$	27,206	\$	9,512	\$	118,338
Division 31 - Earthwork		\$	2,881	\$	1,627	\$	1,954	\$	363	\$	403	\$	7,228
Division 32 - Exterior Improvements		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
Division 33 - Utilities		\$	10,000	\$	10,000	\$	10,000	\$	10,000	\$	10,000	\$	50,000
Sub Total		\$	507,888	\$	618,033	\$	771,365	\$	408,482	\$	38,743	\$	2,344,511
General Requirements for Subcontractors	18.9%	\$	95,990.83	\$	116,808.24	\$	145,787.93	\$	77,203.15	\$	7,322.40	\$	443,112.56
General Requirements for Prime Contractor	20.9%	\$	106,148.59	\$	129,168.90	\$	161,215.22	\$	85,372.80	\$	8,097.26	\$	490,002.78
Contingency	10%	\$	50,788.80	\$	61,803.30	\$	77,136.47	\$	40,848.23	\$	3,874.29	\$	234,451.09
Sub-total Sub-total		\$	760,816	\$	925,813	\$	1,155,504	\$	611,906	\$	58,037	\$	3,512,077
Architectual/Engineering Fees	8%	\$	60,865	\$	74,065	\$	92,440	\$	48,953	\$	4,643	\$	280,966
Probable Project Cost		\$	821,682	\$	999,879	\$	1,247,945	\$	660,859	\$	62,680	\$	3,793,044
Cost per Square F	oot		\$239.91		\$273.41		\$335.47		\$407.94		\$368.70		\$301.23

wood. Summary

Diesel Plant Repair Project Building 1 City of Key West Engineering Department

3,425 sf

allw allw	Unit Cost	Total -	Unit Cost	Total -	10,000.00	Total	Unit Cost	Total	Unit Cost	Total	10,000.0
allw	- -		-	-	10,000.00	10,000.00	-				10,000 (
allw	-		-	-	10,000.00	10,000.00	-		_		10,000
allw	=		-	-	10,000.00	10,000.00	-		_ 1		10 000 0
	-	_							- 1	- 1	10,000.0
allur			-	-	3,500.00	3,500.00	-	-	-	-	3,500.
allw		-	-	-	5,000.00	5,000.00	-	-	-	-	5,000.0
allw	-	-	-	-	15,000.00	15,000.00	-	-	-	-	15,000.0
sf	-	-	-		3.25	11,131.25	-	-	-	-	11,131.
sf	-	-	-	-	0.30	1,027.50	-	-	-	-	1,027.
	sf	sf -	sf	sf	sf	sf 3.25	sf 3.25 11,131.25	sf 3.25 11,131.25 -	sf 3.25 11,131.25	sf 3.25 11,131.25	sf 3.25 11,131.25

ITEM DESCRIPTION	Quant	ity	Labor	Cost	Materia	al Cost	Subcon	ntractor	Equi	pment	0	ther	TOTAL
HEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 3 - Concrete													
Building Slab Repair (Cut and Square Edges, Structure	al Gravel, Dowels, Pla	cement)											
Pit Infill Slab Structure	304	sf											
Ready Mix Materials	4	су	-	-	145.00	543.65	-	-	-	-	-	-	543.0
Admixtures - mid range	4	су	-	-	3.00	11.25	-	-	-	-	-	-	11.3
Fiber Mesh	4	су	-	-	5.00	20.00	-	-	-	-	-	-	20.0
Dowels	70	ea	15.00	1,050.00	3.00	210.00	-	-	-	-	-	-	1,260.0
SOG Concrete Placement	304	sf	2.00	608.00	-	-	-	-	-	-	-	-	608.0
Cure	304	sf	0.05	15.20	0.02	6.08	-	-	-	-	-	-	21.2
Caulk Control Joint & Saw Cuts	0	lf	1.00	-	0.44	-	-	-	-	-	-	-	0.0
Pour Prep	1	ls	450.00	450.00	-	-	-	-	-	-	-	-	450.0
Pumps	1	ea	-	-	-	-	-	-	1,500.00	1,500.00	-	-	1,500.0

Division 4															
	ITEM DESCRIPTION		Quant	ity	Labo	r Cost	Mater	ial Cost	Subco	ntractor	Equ	uipment		Other	TOTAL
			Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 4 - Ma	sonry														
Exterior Mason															
	Exterior Scaffold		5,670	sf	-	-	-	-	4.50	25,515.00	-	-	-	-	25,515.00
	Reinforced Plastic Wrap for Du	st Control	5,670	sf	-	-	-	-	3.10	17,577.00	-	-	-	-	17,577.00
	Water Hookup		1	ls	-	-	-	-	1,500.00	1,500.00	-	-	-	-	1,500.00
	dailv														
mason1	54	432													
mason2	36	288													
mason3	36	288													
mason4	36	288													
mason5	36	288													
mixer		36													
Rack Truck		74													
Pickup Truck		<u>46</u>													
		1740	15	days	-	-	-	-	1,740.00	26,100.00	-	-	-	-	26,100.00
	Structure Crack Repair			If	-	-	_	-	41.00		-	-	-	-	0.00
	•														
Interior Mason															
	Interior Scaffold		709	sf	-	-	-	-	4.50	3,190.50	-	-	-	-	3,190.50
	Interior Elevation 1 Repoint		1,534	sf	-	-	-	-	8.00	12,272.00	-	-	-	-	12,272.00
	Interior Elevation 2.0 Repoint		961	sf	-	-	-	-	8.00	7,688.00	-	-	-	-	7,688.00
	Interior Elevation 2.1 Repoint		397	sf	-	-	-	-	8.00	3,176.00	-	-	-	-	3,176.00

TOTAL MASONRY	L MASONRY					0.00		124,551.50		0.00		0.00	124,551.50
												-	
Infills	10	ea	-	-	-	-	560.00	5,600.00	-	-	-	-	5,600.00
Structure Crack Repair	85	lf	-	-	-	-	41.00	3,485.00	-	-	-	-	3,485.00
Interior Elevation 4 Repoint	1,614	sf	-	-	-	-	8.00	12,912.00	,	-	-	-	12,912.00
Interior Elevation 3 Repoint	692	sf	-	-	-	-	8.00	5,536.00	-	-	-	-	5,536.00

	ITEM DECODIDATION		Quant	ity	Labor	Cost	Materi	al Cost	Subcor	ntractor	Equ	ipment		Other	TOTAL
	ITEM DESCRIPTION		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 5 - M	letals														
OPTION 2 ON	ILY														
Footing Insta															
Excavate	Slab Removal & Excavate		15	ea	-	-	-	-	385.00	5,775.00	-	-	-	-	5,775.00
2'x2'x1.5'	Reinforced Concrete		15	ea	-	-	-	-	425.00	6,375.00	-	-	-	-	6,375.00
	diamond expansion joint		15	ea	-	-	-	-	120.00	1,800.00	-	-	-	-	1,800.00
Steel Frame															
Materials															
Beams	If	ea													
W14 x 61	30	15	27450												
W12 x 30	15	27	12150												
		42	39600												
	\$2,500		21	tns	-	-	6,500.00	135,135.00	-	-	-	-	-	-	135,135.00
Primer			21	tns	-	-	250.00	5,197.50	-	-	-	-	-	-	5,197.50
	\$2.5 per pd Industrial														
	\$4.30 per pd Commercial														
Bolts			168	ea	-	-	12.25	2,058.00	-	-	-	-	-	-	2,058.00
Shim Stock			1	ls	-	-	500.00	500.00	-	-	-	-	-	-	500.00
Grout			15	sacks	-	-	30.00	450.00	-	-	-	-	-	-	450.00
Welding Gas 8	& Sundry		1	ls	-	-	600.00	600.00	-	-	-	-	-	-	600.00
Labor															
	hr	daily													
Labor foreman		\$524.40													
Steel Erector 1		\$440.00													
Steel Erector 2		\$440.00													
Steel Erector 3		\$440.00													
Pick up truck		\$36.00													
Rack truck		\$101.00													
Hoist & Lifts		\$673.00													
Perdiem		\$1,250.00													
Overhead & P		\$875.95													
Daily Burn Rat		\$4,780.35													
	Steel Contractor		5	day	\$4,780.35	23,901.76	-	-	-	-	-	•	-	-	23,901.76
Crane Service)		5	day	-	-	-	-	1,100.00	5,500.00	-	-	-	-	5,500.00
TOTAL META	u s					23,901.76		143,940.50	<u></u>	19,450.00		0.00		0.00	187,292

Division 6														
ITEM DESCRIPTION		Quant	ity	Labo	r Cost	Mater	ial Cost	Subco	ntractor	Equ	uipment		Other	TOTAL
TIEW DESCRIPTION		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 6 - Wood & Plastics														
Building Roof Framing	Not Used	3,863	sf	-	-	-	-	-		-	-	-		0.00
TOTAL WOOD & PLASTICS					0.00		0.00		0.00		0.00		0.00	0

Division 7														
ITEM DESCRIPTION		Quant	ity	Labo	r Cost	Mater	ial Cost	Subco	ntractor	Eq	uipment	(Other	TOTAL
TIEW DESCRIPTION		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 7 - Thermal & Moisture Protection														
Exterior Stuccos Finish		0	sf			-	-	-	-	-	-	-		0.00
Metal Roofing	Not Used	0	sf	-		-	-	-		-	-	-	-	0.00
Metal Gutter	Not Used	0	lf	-		-	-	-		-	-	-	-	0.00

Joint Sealants	Not Used	0	ls	-	-	-	-	-	-	-	-	-	-	0.00
Metal Panel Repair		1,100	ls	-	-	-		18.00	19,800.00	-	-	-		19,800.00
TOTAL THERMO MOISTURE					0.00		0.00		19,800.00		0.00		0.00	19,800

17	EM DESCRIPTION		Quant	ity	Labo	Cost	Materi	al Cost	Subco	ntractor	Eq	uipment		Other	TOTAL
111	EM DESCRIPTION		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 8 - Doors & Wi	ndows														
Interior Doors															2.0
None			0	ea	-	-	-	-	-	-	-		-	-	0.0
Exterior Doors															
					455.00	4== 00	4 404 00	4 404 00							4.570.0
Door &	Hardware		1	ea	455.00	455.00	1,121.00	1,121.00	-	-	-		-	-	1,576.0
W															
Windows and Glazing			40						500.00	0.000.00					0.000.0
Window Opening Rebu Materials	ııa		16	ea	-	-	-	-	500.00	8,000.00	-		-	-	8,000.0
Windows															
1	A Type		21	sf	_	-	125.00	2.625.00	-	-	_	-	-	-	2,625.0
2	A Type		21	sf	-	-	125.00	2,625.00			_		-	-	2,625.0
3	A Type		21	sf	-		125.00	2,625.00	-	-	-	-	-	-	2,625.0
4	A Type		21	sf	-	-	125.00	2,625.00	-	-	-	-	-	-	2,625.0
5	A Type		21	sf	-	-	125.00	2,625.00	-	-	-	-	-	-	2,625.0
1	B Type		62	sf	-	-	125.00	7,750.00	-	-	-	-	-	-	7,750.0
2	B Type		62	sf	-	-	125.00	7,750.00	-	-	-	-	-	-	7,750.0
3	В Туре		62	sf	-	-	125.00	7,750.00	-	-	-		-	-	7,750.0
4	В Туре		62	sf	-	-	125.00	7,750.00	-	-	-		-	-	7,750.0
5	В Туре		62	sf	-	-	125.00	7,750.00	-	-	-	-	-	-	7,750.0
1	C Type		100	sf	-	-	125.00	12,500.00	-	-	-		-	-	12,500.0
2	C Type		100	sf	-	-	125.00	12,500.00	-		-	-	-	-	12,500.0
3	С Туре		100	sf	-	-	125.00	12,500.00	-	-	-	-	-	-	12,500.0
4	С Туре		100	sf	-	-	125.00	12,500.00	-	-	-	-	-	-	12,500.0
5	С Туре		100	sf	-	-	125.00	12,500.00	-	-	-	-	-	-	12,500.0
		Tinting	915	sf	-	-	2.00	1,830.00	-	-	-	-	-	-	1,830.0
Window Bucks		If													
A Type		18	5	ea	_	-	36.66	183.30	-		_	-	-	-	183.3
B Type		31	6	ea	-	-	62.99	377.95			-		-		377.9
C Type		40	5	ea	-	-	80.00	400.00	-		-		-	-	400.0
о туро							00.00								100.0
Fasteners 1/4" x 3 1/4" Concret	te Screw Slot Hex Washer F	ld Blue Polymer 4" on Ct	r												
A Type		,	275	ea	-	-	0.72	197.97	-	-	-		-	-	197.9
В Туре			567	ea	-	-	0.72	408.19	-	-	-		-	-	408.1
С Туре			600	ea	-	-	0.72	432.00	-	-	-		-	-	432.0
Caulking			1	ls	-	-	300.00	300.00	-		-		-	-	300.0
Window Security Screen	IS		915	sf	-	-	-	-	20.00	18,300.00	-	-	-	-	18,300.0
Installation Crew	haudi:	يا - الد - الد - الد		-									1		^^
Eoroman	hourly 50.00	daily \$400.00			-	-	-				-	-	-	-	0.0
Foreman journeyman 1	38.00	\$304.00			-	-	-		-		-	-	-	-	0.0
journeyman 2	38.00	\$304.00		 			-		-		-	-	-	-	0.0
journeyman 3	38.00	\$304.00					-	-	-			-	 	-	0.0
Pick up truck	00.00	\$35.00					-	-	-	-	-	-	-	-	0.0
Rack Truck		\$125.00					-	-	-		-		-	-	0.0
Van with tools and parts		\$185.00					-	-	-		-		-	-	0.0
Per diem		\$1,300.00													
Daily Sub Total		\$2,957.00	1	Days	\$2,957.00	2,957.00	-	-	-	-	-		-	-	2,957.0
·		sf	·												
Barn Door 1		95	1	ea	1,140.00	1,140.00	3,230.00	3,230.00	-	-	-	-	-	-	4,370.0
Barn Door 2		114	1	ea	1,368.00	1,368.00	3,876.00	3,876.00	-	-	-		-	-	5,244.0
				1							I		1	1	

Division 9

ITEM DESCRIPTION		Quant	ity	Labor	Cost	Materi	al Cost	Subco	ntractor	Equ	ipment	0	Other	TOTAL
ITEM DESCRIPTION	٧.	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 9 - Finishes														
Walls & Partitions	None	0	ls	-		-	-	-		-	-	-	-	0.0
Hard Ceilings	None	0	ls	-	-	-	-	-	-	-	-	-	-	0.0
Acoustic Ceilings	None	0	ls	-	-	-		-	-	-	-	-	-	0.0
Flooring	None	0	ls	-		-	-	-		-		-	-	0.0
Paint														
Exterior None		0	sf	-		-	-	-	-	-	-	-	-	0.0
Interior Misc Steel/ Handrail		1	ls	-	-	-	-	-	-	-	-	-	-	0.0
TOTAL FINISHES		l			0.00		0.00		0.00	1	0.00		0.00	

Division 10													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mater	ial Cost	Subco	ntractor	Eq	uipment	(Other	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 10 - Specialties													
Interior Signage	2	ea	12.00	24.00	150.00	300.00	-	-	-	-	-	-	324.00
Fire Extinguisher on Brackets	1	ea	50.00	50.00	67.00	67.00	-	-	-	-	-		117.00
TOTAL SPECIALTIES				74.00		367.00		0.00		0.00		0.00	441

Division 11													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mater	ial Cost	Subco	ntractor	Eq	uipment		Other	TOTAL
TIEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 11 - Equipment													
Not Used	1	ea		-	-		-		-		-	-	0.00
TOTAL EQUIPMENT				0.00		0.00		0.00		0.00		0.00	0

Division 12													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mater	ial Cost	Subco	ntractor	Equ	uipment		Other	TOTAL
TIEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 12 - Furnishings													
Not Used	1	ea		-	-	-	-	-	-	-	-	-	0.00
TOTAL FURNISHINGS				0.00		0.00		0.00		0.00		0.00	0

Division 13													
ITEM DESCRIPTION	Quant	tity	Labo	r Cost	Mater	ial Cost	Subco	ntractor	Equ	uipment		Other	TOTAL
TIEW DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 13 - Special Construction													
Not Used	1	ls	-	-	-	-	-	-	-	-	-	-	0.00
	<u> </u>								·		·		
TOTAL SPECIAL CONSTRUCTION				0.00		0.00		0.00		0.00		0.00	0

Division 14													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mater	ial Cost	Subco	ntractor	Eq	uipment	(Other	TOTAL
TIEW DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 14 - Conveyors													
Not Used	1	ea	-	-	-			•	-	-	-	-	0.00
TOTAL CONVEYORS				0.00		0.00		0.00		0.00		0.00	0

Division 21													
ITEM DECORIDATION	Quant	ity	Labo	r Cost	Materi	ial Cost	Subco	ntractor	Eq	uipment	(Other	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 21 - Fire Protection													
None Required	1	ea	-	-	-	-	-	-	-		-	-	0.00
TOTAL MECHANICAL				0.00		0.00		0.00		0.00		0.00	0

Division 22													
ITEM DESCRIPTION	Quan	tity	Labo	r Cost	Mater	ial Cost	Subco	ntractor	Eq	uipment		Other	TOTAL
TIEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 22 - Plumbing													
See Demolition in Division 2 Assembly													
				-		-		-		-		-	-
Plumbing Contractor Overhead	8%			-		-		-		-		-	-
Profit	8%			-		-		-		-		-	-
TOTAL PLUMBING				0.00		0.00		0.00		0.00		0.00	0.00

Division 23													
ITEM DESCRIPTION	Quant	tity	Labo	r Cost	Mater	ial Cost	Subco	ontractor	Eq	uipment	(Other	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 23 - Mechanical - HVAC													
See Demolition in Division 2	1	ls	-	-	,	-	-	-		-	-	-	0.00
				\$0.00		\$0.00		\$0.00		\$0.00		\$0.00	\$0.00
				-		-		-		-		-	-
TOTAL HVAC				0.00		0.00		0.00		0.00		0.00	0.00

ITEM DECODIDATION	Quant	ity	Labo	r Cost	Materia	al Cost	Subcor	ntractor	Equ	ipment	C	ther	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 26 - Electrical													
Construction Temp Power	1	ls	-	-	-	-	2,300.00	2,300.00	-	-	-	-	2,300.0
Construction illumination	3,424	sf	-	-	-	-	-	-	-	-	0.50	1,712.00	1,712.0
													0.0
Panel 480Y,270V, 42 circuits	1	ea	4,065.00	4,065.00	1,575.00	1,575.00	-	-	-	-	-	-	5,640.0
Dry Transformer	1	ea	220.00	220.00	340.00	340.00	-	-	-	-	-	-	560.0
2'x4' Fixture	4		74.00	296.00	153.00	612.00							908.0
Emergency ballast, factory installed	4	ea	0.00	0.00	153.00	314.00	-	-	-	-	-	-	314.0
Fixture wiring whip	2	ea	12.40	49.60	157.00	60.00	-	-	-			-	109.6
Exit light, LED, single face w/battery	4	ea ea	84.00	168.00	126.00	252.00	-	-	-			-	420.0
Emergency Light with Battery Backup	2	ea	110.00	440.00	162.00	648.00	-	-	-		-		1,088.0
Emergency Light with battery backup	4	ea	110.00	440.00	102.00	040.00	-		-		-	-	1,000.0
Toggle switch, single pole with occupancy sensor	1	ea	14.50	14.50	8.40	8.40	-	-	-	-	-	-	22.9
Receptacle, GFI, 20A	3	ea	14.50	43.50	35.50	106.50	-	-	-	-	-	-	150.0
Electrical metallic tubing, 3/4"	117	1£	3.80	444.60	1.91	223.47							668.0
Wire. #12 solid	2.81	clf	34.00	95.54	15.90	44.68	-	-					140.2
Wall plate, 1-gang	2.01	ea	5.56	22.24	1.34	5.36	-						27.6
Manual motor starter, 1-pole	3	ea	58.00	174.00	62.50	187.50	-						361.5
Wire, #1/0	0.6	clf	111.00	66.60	254.00	152.40	-	-	-	-	-	-	219.0
Wire, #6	0.15	clf	57.00	8.55	62.00	9.30	_	-	-	-			17.8
Wire, #2	2.2	clf	82.00	180.40	155.00	341.00	-		-		-	-	521.4
Wire, #8	0.55	clf	46.50	25.58	41.50	22.83	-	-	-		-	-	48.4
Wire, #4	0.15	clf	70.00	10.50	98.50	14.78	-	-	-	-	-	-	25.2
Grounding	1	ls		-	-	-	8,200.00	8,200.00	-	-	-	-	8,200.0
<u> </u>													
TOTAL ELECTRICAL				6.324.61		4.917.21		10.500.00		0.00		1.712.00	23.453.8

Division 31, 32 and 33												
ITEM DESCRIPTION	Quantity	Labo	r Cost	Mater	rial Cost	Subco	ntractor	Equi	pment	C	Other	TOTAL
ITEM DESCRIPTION	Number Un	t Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	

Division 31 - Earthwork														
						21.00								
Building interior pit stru		85	cy	10.00	847.41	24.00	2,033.78	-	-	-	-	-	-	2,881.19
Sub Total Earthwork				-	847.41	-	2,033.78	-	-	-	-	-	-	2,881.19
Division 32 - Exterior Improvements														
Sidewalks		0	Is	-	-	-	-	-	-	-	-	-	-	0.00
Parking		0	ls	-	-	-	-	-	-	-	-	-	-	0.00
Landscaping		0	ls	-	-	-	-	-	-	-	-	-	-	0.00
Sub Total Exterior Im	provements				-		-		-		-		-	-
Division 33 - Utilities														
Water	None	1	ls	-	-	-	-	-	-	-	-	-	-	0.00
Sanitary	None	1	ls	-	-	-	-	-	-	-	-	-	-	0.00
Electric	Hook up to existi	1	Is	-	-	-	-	10,000.00	10,000.00	-	-	-	-	10,000.00
Sub Total Utilities					-		-		10,000.00		-		-	10,000.00
													<u> </u>	
TOTAL EARTHWORK, Exterior Finish	EARTHWORK, Exterior Finishes & Utilities						2,033.78		10,000.00		0.00		0.00	12,881.19

	\$ 577,444
Total Cost	\$ 577,444
Other	\$ 1,712
Equipment	\$ 1,500
Subcontract	\$ 256,260
Material	\$ 278,781
Labor	\$ 39,191

Diesel Plant Repair Project Building 2 City of Key West Engineering Department

3,657 sf

ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	rial Cost	Subcon	tractor	Equ	uipment	0	ther	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 2 - Existing Conditions													
Abatement													
Asbestos Abatement	1	allw	-	-	-	-	10,000.00	10,000.00	-	-	-	-	10,000.0
Lead Paint Abatement	1	allw	-	-	-	-	3,500.00	3,500.00	-	-	-	-	3,500.0
Contaminated Soils	1	allw	-	-	-		5,000.00	5,000.00	-	-	-	-	5,000.0
Shoring - Heavy Duty	1	allw	-	-	-		15,000.00	15,000.00	-		-	-	15,000.0
Remove all electric and mechanical devices - leave Gen Set	3,657	sf	-	-	-	-	3.25	11,885.25	-	-	-	-	11,885.2
Broom Clean and dump	3,657	sf	-	-	-	-	0.30	1,097.10	-	-	-	-	1,097.1
TOTAL EXISTING CONDITIONS				0.00		0.00		46.482.35		0.00		0.00	46,48

ITEM DESCRIPTION	Quant	tity	Labo	r Cost	Mate	rial Cost	Subcor	ntractor	Equ	uipment		Other	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 3 - Concrete													
Building Slab Repair (Cut and Square Edges, Structural G	ravel, Dowels, Placement)												
Pit Infill Slab Structure	250	sf											
Ready Mix Materials	3	су	-	-	145.00	447.08	-	-	-	-	-	-	447.0
Admixtures - mid range	3	су	-		3.00	9.25	-	-	-	-	-	-	9.2
Fiber Mesh	3	су	-		5.00	15.42	-	-	-	-	-	-	15.4
Dowels	95	ea	15.00	1,425.00	3.00	285.00	-	-	-	-	-	-	1,710.0
SOG Concrete Placement	250	sf	2.00	500.00	-	-	-	-	-	-	-	-	500.0
Cure	250	sf	0.05	12.50	0.02	5.00	-	-	-	-	-	-	17.5
Caulk Control Joint & Saw Cuts	0	lf	1.00		0.44			-	-	-	-	-	0.0
Pour Prep	1	ls	450.00	450.00	-		-	-	-	-	-	-	450.0
Pumps	1	ea	-	-	-	-	-	-	1,500.00	1,500.00	-	-	1,500.0
TOTAL CONCRETE				2,387.50		761.75		0.00		1.500.00		0.00	4,64

ITEM RECODIFICAL	Quant	ity	Labo	r Cost	Mate	rial Cost	Subcon	itractor	Equ	uipment	C	ther	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 4 - Masonry													
Exterior Masonry Repair													
Exterior Scaffold	3,600	sf		-	-		4.50	16,200.00	-	-	-	-	16,200.0
Exterior Scaffold Reinforced Plastic Wrap for Dust Control	3,600	sf	-	-	-	-	3.10	11,160.00	-	-	-	-	11,160.0
Exterior Elevation A Repoint	1,107	sf	-	-	-	-	8.00	8,856.00	-	-	-	-	8,856.0
Exterior Elevation B Repoint	1,137	sf	-	-	-	-	8.00	9,096.00	-	-	-	-	9,096.0
Exterior Elevation C Repoint	1,129	sf	-	-	-	-	8.00	9,032.00	-	-	-	-	9,032.0
Exterior Elevation D Repoint	762	sf	-	-	-	-	8.00	6,096.00	-	-	-	-	6,096.0
Grout Masonry Door & Window Jambs	14	ea	-	-	-	-	41.00	574.00	-	-	-	-	574.0
Structure Crack Repair	85	lf	-	-	-	-	41.00	3,485.00	-	-	-	-	3,485.0
Interior Masonry Repair													
Interior Scaffold	3,600	sf	-	-	-		4.50	16,200.00	-	-	-	-	16,200.0
Interior Elevation 1 Repoint	1.107	sf	-		-		8.00	8,856.00	-	-	-	-	8,856.0
Interior Elevation 2 Repoint	1,137	sf	-	-	-		8.00	9,096.00	-	-	-	-	9,096.0
Interior Elevation 3 Repoint	1,129	sf	-	-	-		8.00	9,032.00	-	-	-	-	9,032.0
Interior Elevation 4 Repoint	762	sf	-	-	-	-	8.00	6,096.00	-	-	-	-	6,096.0
Structure Crack Repair	85	lf	-	-	-	-	41.00	3,485.00	-	-	-	-	3,485.0
Infills	10	ea		-	-		560.00	5,600.00	-	-	-	-	5,600.0
TOTAL MASONRY				0.00		0.00		122,864.00		0.00		0.00	122,864.0

Number N	Division 5			Quant	tity	Labor	Coet	Mato	rial Cost	Subcont	tractor	East	uipment		Other	TOTAL
Division 5 - Metals		ITEM DESCRIPTION														IOIAL
Second Sub Removal & Excavate 11	Division 5 - N	letals		Humber	Oiiit	Oint Gost	Total	Onit Gost	10101	Ollit Gost	rotai	Onit Goot	rotui	Onit Gost	Total	
22/21/5 Reinforced Concrete																
Diamond expansion joint 11 ea	Excavate	Slab Removal & Excavate		11	ea	-	-	-		385.00	4,235.00	-	-	-	-	4,235.00
Materials Beams If ea	2'x2'x1.5'	Reinforced Concrete		11	ea	-	-	-	-	425.00	4,675.00	-	-	-	-	4,675.00
Beams F		Diamond expansion joint		11	ea	-	-	-	-	120.00	1,320.00	-	-	-	-	1,320.00
Beams H																
W14 x 61 30 11 20130																
W12 x 90																
S2.500 \$95,000 17 ths																
S2.50 \$95.00 17 ms	W12 x 30	15														
Primer 17																
\$2.5 per pd Industrial		\$2,500	\$95,000													110,155.50
State Stat	Primer			17	tns	-	-	250.00	4,236.75	-	-	-	-	-	-	4,236.75
Bolts																
Shim Stock		\$4.30 per pd Commercial														
Shim Stock																
Shim Stock	Polto			152	00			12.25	1 962 00							1,862.00
Grout				102												500.00
Velding Gas & Sundry				6		+										180.00
Labor hr daily		& Sundry														600.00
Labor foreman \$65.55 \$524.40	Wolding Gus	a curiary			10		_	000.00	000.00				_			000.00
Labor foreman	Labor															
Labor foreman \$65.55 \$524.40 Steel Erector 1 \$55.00 \$440.00 Steel Erector 2 \$55.00 \$440.00 Steel Erector 3 \$55.00 \$440.00 Pick up truck \$36.00 Rack truck \$101.00 Hoist & Lifts \$673.00 Perdiem \$1,250.00 Overhead & Profit \$875.95 Daily Burn Rate \$4,780.35 Steel Contractor 5 day \$4,780.35 - - - - - -		hr	daily													
Steel Erector 1 \$55.00 \$440.00 \$440.00 Steel Erector 2 \$55.00 \$440.00 \$440.00 Steel Erector 3 \$55.00 \$440.00 \$440.00 Pick up truck \$36.00 \$36.00 \$440.00 Rack truck \$101.00 \$100.00 \$440.00 Hoist & Lifts \$673.00 \$673.00 \$673.00 Perdiem \$1,250.00 \$1,250.00 \$1,250.00 Overhead & Profit \$875.95 \$1,250.00 \$1,250.00 Daily Burn Rate \$4,780.35 \$4,780.35 \$1,250.00 Steel Contractor \$4,780.35 \$4,780.35 \$1,250.00	Labor forema															
Steel Erector 2 \$55.00 \$440.00																
Pick up truck \$36.00	Steel Erector		\$440.00													
Rack truck \$101.00 <td>Steel Erector</td> <td>3 \$55.00</td> <td>\$440.00</td> <td></td>	Steel Erector	3 \$55.00	\$440.00													
Hoist & Lifts \$673.00	Pick up truck		\$36.00													
Perdiem \$1,250.00			\$101.00													
Overhead & Profit \$875.95 Image: Contractor of the contractor o	Hoist & Lifts		\$673.00													
Daily Burn Rate \$4,780.35 Steel Contractor 5 day \$4,780.35 -	Perdiem		\$1,250.00													
Steel Contractor 5 day \$4,780.35 23,901.76																
	Daily Burn Ra															
Crane Service 5 day 1,100.00 5,500.00	-	Steel Contracto	or	5	day	\$4,780.35	23,901.76	-	-	-	-	-	-	-	-	23,901.76
	Crane Service	<u> </u>		5	day	_	-	_		1.100.00	5.500.00	-	_	-	_	5,500.00
		-								.,100.00	3,000.00					0,000.00
		_														

			Quant	titv	Labo	r Cost	Mate	rial Cost	Subcor	ntractor	Fa	uipment		Other	TOTAL
	ITEM DESCRIPTION		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	TOTAL
ivision 6 - Wood & Pla	stics														
uilding Roof Framing	rebuild	d on existing steel	3,759	sf											
Replace in Kind Beam Pa	ads		40	ea	-	-	36.00	1,440.00	-	-	-	•	-	-	1,440.0
Roof Joi	st	2x10x12	144	ea	-	-	36.00	5,184.00	-	-	-	•	-	-	5,184.0
Truss Sp		2x4	100	lf	-	-	1.00	100.00	-	-	-		-	-	100.0
Roof Str	apping	2x4	300	3f	-	-	1.00	300.00	-	-	-	-	-	-	300.0
Roof She		5/8" PLY	117	sheets	-	-	58.00	6,813.19	-	-	-	-	-	-	6,813.1
Roof Sot			250	rf	-	-	65.00	16,250.00	-	-	-		-	-	16,250.0
Parapet	Endwell Framing & Sheathing	eframe parapets	240	sf	-	-	45.00	10,800.00	-	-	-	-	-	-	10,800.0
Crickets Roof Ra	fters	2x6x12	104	ea	_		24.00	2,496.00	_	_	-	-	_	_	2,496.0
Truss Sp		2x4	85	If .	_		1.00	85.00	-	-	-		-	-	85.0
Roof Str		2x4	125	if	-	-	1.00	125.00	_		-		-	-	125.0
Roof She		5/8" PLY	39	sheets	-	-	58.00	2,268.79	-	-	-		-	-	2,268.7
Ice & Wa	ater Shield	200 sf per roll	19	rolls	-	-	120.00	2,255.40	-	-	-		-	-	2,255.4
Roof Sot	fit	•	140	rf	-	-	65.00	9,100.00	-	-	-		-	-	9,100.0
Parapit E	Endwall Framing & Sheathing	eframe perrapits	552	sf	-	-	45.00	24,840.00	-	-	-	•	-	-	24,840.0
Timber F	rame Componets		1	Is	-	-	10,000.00	10,000.00	_	_	_	-	-	-	10,000.0
	-						.,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	-,,,,,,,,,,							,
Hardwar	e, hangers & fasteners		1	ls	-	-	15,000.00	15,000.00	-	-	-		-	-	15,000.0
Carpente		6 men 2 weeks	480	man hrs	53.20	25,536.00	_						_		25,536.0

TOTAL WOOD & PLASTICS	25,536.00	105,617.38	0.00	0.00	0.00	131,153
-----------------------	-----------	------------	------	------	------	---------

Division 7													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	erial Cost	Subcon	tractor	Eq	uipment	(Other	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 7 - Thermal & Moisture Protection													
Exterior Stuccos Finish	0	sf	-	-	-	-	5.00	-	-	-	-		0.00
Metal Roofing	3,759	sf	-	-	-	-	18.00	67,662.00	-	-	-	-	67,662.00
Galv Metal Gutter	480	lf	-	-	-	-	16.00	7,680.00	-	-	-		7,680.00
Joint Sealants	1	ls	-	-	-	-	600.00	600.00	-	-	-		600.00
													·
TOTAL THERMO MOISTURE				0.00		0.00		75,942.00		0.00		0.00	75,942

Division 8			Quant	itv	Labor	Cost	Mater	ial Cost	Subcont	ractor	Eau	ipment	0	ther	TOTAL
	ITEM DESCRIPTION		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 8 - Doors & Wi	ndows														
Interior Doors															
None			0	ea		-		-	-	-	-		-		0.0
Exterior Doors															
	Door & Hardware		0	ea	-	-	-	-	-	-	-	-	-	-	0.0
101															
Windows and Glazing Window Opening Rebu	ila .		20			-			500.00	10.000.00			_		10,000.0
window Opening Rebu	iid		20	ea		-		-	500.00	10,000.00	-		-	-	10,000.0
Materials							+								
Windows							-								
1	A Type		18	sf	-	-	125.00	2,250.00	-	-	-	-	-	-	2,250.0
2	A Type		18	sf	-		125.00	2,250.00	-	-	-	-	-	-	2,250.0
3	A Type		18	sf	-	-	125.00	2,250.00	-	-	-	-	-	-	2,250.0
4	A Type		18	sf	-	-	125.00	2,250.00	-	-	-	-	-	-	2,250.0
5	A Type		18	sf	-	-	125.00	2,250.00	-	-	-	-	-	-	2,250.0
6	A Type		18	sf	-	-	125.00	2,250.00	-	-	-	-	-		2,250.0
7	A Type		18	sf	-	-	125.00	2,250.00	-	-	-		-	-	2,250.0
8	A Type		18	sf	-	-	125.00	2,250.00	-	-	-	-	-	-	2,250.0
9	A Type		18	sf	-	-	125.00	2,250.00	-	-	-	-	-	-	2,250.0
10	A Type		18	sf	-	-	125.00	2,250.00	-	-	-	-	-	-	2,250.0
11 12	A Type		18	sf	-	-	125.00 125.00	2,250.00 2,250.00	-	-	-	-	-	-	2,250.0 2,250.0
13	A Type A Type		18 18	sf sf	-	-	125.00	2,250.00	-	-	-	<u> </u>	-		2,250.0
14	A Type		18	sf	-		125.00	2,250.00	-	-	-		-		2,250.0
15	A Type		18	sf			125.00	2,250.00	-	-	-		-		2,250.0
16	A Type		18	sf	-	-	125.00	2,250.00	-	-	-		-		2,250.0
1	B Type		9	sf	-	-	125.00	1,125.00	-	-	-	-	-	-	1,125.0
journeyman 1	38.00	\$304.00					-		-	-	-	-	-	-	0.0
journeyman 2	38.00	\$304.00				İ	-	-	-	-	-	-	-	-	0.0
journeyman 3	38.00	\$304.00													
Pick up truck		\$35.00					-	-	-	-	-	-	-	-	0.0
Rack Truck		\$125.00					-	-	-	-	-	-	-	-	0.0
Van with tools and parts		\$185.00					-	-	-	-	-	-	-	-	0.0
Per diem		\$1,300.00			00.057.00	44 707 55									
Daily Sub Total		\$2,957.00	5	Days	\$2,957.00	14,785.00	-		-	-	-		-	-	14,785.0
Barn Door 1	Heavey Duty	77	1	ea	924.00	924.00	2,618.00	2,618.00	-	-	-	-	-	-	3,542.0
Barn Door 2	tripple price	114	1	ea	1,368.00	1,368.00	3,876.00	3,876.00	-	-	-	-	-	-	5,244.0
TOTAL DOORS & WIND	oows					17.077.00		47.308.03		16.480.00		0.00		0.00	80,86

Division 9													
ITEM DESCRIPTION	Quant	ity	Labor Cost		Material Cost		Subco	ntractor	Eq	uipment	Other		TOTAL
TIEW DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 9 - Finishes													
Walls & Partition None	0	ls	-	-	-	-	-	-	-	-	-		0.00
				•									
Hard Ceilings None	0	ls	-	-	-	-	-	-	-	-	-		0.00

TOTAL FINISHES				0.00		0.00		0.00		0.00		0.00	0
Exterior Notice		31	_		_		_			-	_	·	0.00
Paint Exterior None	0	of	_	_	_	_	_			_	_		0.00
Flooring None	0	ls	-	-	-	-	-	-	-	-	-	-	0.00
7.000000 Ocining Noric		10											0.00
Acoustic Ceiling None	0	le	_	_	_	_	_	_		_	_	_	0.00

Division 10		-		_									
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	ial Cost	Subco	ntractor	Eq	uipment	(Other	TOTAL
TIEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 10 - Specialties													
Interior Signage	2	ea	12.00	24.00	150.00	300.00	-	-	-	-	-	-	324.00
Fire Extinguisher on Brackets	1	ea	50.00	50.00	67.00	67.00	-	-	-		-	-	117.00
TOTAL SPECIALTIES				74.00		367.00		0.00		0.00		0.00	441

ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	rial Cost	Subcor	itractor	Eq	uipment		Other	TOTAL
IT EWI DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 11 - Equipment													
Not Used	1	ea			-			-	-	-	-		0.00
TOTAL EQUIPMENT				0.00		0.00		0.00		0.00		0.00	C

Division 12													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	erial Cost	Subco	ntractor	Eq	uipment		Other	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 12 - Furnishings													
Not Used	1	ea	-	-	-	-	-		-	-	-	-	0.00
TOTAL FURNISHINGS				0.00		0.00		0.00		0.00		0.00	0

Division 13													
ITEM DESCRIPTION	Quant	tity	Labo	r Cost	Mate	erial Cost	Subco	ntractor	Eq	uipment		Other	TOTAL
II EM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 13 - Special Construction													
Not Used	1	ls	-	-	-		-		-	-	-	-	0.00
													_
TOTAL SPECIAL CONSTRUCTION				0.00		0.00		0.00		0.00		0.00	0

Division 14													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	erial Cost	Subco	ntractor	Eq	uipment	(Other	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 14 - Conveyors													
Not Used	1	ea	-		-	-	-	-	-	-	-	-	0.00
TOTAL CONVEYORS				0.00		0.00		0.00		0.00		0.00	0

ITEM DESCRIPTION	Quant	tity	Labo	r Cost	Mate	rial Cost	Subco	ntractor	Eq	uipment		Other	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 21 - Fire Protection													
None Required	1	ea	-	-	-	-	-	-	-	-	-	-	0.00
TOTAL MECHANICAL				0.00		0.00		0.00		0.00		0.00	0

Division 22	Quant	ity	Laho	r Cost	Mate	rial Cost	Subcor	ntractor	Fai	uipment		Other	TOTAL
ITEM DESCRIPTION													IOIAL
	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 22 - Plumbing													
See Demolition in Division 2													
				-		-		-		-			
Plumbing Contractor Overhead	8%			-		-		-		-			-
Profit	8%			-		-		-		-			-
TOTAL PLUMBING				0.00		0.00		0.00		0.00		0.00	0.0

Division 23													
ITEM DESCRIPTION	Quan	tity	Labo	or Cost	Mate	erial Cost	Subco	ntractor	Eq	uipment	(Other	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 23 - Mechanical - HVAC													
See Demolition in Division 2	1	ls	-	-	-	-	-	-	-	-	-	-	0.00
				\$0.00		\$0.00		\$0.00		\$0.00		\$0.00	\$0.00
				·									
TOTAL HVAC				0.00		0.00		0.00		0.00		0.00	0.00

ITEM DESCRIPTION	Quant		Labo	r Cost	Mater	ial Cost	Subcont	ractor	Eq	uipment		Other	TOTAL
TI EW DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 26 - Electrical													
Construction Temp Power	1	ls	-	-	-	-	2,300.00	2,300.00	-	-	-	-	2,300.0
Construction illumination	3,424	sf	-	-	-	-	-	-	-	-	0.50	1,712.00	1,712.0
													0.0
Panel 480Y,270V, 42 circuits	1	ea	4,065.00	4,065.00	1,575.00	1,575.00	-	-	-	-	-	-	5,640.0
Dry Transformer	1	ea	220.00	220.00	340.00	340.00	-	-	-	-	-	-	560.0
2'x4' Fixture	4	ea	74.00	296.00	153.00	612.00	_		-		-	-	908.0
Emergency ballast, factory installed	2	ea	0.00	0.00	157.00	314.00	-	-	-	-	-	-	314.0
Fixture wiring whip	4	ea	12.40	49.60	15.00	60.00	-	-	-	-	-	-	109.6
Exit light, LED, single face w/battery	2	ea	84.00	168.00	126.00	252.00	-	-	-	-	-	-	420.0
Emergency Light with Battery Backup	4	ea	110.00	440.00	162.00	648.00	-	-	-	-	-	-	1,088.0
Toggle switch, single pole with occupancy sensor	1	ea	14.50	14.50	8.40	8.40	-	-	-	-	-	-	22.9
Receptacle, GFI, 20A	3	ea	14.50	43.50	35.50	106.50	-	-	-	-	-	-	150.0
F1 () (117		0.00	444.00	4.04	200 47							000.0
Electrical metallic tubing, 3/4"	117	IT If	3.80	444.60	1.91	223.47	-	•	-		-	•	668.0
Wire, #12 solid	2.81	clf	34.00	95.54	15.90	44.68		-	-	-	-	-	140.2
Wall plate, 1-gang	4	ea	5.56	22.24	1.34	5.36	-	-	-	-	-	-	27.6
Manual motor starter, 1-pole	3	ea	58.00	174.00	62.50	187.50	-	-	-	-	-	-	361.5
Wire, #1/0	0.6	clf	111.00	66.60	254.00	152.40	-	-	-	-	-	-	219.0
Wire, #6	0.15	clf	57.00	8.55	62.00	9.30	-	-	-		-	-	17.8
Wire, #2	2.2	clf	82.00	180.40	155.00	341.00	-	-	-	-	-	-	521.4
Wire, #8	0.55	clf	46.50	25.58	41.50	22.83	-	-	-	-	-	-	48.4
Wire, #4	0.15	clf	70.00	10.50	98.50	14.78	-	-	-	-	-	-	25.2
Grounding	1	ls		-	-	-	8,200.00	8,200.00	-	-	-	-	8,200.0
TOTAL ELECTRICAL	•			6.324.61		4,917.21	•	10,500.00		0.00	•	1.712.00	23,453.8

·	Quant	itv	Laho	r Cost	Mate	rial Cost	Subco	ntractor	Fa	uipment		Other	TOTAL
ITEM DESCRIPTION										•			
	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 31 - Earthwork													
Building interior pit structural fill	48	су	10.00	478.52	24.00	1,148.44	-	-	-	-	-	-	1,626.9
Sub Total Earthwork			-	478.52	-	1,148.44	-	-	-	-	-	-	1,626.9
Division 32 - Exterior Improvements													
Sidewalks	0	lf	-	-	-	-	-	-	-	-	-	-	0.0
Parking	0	ea	-	-	-	-	_	_	_		_	-	0.

Landscaping		0	ls	-	-	-	-	-	-	-	-	-	-	0.00
Sub Total Exterior Improvements					-		-		-		-		-	0.00
Division 33 - Utilities														
Water	None	1	ls	-	-	-	-	-	-	-	-	-	-	0.00
Sanitary	None	1	ls	-	-	-	-	-	-	-	-	-	-	0.00
Electric	Hook up to exis	1	ls	-		-	-	10,000.00	10,000.00	-	-	-	-	10,000.00
Sub Total Utilities					-		-		10,000.00		-		-	10,000.00
TOTAL EARTHWORK, Exterior Finishes & Utilities					478.52		1,148.44		10,000.00		0.00		0.00	11,626.96

Labor	\$ 75,779
Material	\$ 277,654
Subcontract	\$ 287,768
Equipment	\$ 1,500
Other	\$ 1,712
Total Cost	\$ 644,414
	\$ 644,414

Diesel Plant Repair Project Building 3 City of Key West Engineering Department

3,720 st

ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	erial Cost	Subcon	tractor	Equ	ipment	O	ther	TOTAL
II EM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 2 - Existing Conditions													
Abatement													
Asbestos Abatement	1	allw	-		-	-	10,000.00	10,000.00	-	-	-	-	10,000.
Lead Paint Abatement	1	allw			-	-	3,500.00	3,500.00	-	-	-	-	3,500.
Containated Soils	1	allw			-	-	5,000.00	5,000.00	-	-	-	-	5,000.
Shoring - Heavy Duty	1	allw			-	-	15,000.00	15,000.00	-	-	-	-	15,000.
Remove all electric and mechanical devices - leave Gen Set	3,720	sf			-	-	3.25	12,090.00	-	-	-	-	12,090.
Broom Clean and dump	3,720	sf	-	-	-	-	0.30	1,116.00	-	-	-	-	1,116.
OTAL EXISTING CONDITIONS				0.00		0.00		46,706.00		0.00		0.00	46,7

ITEM DESCRIPTION	Quant	ity	Labor	Cost	Mate	rial Cost	Subcor	ntractor	Equ	uipment		Other	TOTAL
TIEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 3 - Concrete													
BuildingSlab Repair (Cut and Square Edges, Structural G	ravel, Dowels, Placement)												
Pit Infill Slab Structure	344	sf											
Ready Mix Materials	4	су	-	-	145.00	615.19	-		-		-	-	615.1
Admixtures - mid range	4	су	-	-	3.00	12.73	-	-	-	-	-	-	12.7
Fiber Mesh	4	су	-	-	5.00	21.21	-	-	-	-	-	-	21.2
Dowels	148	ea	15.00	2,220.00	3.00	444.00	-	-	-	-	-	-	2,664.0
SOG Concrete Placement	344	sf	2.00	688.00	-	-	-	-	-	-	-	-	688.0
Cure	344	sf	0.05	17.20	0.02	6.88	-	-	-	-	-	-	24.0
Caulk Control Joint & Saw Cuts	0	lf	1.00	-	0.44		-	-	-	-	-	-	0.0
Pour Prep	1	ls	450.00	450.00	-		-	-	-	-	-	-	450.0
Pumps	1	ea	-	-	-	-	-	-	1,500.00	1,500.00	-	-	1,500.0
			<u> </u>					1					
TOTAL CONCRETE				3.375.20		1,100.01		0.00		1.500.00		0.00	5,97

ITEM DECORPORATION	Quant	ity	Labo	r Cost	Mate	rial Cost	Subcont	tractor	Equ	ipment	C	ther	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 4 - Masonry													
Exterior Masonry Repair													
Exterior Scaffold	4.530	sf	-		-		4.50	20,385.00	-		_	-	20,385.00
Exterior Scaffold Reinforced Plastic Wrap for Dust Control	4,530	sf	-		-		3.10	14,043.00	- 1	_	-	-	14,043.00
Exterior Elevation A Repoint	396	sf	-		-	-	4.50	1,782.00	-	-	-	-	1,782.0
Exterior Elevation B Repoint	1,142	sf	-		-	-	4.50	5,139.00	- 1	-	-	-	5,139.0
Exterior Elevation C Repoint	1,192	sf	-		-	-	4.50	5,364.00	- 1	-	-	-	5,364.0
Exterior Elevation D Repoint	1,112	sf		-	-	-	4.50	5,004.00	-	-	-	-	5,004.0
Grout Masonry Door & Window Jambs	14	ea		-	-	-	41.00	574.00	-	-	-	-	574.0
Scrcture Crack Repair	85	If		-	-	-	41.00	3,485.00	-	-	-	-	3,485.00
Interior Masonry Repair													
Interior Scaffold	3,600	sf	-		-	-	4.50	16,200.00	-	-	-	-	16,200.0
Interior Elevation 1 Repoint	396	sf	-		-	-	8.00	3,168.00	- 1	-	-	-	3,168.0
Interior Elevation 2 Repoint	1,142	sf	-		-	-	8.00	9,136.00	- 1	-	-	-	9,136.0
Interior Elevation 3 Repoint	1,192	sf	-		-	-	8.00	9,536.00	- 1	-	-	-	9,536.0
Interior Elevation 4 Repoint	1,112	sf	-		-	-	8.00	8,896.00	-	-	-	-	8,896.0
Structure Crack Repair	85	lf	-		-	-	41.00	3,485.00	-	-	-	-	3,485.0
Infills	10	ea	-	-	-	-	560.00	5,600.00	-	-	-	-	5,600.0
							L					L	
OTAL MASONRY				0.00		0.00		111,797.00		0.00		0.00	111,797.0

Division 5							
ITEM DESCRIPTION	Quantity	Labor Cost	Material Cost	Subcontractor	Equipment	Other	TOTAL
THEM DESCRIPTION							

İ	ILINI DEGUNIF HOR		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 5 - M	etals														
OPTION 2 ON	ILY														
Excavate	Slab Removal & Excavate		30	ea	-		-	-	385.00	11,550.00	-		-		11,550.00
2'x2'x1.5'	Reinforced Concrete		30	ea	-		-		425.00	12,750.00			-		12,750.00
	Diamond expansion joint		30	ea	_		_		120.00	3,600.00			_	-	3,600.00
	Brameria expansion joint			ou					120.00	0,000.00					- 0,000.00
Materials			+												
Beams	If	ea													
W14 x 61	30	13	23790												
W12 x 30	15	39	17550												
		52	41340												
	\$2,500	\$130,000	22	tns	-		6,500.00	141,072.75	-		- 1		-		141,072.75
Primer	, ,	,,	22	tns	-		250.00	5,425.88	-		- 1		-		5,425.88
	\$2.5 per pd Industrial							.,							
	\$4.30 per pd Commercial														
	ψ που per pa commercial														
Bolts			208	ea	-	-	12.25	2,548.00	-		- 1		-		2,548.00
Shim Stock			1	Is	-	-	500.00	500.00	-		-	-	-	-	500.00
Grout			15	sacks	-		30.00	450.00	-	-	- 1		-	-	450.00
Welding Gas 8	R Sundry		1	ls	-	-	600.00	600.00	-	-	- 1		-	-	600.00
Labor															
	hr	daily													
Labor foreman		\$524.40													
Steel Erector		\$440.00													
Steel Erector 2		\$440.00													
Steel Erector 3		\$440.00	+												
Pick up truck	955.00	\$36.00	+												
Rack truck		\$101.00													
Hoist & Lifts		\$673.00													
Perdiem		\$1,250.00													
Overhead & P	rofit	\$875.95													
Daily Burn Rat		\$4,780.35													
Daily Buill Kai	Steel Contractor	94,700.33	5	day	\$4,780.35	23,901.76									23,901.76
-	Steet Contractor		3	uay	φ4,10U.35	23,901.76	-	-	-	•	-	-	-	-	23,901.76
Crane Service			5	day	-	-	-	_	1,100.00	5,500.00				-	5,500.00
Cialle Selvice			- 3	uay	-	-	-	-	1,100.00	5,500.00	 		 		5,500.00
											\vdash				
TOTAL META	ıs					23,901.76		150,596.63		5.500.00		0.00		0.00	179,998
						20,001.70		100,000.00		5,555.00		0.00			.,,,,,,,,

Division 6			Quant	itv	Labo	r Cost	Mate	rial Cost	Subcor	tractor	Fai	uipment		ther	TOTAL
	ITEM DESCRIPTION		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 6 - V	Nood & Plastics			-				1.575					J 2001		
Building Roo	of Framing	rebuild on existing steel	3,860	sf											
Replace in Ki	ind Beam Pads		44	ea	-	-	36.00	1,584.00	-	-	-	-	-	-	1,584.00
	Roof Joist	2x10x12	144	ea	-	-	36.00	5,184.00	-	-	-	-	-	-	5,184.00
	Truss Spacers	2x4	100	lf	-	-	1.00	100.00	-	-	-		-	-	100.00
	Roof Strapping	2x4	300	3f	-	-	1.00	300.00	-		-		-		300.00
	Roof Sheathing	5/8" PLY	121	sheets	-	-	58.00	6,996.25	-		-		-		6,996.25
	Roof Soffit		250	rf	-	-	65.00	16,250.00	-		-		-	-	16,250.00
	Parapit Endwall Framing & Sheat	reframe perrapits	240	sf	-	-	45.00	10,800.00	-	-	-	-	-	-	10,800.00
Crickets	Roof Rafters	2x6x12	104	ea	-	-	24.00	2,496.00	-	-	-	-	-	-	2,496.00
	Truss Spacers	2x4	85	lf	-	-	1.00	85.00	-	-	-	-	-	-	85.00
	Roof Strapping	2x4	125	lf	-	-	1.00	125.00	-	-	-	-	-	-	125.00
	Roof Sheathing	5/8" PLY	40	sheets	-	-	58.00	2,329.75	-	-	-	-	-	-	2,329.75
	Ice & Water Shield	200 sf per roll	19	rolls	-	-	120.00	2,316.00	-	-	-	-	-	-	2,316.00
	Roof Soffit		140	rf	-	-	65.00	9,100.00	-	-	-	-	-	-	9,100.00
	Parapit Endwall Framing & Sheat	reframe perrapits	552	sf	-	-	45.00	24,840.00	-	-	-	-	-	-	24,840.00
	Timber Frame Componets		1	ls	-	-	10,000.00	10,000.00	-	-	-	-	-	-	10,000.00
	Hardware, hangers & fasteners		1	ls	-	-	15,000.00	15,000.00	-	-	-		-	-	15,000.00
	Carpenter Crew	6 men 2 weeks	480	man hrs	53.20	25,536.00	_	-			-		_		25,536.0
		Woold	.00		00.20	_0,000.00									20,000.00
TOTAL WOO	DD & PLASTICS					25,536.00	<u> </u>	105.922.00		0.00	•	0.00		0.00	131,458

ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	erial Cost	Subcor	ntractor	Equ	uipment	C	Other	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	i
Division 7 - Thermal & Moisture Protection													i
													i
Exterior Stuccos Finish	2,208	sf	-	-	-	-	5.00	11,040.00	-	-	-	-	11,040.
Metal Roofing	3,860	sf	-	-	-	-	18.00	69,480.00	-	-	-	-	69,480.
Galv Metal Gutter	480	lf	-	-	-	-	16.00	7,680.00	-	-	-	-	7,680.0
Joint Sealants	1	ls	-	-	-	-	600.00	600.00	-	-	-	-	600.0
TOTAL THERMO MOISTURE				0.00		0.00		88,800.00		0.00		0.00	88,80

		Quant	itv	Labor	Cost	Mater	ial Cost	Subcon	tractor	Ea	uipment	1 (Other	TOTAL
	ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 8 - Doors & Wind	ows													
Interior Doors														
None		0	ea	-	-	-	-	-	-	-	-	-		0.00
Exterior Doors														
Door & Hai	rdware	1	ea	455.00	455.00	1,121.00	1,121.00	-	-	-	-	-	-	1,576.00
Windows and Glazing														
Window Opening Rebuild		291	55	-	-	-	-	500.00	145,455.84	-	-	-	-	145,455.84
Materials														
Windows														
1	A Type	18	sf	-	-	44.88	807.86	-	-	-	-	-	-	807.86
1	В Туре	25	sf	-	-	44.88	1,122.03	-	-	-	-	-	-	1,122.03
journeyman 2	38.00 \$304.00					-	-	-	-	-	-	-	-	0.00
journeyman 3	38.00 \$304.00													
Pick up truck	\$35.00					-	-	-	-	-	-	-	-	0.00
Rack Truck	\$125.00					-	-	-	-	-	-	-	-	0.00
Van with tools and parts	\$185.00					-	-	-	-	-	-	-	-	0.00
Per diem	\$1,300.00													
Daily Sub Total	\$2,957.00	3	Days	\$2,957.00	8,871.00	-	-	-	-	-	-	-	-	8,871.00
	sf													
Barn Door 1	77	1 1	ea	924.00	924.00	2,618.00	2,618.00	-	-	-	-	-	-	3,542.00
Barn Door 2	114	1 1	ea	1,368.00	1,368.00	3,876.00	3,876.00	-	-	-	-	-		5,244.00
TOTAL DOORS & WINDO	ws				11,618.00		14,050.38		147,815.84		0.00		0.00	173,484

ITEM DESCRIPTION	Quant	tity	Labo	r Cost	Mate	rial Cost	Subcor	ntractor	Equ	ipment	0	ther	TOTAL
TIEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 9 - Finishes													
Nalls & Partitio None	0	ls	-										
Hard Ceilings None	0	ls	-	-	-	-	-	-	-	-	-	-	0.
					-		-		-		-	-	0
Acoustic Ceiling None	0	ls	-		-		-		-		-	-	0
					-		-		-		-		0
Flooring None	0	ls	-	-	-		-	-	-	-	-	-	0
Paint				-	-	-	-	-	-	-	-	-	0
Exterior None	0	sf	-	-	-	-	-	-	-	-	-	-	0
TOTAL FINISHES				0.00		0.00		0.00		0.00		0.00	

Division 10													
ITEM DESCRIPTION	Quant	tity	Labo	r Cost	Mate	erial Cost	Subcor	ntractor	Eq	uipment		Other	TOTAL
TI EW DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 10 - Specialties													
Interior Signage	2	ea	12.00	24.00	150.00	300.00	-		-	-	-	-	324.00
Fire Extinguisher on Brackets	1	ea	50.00	50.00	67.00	67.00	-	-	-	-	-	-	117.00
					, in the second		, and the second						

wood. Diesel Plant BLDG 3 BWS

													1 ugo 20 0
TOTAL SPECIALTIES				74.00		367.00		0.00		0.00		0.00	441
Division 11													
	Quant	itv	Labo	r Cost	Mate	rial Cost	Subcor	ntractor	Ea	uipment		Other	TOTAL
ITEM DESCRIPTION	Number			Total	Unit Cost	Total	Unit Cost	Total	Unit Cost		Unit Cost		
Division 11 - Equipment													
Niet I (e.e.d.	1				_								0.00
Not Used	ı	ea	-	•	-	-	-	•	-		-	-	0.00
TOTAL EQUIPMENT				0.00		0.00		0.00		0.00		0.00	0
Division 12													
ITEM DESCRIPTION	Quant			r Cost		rial Cost	Subcor			uipment		Other	TOTAL
Division 12 - Furnishings	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
•													
	1	ls	-	-	-	-	-	-	-	-	-	-	0.00
TOTAL FURNISHINGS	L			0.00		0.00		0.00		0.00		0.00	0
Division 13													
	Quant			r Cost		rial Cost		ntractor		uipment		Other	TOTAL
ITEM DESCRIPTION	Number		Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost		Unit Cost	Total	
Division 13 - Special Construction													
Not Used	1	ls	-		-		-	-	-	-	-	-	0.00
TOTAL SPECIAL CONSTRUCTION				0.00		0.00		0.00		0.00		0.00	0
Division 14	Quant	itv	Laho	r Cost	Mato	rial Cost	Subcor	ntractor	Fo	juipment		Other	TOTAL
ITEM DESCRIPTION	Number		Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost		IOIAL
Division 14 - Conveyors													
Not Used	1	ea	-	-	-	-	-	-	-	-	-	-	0.00
TOTAL CONVEYORS	1	1	1	0.00		0.00		0.00		0.00		0.00	0
Division 21													
	Quant	itv	Labo	r Cost	Mate	rial Cost	Subcor	ntractor	Ea	uipment	1	Other	TOTAL
ITEM DESCRIPTION	Number		Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost		Unit Cost	Total	
Division 21 - Fire Protection													
None Required	1	ea	-	-	-	-	_	-	-	-	_	-	0.00
None Required		Cu				_							0.00
TOTAL MECHANICAL				0.00		0.00		0.00		0.00		0.00	0
Division 22													
ITEM DESCRIPTION	Quant			r Cost		rial Cost		tractor		uipment		Other	TOTAL
	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 22 - Plumbing		 	 							 			
See Demolition in Division 2 Assembly													
				-		-		-		-		-	-
Plumbing Contractor Overhead	8%			-		-		-		-		-	-
Profit	8%	1	I.	-		-		-	L	1	I	-	-
TOTAL PLUMBING				0.00		0.00		0.00		0.00		0.00	0.00
Division 23													
ITEM DESCRIPTION	Quant			r Cost		rial Cost	Subcor			uipment		Other	TOTAL
Division 23 - Mechanical - HVAC	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
DIVISION 23 - MECHANICAI - TIVAC		 	 							 			
See Demolition in Division 2	1	ls	-	-	-	-	-	-	-	-	-	-	0.00
				\$0.00		\$0.00		\$0.00		\$0.00		\$0.00	\$0.00

wood. Diesel Plant BLDG 3 BWS

HVAC Contractor Overhead	8%		-	-	-	-	-	-
Profit	8%		-	-	-	-	-	-
TOTAL HVAC			0.00	0.00	0.00	0.00	0.00	0.00

ITEM DECODINATION	Quant	ity	Labo	r Cost	Mater	rial Cost	Subcon	tractor	Equ	uipment	C	ther	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 26 - Electrical													
Construction Temp Power	1	ls	-	-	-	-	2,300.00	2,300.00	-	-	-	-	2,300.00
Construction illumination	3,424	sf	-	-	-	-	-	-	-	-	0.50	1,712.00	1,712.00
													0.00
Panel 480Y,270V, 42 circuits	1	ea	4,065.00	4,065.00	1,575.00	1,575.00	-	-	-	-	-	-	5,640.00
Dry Transformer	1	ea	220.00	220.00	340.00	340.00	-	-	-		-	-	560.00
2'x4' Fixture	4		74.00	296.00	153.00	612.00							908.00
Emergency ballast, factory installed	2	ea	0.00	0.00		314.00	-		-	-	-	-	314.00
Fixture wiring whip	2	ea	12.40	49.60		60.00	-		-	-	-	-	109.60
Exit light, LED, single face w/battery	2	ea	84.00	168.00		252.00	-	-	-	-	-	-	420.00
Exit light, LED, single face w/battery Emergency Light with Battery Backup	4	ea	110.00	440.00		648.00	-	-	-	-	-	-	1,088.00
Emergency Light with battery backup	4	ea	110.00	440.00	162.00	040.00	-	-	-	-	-	-	1,000.00
Toggle switch, single pole with occupancy sensor	1	ea	14.50	14.50	8.40	8.40	_		_	-		-	22.90
Receptacle, GFI, 20A	3	ea	14.50	43.50		106.50	_	-	_		_	-	150.00
1000ptable, 011, 20/1		- Cu	14.00	40.00	00.00	100.00							100.00
Electrical metallic tubing, 3/4"	117	If	3.80	444.60	1.91	223.47	-	-	_	_	- 1	-	668.07
Wire, #12 solid	2.81	clf	34.00	95.54	15.90	44.68	-		-		-		140.22
Wall plate, 1-gang	4	ea	5.56	22.24		5.36	-	-	-		-		27.60
Manual motor starter, 1-pole	3	ea	58.00	174.00	62.50	187.50	-	-	-	-	- 1	-	361.50
Wire, #1/0	0.6	clf	111.00	66.60	254.00	152.40	-	-	-	-	- 1	-	219.00
Wire, #6	0.15	clf	57.00	8.55	62.00	9.30	-	-	-		-	-	17.85
Wire, #2	2.2	clf	82.00	180.40	155.00	341.00	-	-	-		-	-	521.40
Wire, #8	0.55	clf	46.50	25.58	41.50	22.83	-	-	-	-	- 1	-	48.40
Wire, #4	0.15	clf	70.00	10.50	98.50	14.78	-	-	-	-	- 1	-	25.28
Grounding	1	ls		-	-	-	8,200.00	8,200.00	-	-	-	-	8,200.00
TOTAL ELECTRICAL				6,324.61		4,917.21		10,500.00		0.00		1,712.00	23,453.81

ITEM DE	SCRIPTION	Quant	ity	Labor	Cost	Mater	ial Cost	Subcon	tractor	Equ	ipment	0	ther	TOTAL
I EWI DES	SCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 31 - Earthwork														
Building interior pit str	ructural fill	57	су	10.00	574.81	24.00	1,379.56	-		-		-	-	1,954.
Sub Total Earthwork	(-	574.81	-	1,379.56	-	-	-	-	- 1	-	1,954.
Division 32 - Exterior Improvements	<u> </u>													
Sidewalks		0	lf	-	-	-	-	-	-	-	-	-	-	0.
Parking		0	ea	-	-	-	-	-	-	-	-	-	-	0.
Landscaping		0	ls	-	-	-	-	-		-	-	-	-	0.
Sub Total Exterior In	nprovements				-		-				-		-	0.
Division 33 - Utilities														
Water	None	1	ls	-		-	-	-		-	-	-	-	0.
Sanitary	None	1	ls	-	-	-	-	-	-	-	-	-	-	0.
Electric	Hook up to existing	1	ls	-	-	-	-	10,000.00	10,000.00	-	-	-	-	10,000.
Sub Total Utilities					-		-		10,000.00		-		-	10,000.
							l						J	
TOTAL EARTHWORK, Exterior Finis	shes & Utilities				574.81		1,379.56		10,000.00		0.00		0.00	11,954.

 Labor
 \$ 71,404

 Material
 \$ 278,333

 Subcontract
 \$ 421,119

 Equipment
 \$ 1,500

 Other
 \$ 1,712

 Total Cost
 \$ 774,068

 \$ 774,068

Diesel Plant Repair Project Building 4 City of Key West Engineering Department

1,620 sf

ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	rial Cost	Subco	ntractor	Equi	ipment	0	ther	TOTAL
HEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	i
Division 2 - Existing Conditions													
													i
Abatement													i
Asbestos Abatement	1	allw	-	-	-	-	10,000.00	10,000.00	-		-	-	10,000.00
Lead Paint Abatement	1	allw	-		-	-	3,500.00	3,500.00	-	-	-	-	3,500.00
Contaminated Soils	1	allw	-	-	-	-	5,000.00	5,000.00	-		-	-	5,000.00
Shoring - Heavy Duty	1	allw	-	-	-	-	15,000.00	15,000.00	-		-	-	15,000.00
Remove all electric and mechanical devices - leave Gen Set	1,620	sf	-	-	-	-	3.25	5,265.00	-		-	-	5,265.00
Broom Clean and dump	1,620	sf	-		-	-	0.30	486.00	-	-	-	- 1	486.00
											-		
TOTAL EXISTING CONDITIONS				0.00		0.00		39,251.00		0.00		0.00	39,251

ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	rial Cost	Subc	ontractor	Equi	ipment	0	ther	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 3 - Concrete													
Building Slab Repair (Cut and Square Edges, Structural Gravel	Dowels, Placement)												
Pit Infill Slab Structure	36	sf											
Ready Mix Materials	0.44	су	-	-	145.00	64.38	-	-	-	-	-	-	64.3
Admixtures - mid range	0.44	су	-	-	3.00	1.33	-	-	-	-	-	-	1.3
Fiber Mesh	0.44	су	-	-	5.00	2.22	-	-	-	-	-	-	2.2
Dowels	20	ea	15.00	300.00	3.00	60.00	-	-	-	-	-	-	360.0
SOG Concrete Placement	36	sf	2.00	72.00	-	-	-		-	•	-	-	72.0
Cure	36	sf	0.05	1.80	0.02	0.72	-	-	-	•	-	-	2.5
Caulk Control Joint & Saw Cuts	0	lf	1.00	-	0.44	-	-		-	•	-	-	0.0
Pour Prep	1	ls	450.00	450.00			-		-	•		-	450.0
Pumps	1	ea	-	-	-	-	-	-	1,500.00	1,500.00	-	-	1,500.0

ITEM DESCRIPTION	Unit		Labor	Cost	Mater	ial Cost	Subcon	tractor	Equi	pment	Ot	her	TOTAL
TIEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 4 - Masonry													
Exterior Masonry Repair													
Exterior Scaffold	2,610	sf	-		-		4.50	11,745.00	-	-	-	0.00	11,745.0
Exterior Scaffold Reinforced Plastic Wrap for Dust Control	2,610	sf	- 1	-	-		3.10	8,091.00	-	-	-	0.00	8,091.0
Exterior Elevation A Repoint	1,135	sf	- 1	-	-		3.25	3,688.75	-	-	-	0.00	3,688.7
Exterior Elevation B Repoint	516	sf	-	-	-	-	3.25	1,677.00	-	-	-	0.00	1,677.0
Grout Masonry Door & Window Jambs	14	ea	-	-	-	-	41.00	574.00	-	-	-	0.00	574.0
Structure Crack Repair	85	lf	-	-	-	-	41.00	3,485.00	-	-	-	0.00	3,485.0
Interior Masonry Repair													
Interior Scaffold	2,610	sf	-	-	-		4.50	11,745.00	-		-	-	11,745.0
Interior Elevation 1 Repoint	1,135	sf	-	-	-	-	8.00	9,080.00	-	-	-	-	9,080.0
Interior Elevation 2 Repoint	516	sf	-	-	-	-	8.00	4,128.00	-	-	-	-	4,128.0
Structure Crack Repair	85	lf	-	-	-	-	41.00	3,485.00	-	-	-	-	3,485.0
Infills	10	ea	-		-	-	560.00	5,600.00	-	•	-	-	5,600.0
TOTAL MASONRY	1			0.00		0.00		63,298.75		0.00		0.00	63,298.

Division 5													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	rial Cost	Subc	ontractor	Equ	ipment	0	ther	TOTAL
TIEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total]
Division 5 - Metals													
OPTION 2 ONLY													
Excavate Slab Removal & Excavate	8	ea	-	-	-		385.00	3,080.00	-	-	-	-	3,080.00

2'x2'x1.5'	Reinforced Concrete		8	ea	-	-	-	-	425.00	3,400.00	-	-	-	-	3,400.00
	Diamond expansion joint		8	ea	-	-	-	-	120.00	960.00	-	-	-	-	960.00
Materials															
Beams	If	ea													
W14 x 61	30	8	14640												
W12 x 30	15	24	10800												
		32	25440												
	\$2,500	\$80,000	13	tns	-	-	6,500.00	86,814.00		-	-	-	-	-	86,814.00
Primer			13	tns	-	-	250.00	3,339.00		-	-	-	-	-	3,339.00
	\$2.5 per pd Industrial														
	\$4.30 per pd Commercial														
					·		·	, and the second	·						·
	_														
Bolts			168	ea	-	-	12.25	2,058.00	-	-	-	-	-	-	2,058.00
Shim Stock			1	ls	-	-	500.00	500.00		-	-	-	-	-	500.00
Grout			4	sacks	-	-	30.00	120.00	-	-	-	-	-	-	120.00
Welding Gas & Su	ndry		1	ls	-	-	600.00	600.00	-	-	-	-	-	-	600.00
Labor															
	hr	daily													
Labor foreman	\$65.55	\$524.40													
Steel Erector 1	\$55.00	\$440.00													
Steel Erector 2	\$55.00	\$440.00													
Steel Erector 3	\$55.00	\$440.00													
Pick up truck	φοσ.σσ	\$36.00													
Rack truck		\$101.00													
Hoist & Lifts		\$673.00													
Perdiem		\$1,250.00		t											
Overhead & Profit		\$875.95													
Daily Burn Rate		\$4,780.35													
	Steel Contractor	Ç.,. 30.00	5	day	\$4,780.35	23,901.76	-		_		-		-	-	23,901.76
	2.22. 2011440101		 		Ţ.,. II.	,									
Crane Service			5	day	-	-	-		1,100.00	5,500.00	-	_	-	_	5,500.00
2.2			 						.,100.00	5,555.55					3,000.00
			+	\vdash											
			+	\vdash								1			
										I	I	1	1		
TOTAL METALS						23,901.76		93,431.00		5.500.00		0.00		0.00	122,833

A DESCRIPTION		Quan	tity	Labor	Cost	Mater	ial Cost	Subcor	ntractor	Equi	oment	Ot	ther	TOTAL
M DESCRIPTION		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
rebu	uild on existing steel	1.614	sf					+						
	•	20	ea	-	-	36.00	720.00	-	-	-	-	-	-	720.0
	2x10x12	72	ea	-	-	36.00	2,592.00	-	-	-	-	-	-	2,592.0
3	2x4	50	lf	-	-	1.00	50.00	-	-	-	-	-	-	50.0
g	2x4	150	3f	-	-	1.00	150.00	-	-	-		-	-	150.0
ng	5/8" PLY	50	sheets	-	-	58.00	2,925.38	-		-	-	-	-	2,925.3
		87	rf	-	-	65.00	5,655.00	-	-	-	-	-	-	5,655.0
vall Framing & Sheathin	reframe parapets	240	sf	-	-	45.00	10,800.00	-	-	-	-	-	-	10,800.0
Components		1	ls	-	-	10,000.00	10,000.00	-		-		-	-	10,000.0
ngers & fasteners		1	ls	-	-	15,000.00	15,000.00	-	-	-	-	-	-	15,000.0
ew	6 men 2 weeks	360	man hrs	53.20	19,152.00	-	-	_		-		-	-	19,152.0
1	s g g g wall Framing & Sheathin c Components	rebuild on existing steel 2x10x12 s 2x4 g 2x4 g 5/8" PLY wall Framing & Sheathin reframe parapets components ngers & fasteners	Number N	Number Unit	Number Unit Unit Cost	Number	Number Unit Unit Cost Total Unit Cost Total Unit Cost Total Unit Cost Total Unit Cost Unit	Number Unit Unit Cost Total Unit Cost Total	Number Unit Unit Cost Total Unit Cost Unit Cost Unit Cost Unit Cost Unit Cost Total Unit Cost Number Unit Unit Cost Total Unit Cos	Number Unit Unit Cost Total Unit Cost Total Unit Cost Total Unit Cost Unit Cost Total Unit Cost Unit	Number Unit Unit Cost Total Unit Cos	Number Unit Unit Cost Total Unit Cos	Number Unit Unit Cost Total Unit Cos	

Division 7													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	rial Cost	Subce	ontractor	Equ	ipment	0	ther	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 7 - Thermal & Moisture Protection													
Exterior Stuccos Finish	2,208	sf	-	-	-	-	5.00	11,040.00	-	-	-	-	11,040.00
Metal Roofing	1,614	sf	-	-	-	-	14.00	22,596.00	-	-	-	-	22,596.00
Galv Metal Gutter	480	lf	-	-	-	-	16.00	7,680.00	-	-	-	-	7,680.00
Joint Sealants	1	ls	-	-	-	-	600.00	600.00	-	-	-	-	600.00

TOTAL THERMO MOISTURE 0.00 0.00 41,916.00 0.00 0.00 41,916

	COUNTION	Quant	iity	Labo	r Cost	Mater	ial Cost	Subco	ntractor	Equi	pment	l Ot	ther	TOTAL
ITEM DES	SCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Í
ivision 8 - Doors & Windows														
														i .
nterior Doors														j
None		0	ea	-	-	-	-	-	-	-	-	-	-	0.
														-
exterior Doors														
Door & Hardware		1	ea	455.00	455.00	1,121.00	1,121.00	-	-	-	-	-	-	1,576.
Vindows and Glazing														i
nstallation Crew														
hou	rly daily			-	-	-	-	-		-	-	-	-	0.0 0.0 0.0
oreman 50.				-	-	-	-	-	-	-		-	-	0.0
ourneyman 1 38.						-	-	-		-	-	-	-	0.0
ourneyman 2 38.						-	-	-	-	-		-	-	0.0
ourneyman 3 38.	00 \$304.00													
rick up truck	\$35.00					-	-	-		-	-	-	-	0.0
lack Truck	\$125.00					-	-	-		-	-	-	-	0.0
an with tools and parts	\$185.00					-	-	-		-	-	-	-	0.0
er diem	\$1,300.00													1
aily Sub Total	\$2,957.00	2	Days	\$2,957.00	5,914.00	-	-	-	-	-	-	-	-	5,914.0
	sf													
arn Door 1	77	1	ea	924.00	924.00	2,618.00	2,618.00	-	-	-	-	-	-	3,542.0

Division 9	0	·	1 - 6 -	- 04			0	-44	F			L	TOTAL
ITEM DESCRIPTION	Quant			r Cost		rial Cost		ntractor		pment		her	IOIAL
TIEM DEGGIA TION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 9 - Finishes													
Walls & Partitions None	0	ls	_						 				
Hard Ceilings None	0	ls	-	-	-	-	-		-	-	ı		0.0
				-	-	-	-		-	-	-	-	0.0
Acoustic Ceilings None	0	ls	-	-	-	-	-		-		-	-	0.0
				-	-	-	-		-		-	-	0.0
Flooring None	0	ls	-	-	-	-	-		-	-	-	-	0.0
Paint													0.0
Exterior None		of		-	-		-		-		-	-	0.0
EYIGHOL MOHE	0	51	-	-	-	-		-	- 1	-	-	-	0.0
	<u> </u>	1		ı	I I								
TOTAL FINISHES				0.00		0.00		0.00		0.00		0.00	

Division 10													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	rial Cost	Subc	ontractor	Equ	ipment	0	ther	TOTAL
II EM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 10 - Specialties													
Interior Signage	2	ea	12.00	24.00	150.00	300.00	-	-	-	-	-	-	324.00
Fire Extinguisher on Brackets	1	ea	50.00	50.00	67.00	67.00	-	-	-	-	-	-	117.00
_						•					-		
TOTAL SPECIALTIES				74.00		367.00		0.00		0.00		0.00	441

Division 11													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	rial Cost	Subc	ontractor	Equ	ipment	Ot	ther	TOTAL
TIEW DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 11 - Equipment													
Not Used	1	ea	-	-	-	-	-	-	-	-	-	-	0.00
TOTAL EQUIPMENT				0.00		0.00		0.00		0.00		0.00	0

Division 12													
ITEM DESCRIPTION	Quant			r Cost	Mate	rial Cost	Subc	ontractor	Equ	ipment	Ot	her	TOTAL
TIEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 12 - Furnishings													
Not Used	1	ea	-		-		•		-	-	-		0.00
TOTAL FURNISHINGS				0.00		0.00		0.00		0.00		0.00	0

Division 13													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	erial Cost	Subc	ontractor	Equ	ipment	0	ther	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 13 - Special Construction													
Not Used	1	ls	-	-	-		-		-	-	-	-	0.00
TOTAL SPECIAL CONSTRUCTION				0.00		0.00		0.00		0.00		0.00	0

Division 14													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	erial Cost	Subc	ontractor	Equ	ipment	0	ther	TOTAL
II EM DESCRIFTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 14 - Conveyors													
Not Used	1	ea	-		-		-	-	-	-	-	-	0.00
TOTAL CONVEYORS				0.00		0.00		0.00		0.00		0.00	0

Division 21													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	erial Cost	Subc	ontractor	Equ	ipment	0	ther	TOTAL
TI EM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 21 - Fire Protection													
None Required	1	ea	-	-	-	-	-		-	-	-	-	0.00
TOTAL MECHANICAL				0.00		0.00		0.00		0.00		0.00	0

Division 22														
ITEM DESCRIPTION		Quant	ity	Labo	r Cost	Mate	rial Cost	Subc	ontractor	Equ	ipment	0	ther	TOTAL
ITEM DESCRIPTION		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 22 - Plumbing														
See Demolition in Division 2	Assembly													
							-		-		-		-	-
Plumbing Contractor Overhead		8%			-		-		-		-		-	-
Profit		8%			-		-		-		-		-	-
							•				•	•	•	
TOTAL PLUMBING					0.00		0.00		0.00		0.00		0.00	0.00

Division 23													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	rial Cost	Subc	ontractor	Equ	ipment	0	ther	TOTAL
TIEW DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 23 - Mechanical - HVAC													
See Demolition in Division 2	1	ls	-	-	-	-	-	-	-	-	-	-	0.00
				\$0.00		\$0.00		\$0.00		\$0.00		\$0.00	\$0.00
HVAC Contractor Overhead	8%			-		-		-		-		-	-
Profit	8%			-		-		-		-		-	-
TOTAL HVAC				0.00		0.00		0.00		0.00		0.00	0.00

Division 26													
ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mate	rial Cost	Subco	ontractor	Equ	ipment	Ot	her	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 26 - Electrical													
Construction Temp Power	1	ls	-	-	-		2,300.00	2,300.00	-	-	-	-	2,300.00

Construction illumination	3,424	sf	-	-	-	-	-	-	-	-	0.50	1,712.00	1,712.00
													0.0
Panel 480Y,270V, 42 circuits	1	ea	4,065.00	4,065.00	1,575.00	1,575.00	-	-	-	-	-	-	5,640.00
Dry Transformer	1	ea	220.00	220.00	340.00	340.00	-	-	-	-	-	-	560.00
2'x4' Fixture	4	ea	74.00	296.00	153.00	612.00	-	-	-	-	-	-	908.00
Emergency ballast, factory installed	2	ea	0.00	0.00	157.00	314.00	-	-	-	-	-	-	314.00
Fixture wiring whip	4	ea	12.40	49.60	15.00	60.00	-	-	-	-	-	-	109.60
Exit light, LED, single face w/battery	2	ea	84.00	168.00	126.00	252.00	-	-	-	-	-	-	420.00
Emergency Light with Battery Backup	4	ea	110.00	440.00	162.00	648.00	-	-			-	-	1,088.00
Toggle switch, single pole with occupancy sensor	1	ea	14.50	14.50	8.40	8.40	-	-	-	- +	-	- +	22.90
Receptacle, GFI, 20A	3	ea	14.50	43.50	35.50	106.50	-	-	-	-	-	-	150.00
Electrical metallic tubing, 3/4"	117	If	3.80	444.60	1.91	223.47	-	-	-	-	-	-	668.07
Wire, #12 solid	2.81	clf	34.00	95.54	15.90	44.68	-	-	-	-	-	-	140.22
Wall plate, 1-gang	4	ea	5.56	22.24	1.34	5.36	-	-	-	-	-	-	27.60
Manual motor starter, 1-pole	3	ea	58.00	174.00	62.50	187.50	-	-	-	-	-	-	361.50
Wire, #1/0	0.6	clf	111.00	66.60	254.00	152.40	-	-	-	-	-	-	219.00
Wire, #6	0.15	clf	57.00	8.55	62.00	9.30	-	-	-	-	-	-	17.85
Wire, #2	2.2	clf	82.00	180.40	155.00	341.00	-	-	-	-	-	-	521.40
Wire, #8	0.55	clf	46.50	25.58	41.50	22.83	-	-	-	-	-	-	48.40
Wire, #4	0.15	clf	70.00	10.50	98.50	14.78	-	-	-	-	-	-	25.28
Grounding	1	ls		-	-	-	8,200.00	8,200.00	-	-	-	-	8,200.00
TOTAL ELECTRICAL		1		6,324.61		4,917.21		10,500.00		0.00		1,712.00	23,453.81

ITEM DESCRIPTION		Quant	ity	Labo	r Cost	Mate	rial Cost	Subco	ntractor	Equi	pment	01	ther	TOTAL
ITEM DESCRIPTION		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 31 - Earthwork														
Building interior pit structural fill		11	cy	10.00	106.67	24.00	256.00	-	-	-	-	-	-	362.6
Sub Total Earthwork				-	106.67	-	256.00	-		-	-	-	-	362.6
Division 32 - Exterior Improvements														
Sidewalks		0	lf	-	-	-	-	-		-	-	-	-	0.0
Parking		0	ea	-	-	-	-	-	-	-	-	-	-	0.0
Landscaping		0	ls	-	-	-	-	-	-	-	-	-	-	0.0
Sub Total Exterior Improvement	3				-		-		-		-		-	-
Division 33 - Utilities														
Water	None	1	ls	-	-	-	-	-		-	-	-	-	0.0
Sanitary	None	1	ls	-	-	-	-	-	-	-	-	-	-	0.0
Electric	Hook up to existing	1	ls	-	-	-		10,000.00	10,000.00	-	-	-	-	10,000.0
Sub Total Utilities	-				-		-		10,000.00		-		-	10,000.0

Labor	\$ 57,676
Material	\$ 158,826
Subcontract	\$ 187,606
Equipment	\$ 1,500
Other	\$ 1,712
Total Cost	\$ 407,320
	\$ 407.320

Diesel Plant Repair Project Building 5 City of Key West Engineering Department

170 sf

ITEM DESCRIPTION	Quant	ity	Labo	r Cost	Mater	ial Cost	Subcontr	actor	Equi	pment	0	ther	TOTAL
TIEW DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 2 - Existing Conditions													
Abatement													
Asbestos Abatement	1	allw	-	-	-	-	3,000.00	3,000.00	-	-	-	-	3,000.00
Lead Paint Abatement	1	allw	-	-	-	-	3,500.00	3,500.00	-	-	-	-	3,500.00
Contaminated Soils	1	allw	-	-	-	-	5,000.00	5,000.00	-	-	-	-	5,000.00
Shoring - Heavy Duty	1	allw	-	-	-	-	-	-	-	-	-	-	0.00
Remove all electric and mechanical devices - leave Gen Set	170	sf	-	-	-	-	3.25	552.50	-	-	-	-	552.50
Broom Clean and dump	170	sf	-	-	-	-	0.30	51.00	-	-	-	-	51.00
TOTAL EXISTING CONDITIONS				0.00		0.00		12,103.50		0.00		0.00	12,104

ITEM DESCRIPTION	Quan	Quantity		Labor Cost		Material Cost		Subcontractor		Equipment		Other	TOTAL
TIEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 3 - Concrete													
Building Slab Repair (Cut and Square Edges, Structural Gravel, Dov	wels, Placement)												
Pit Infill Slab Structure	40	sf											
Ready Mix Materials	13	cy	-		145.00	1,931.40	-	-	-	-	-	-	1,931.40
Admixtures - mid range	13	су	-	-	3.00	39.96	-	-	-	-	-	-	39.96
Fiber Mesh	13	су	-		5.00	66.60	-	-	-	-	-	-	66.60
Dowels	14	ea	15.00	210.00	3.00	42.00	-	-	-	-	-	-	252.00
SOG Concrete Placement	14	sf	2.00	28.00	-	-	-	-	-	-	-	-	28.00
Cure	14	sf	0.05	0.70	0.02	0.28	-	-	-	-	-	-	0.98
Caulk Control Joint & Saw Cuts	0	lf	1.00		0.44	-	-	-	-	-	-	-	0.00
Pour Prep	1	ls	450.00	450.00	-	-	-	-	-	-	-	-	450.00
	į									1	1	-	
TOTAL CONCRETE				688.70		2,080.24		0.00		0.00		0.00	2,769

Division 4													TOTAL
ITEM DESCRIPTION	Quant	Quantity		Labor Cost		Material Cost		Subcontractor		Equipment		Other	
TIEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 4 - Masonry													
Not Used	0	ea	-		•	-	٠	-	-	-	-	-	0.00
TOTAL MACCAURY				0.00				0.00		0.00		0.00	0.00
TOTAL MASONRY				0.00		0.00		0.00		0.00		0.00	0.00

wood. Diesel Plant BLDG 5 BWS

Division 5													
ITEM DESCRIPTION	Quant			r Cost		rial Cost	Subcont			pment		Other	TOTAL
Division 5 - Metals	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
OPTION 2 ONLY													
Not Used	0	ea	-	-	-	-	-	-	-	-	-	-	0.00
TOTAL METALO				0.00		0.00		0.00		0.00		0.00	0
TOTAL METALS				0.00		0.00		0.00		0.00		0.00	U
Division 8													
ITEM DESCRIPTION	Quant	_		r Cost		rial Cost	Subcont			pment		Other	TOTAL
	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 8 - Doors & Windows													
Interior Doors													
None		ea	-	-	-	-	-	-	-	-	-	-	0.00
Exterior Doors													0.00
None		ea	-	-	-	-	-	-	-	-	-	-	0.00
Windows and Glazing													
Exterior Windov None		ea	-	-	-	-	-	-	-	-	-	-	0.00
TOTAL DOORS & WINDOWS			<u> </u>	0.00		0.00		0.00		0.00		0.00	0
TOTAL DOORS & WINDOWS				0.00		0.00		0.00		0.00		0.00	U
Division 9													
	Quant	ity	Labo	r Cost	Mate	rial Cost	Subcont	tractor	Equi	pment	(Other	TOTAL
ITEM DESCRIPTION	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Division 9 - Finishes													
Malla O Davida Nama													
Walls & Partitio None	0	ls	-										
Hard Ceilings None	0	ls	-	-	-	-	-	-	-	-	-	-	0.00
				-		-	-	-	-	-	ı	-	0.00
Acoustic Ceilinς None	0	ls	-	-	-	-	-	-	-	-	-	-	0.00
Flooring None				-	-		<u> </u>	-	-	-	-	-	0.00
Flooring None	0	ls	-	-	-	-	-	-	-	-	-	-	0.00
	_					-		_	-	-	_		0.00
Paint				-	-								
Paint Exterior None	0	sf	-	-	-	-	-	-	-	-		-	0.00
	0	sf	-				-	-	-				
	0	sf	-					-	-				
Exterior None	0	sf	-	-		-	-		-	-		-	0.00
	0	sf	-				-	0.00	-				0.00
Exterior None			-	0.00	-	0.00	-	0.00		0.00	-	0.00	0.00
Exterior None TOTAL FINISHES Division 10	Quant	ity		0.00	- Mate	0.00	Subcont	0.00	Equi	0.00	-	0.00 Other	0.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION			Labo Unit Cost	0.00	-	0.00	-	0.00		0.00	-	0.00	0.00
Exterior None TOTAL FINISHES Division 10	Quant	ity		0.00	- Mate	0.00	Subcont	0.00	Equi	0.00	-	0.00 Other	0.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties	Quant Number	ity Unit	Unit Cost	0.00 r Cost Total	Mate Unit Cost	0.00	Subcont	0.00	Equi	0.00 pment Total	- (0.00 Other Total	0.00 0 TOTAL
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION	Quant	ity		0.00	- Mate	rial Cost Total	Subcont Unit Cost	0.00 tractor Total	Equi Unit Cost	0.00	-	0.00 Other	0.00 TOTAL 324.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage	Quant Number	ity Unit	Unit Cost	0.00 r Cost Total	Mate Unit Cost	rial Cost Total	Subcont Unit Cost	0.00 tractor Total	Equi Unit Cost	0.00 pment Total	Unit Cost	0.00 Other Total	0.00 TOTAL 324.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets	Quant Number	ity Unit	Unit Cost	0.00 r Cost Total 24.00 50.00	Mate Unit Cost	70.00 rial Cost Total 300.00 67.00	Subcont Unit Cost	0.00 tractor Total	Equi Unit Cost	0.00 pment Total	Unit Cost	0.00 Other Total	0.00 TOTAL 324.00 117.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage	Quant Number	ity Unit	Unit Cost	0.00 r Cost Total	Mate Unit Cost	rial Cost Total	Subcont Unit Cost	0.00 tractor Total	Equi Unit Cost	0.00 pment Total	Unit Cost	0.00 Other Total	0.00 TOTAL 324.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES	Quant Number	ity Unit	Unit Cost	0.00 r Cost Total 24.00 50.00	Mate Unit Cost	70.00 rial Cost Total 300.00 67.00	Subcont Unit Cost	0.00 tractor Total	Equi Unit Cost	0.00 pment Total	Unit Cost	0.00 Other Total	0.00 TOTAL 324.00 117.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES Division 11	Quant Number	ity Unit ea	12.00 50.00	0.00 r Cost Total 24.00 50.00	Mate Unit Cost 150.00 67.00	70.00 rial Cost Total 300.00 67.00	Subcont Unit Cost	0.00 tractor Total	Equi Unit Cost - -	0.00 pment Total	Unit Cost	0.00 Other Total	0.00 0 TOTAL 324.00 117.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES	Quant Number	ity Unit ea	12.00 50.00	0.00 r Cost Total 24.00 50.00	Mate Unit Cost 150.00 67.00	0.00 rial Cost Total 300.00 67.00	Subcont Unit Cost	0.00 tractor Total	Equi Unit Cost - -	O.00 pment Total 0.00	Unit Cost	O.00 Other Total	0.00 TOTAL 324.00 117.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES Division 11 ITEM DESCRIPTION	Quanti Number	ity Unit ea ea	12.00 50.00	0.00 r Cost Total 24.00 50.00 74.00	Mate Unit Cost 150.00 67.00	0.00 rial Cost Total 300.00 67.00 367.00	Subcont Unit Cost	0.00 tractor Total	Equi Unit Cost - - Equi	O.00 Doment Total 0.00 Doment	Unit Cost	Other Total	0.00 TOTAL 324.00 117.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES Division 11 ITEM DESCRIPTION Division 11 - Equipment	Quanti Number	ity Unit ea ea	12.00 50.00	0.00 r Cost Total 24.00 50.00 74.00	Mate Unit Cost 150.00 67.00	0.00 rial Cost Total 300.00 67.00 367.00	Subcont Unit Cost	0.00 tractor Total	Equi Unit Cost - - Equi	O.00 Doment Total 0.00 Doment	Unit Cost	Other Total	0.00 TOTAL 324.00 117.00 441 TOTAL
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES Division 11 ITEM DESCRIPTION	Quanti Number	ity Unit ea ea	12.00 50.00	0.00 r Cost Total 24.00 50.00 74.00	Mate Unit Cost 150.00 67.00	0.00 rial Cost Total 300.00 67.00 367.00	Subcont Unit Cost	0.00 tractor Total	Equi Unit Cost - - Equi	O.00 Doment Total 0.00 Doment	Unit Cost	Other Total	0.00 TOTAL 324.00 117.00 441
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES Division 11 ITEM DESCRIPTION Division 11 - Equipment	Quant Number 2 1	Unit ea ea Unit Unit	Unit Cost 12.00 50.00 Labo Unit Cost	74.00 r Cost Total 24.00 50.00 74.00 r Cost Total	Mate Unit Cost 150.00 67.00 Mate Unit Cost	70.00 rial Cost Total 300.00 67.00 367.00 rial Cost Total	Subcont Unit Cost Subcont Unit Cost	0.00 tractor Total 0.00 tractor Total	Equi Unit Cost - - Equi Unit Cost	O.00 pment Total 0.00 pment Total Total	Unit Cost	O.00 Other Total O.00 Other Total Total Total Total	0.00 TOTAL 324.00 117.00 441
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES Division 11 ITEM DESCRIPTION Division 11 - Equipment Not Used	Quant Number 2 1	Unit ea ea Unit Unit	Unit Cost 12.00 50.00 Labo Unit Cost	0.00 r Cost Total 24.00 50.00 74.00 r Cost Total	Mate Unit Cost 150.00 67.00 Mate Unit Cost	70.00 rial Cost Total 300.00 67.00 367.00 rial Cost Total	Subcont Unit Cost Subcont Unit Cost	0.00 tractor Total 0.00 tractor Total	Equi Unit Cost - - Equi Unit Cost	O.00 pment Total 0.00 pment Total	Unit Cost	Other Total O.00 Other Total O.00 Other Total O.00 Other Total	0.00 TOTAL 324.00 117.00 441 TOTAL 0.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES Division 11 ITEM DESCRIPTION Division 11 - Equipment Not Used	Quant Number 2 1	Unit ea ea Unit Unit	Unit Cost 12.00 50.00 Labo Unit Cost	74.00 r Cost Total 24.00 50.00 74.00 r Cost Total	Mate Unit Cost 150.00 67.00 Mate Unit Cost	70.00 rial Cost Total 300.00 67.00 367.00 rial Cost Total	Subcont Unit Cost Subcont Unit Cost	0.00 tractor Total 0.00 tractor Total	Equi Unit Cost - - Equi Unit Cost	O.00 pment Total 0.00 pment Total Total	Unit Cost	O.00 Other Total O.00 Other Total Total Total Total	0.00 TOTAL 324.00 117.00 441 TOTAL 0.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES Division 11 ITEM DESCRIPTION Division 11 - Equipment Not Used	Quant Number 2 1	Unit ea ea Unit Unit	Unit Cost 12.00 50.00 Labo Unit Cost	0.00 r Cost Total 24.00 50.00 74.00 r Cost Total	Mate Unit Cost 150.00 67.00 Mate Unit Cost	70.00 rial Cost Total 300.00 67.00 367.00 rial Cost Total	Subcont Unit Cost Subcont Unit Cost	0.00 tractor Total 0.00 tractor Total	Equi Unit Cost - - Equi Unit Cost	O.00 pment Total 0.00 pment Total	Unit Cost	Other Total O.00 Other Total O.00 Other Total O.00 Other Total	0.00 TOTAL 324.00 117.00 441 TOTAL 0.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES Division 11 ITEM DESCRIPTION Division 11 - Equipment Not Used TOTAL EQUIPMENT Division 12	Quant Number 2 1	ity Unit ea ea ity Unit ea ea	Unit Cost 12.00 50.00 Labo Unit Cost	0.00 r Cost Total 24.00 50.00 74.00 r Cost Total	Mate Unit Cost 150.00 67.00 Mate Unit Cost	70.00 rial Cost Total 300.00 67.00 367.00 rial Cost Total	Subcont Unit Cost Subcont Unit Cost	0.00 tractor Total - 0.00 tractor Total - 0.00	Equi Unit Cost - - - Equi Unit Cost	O.00 pment Total 0.00 pment Total	Unit Cost Unit Cost Unit Cost	Other Total O.00 Other Total O.00 Other Total O.00 Other Total	0.00 TOTAL 324.00 117.00
Exterior None TOTAL FINISHES Division 10 ITEM DESCRIPTION Division 10 - Specialties Interior Signage Fire Extinguisher on Brackets TOTAL SPECIALTIES Division 11 ITEM DESCRIPTION Division 11 - Equipment Not Used	Quant Number 2 1	ity Unit ea ea ea ity Unit	Unit Cost 12.00 50.00 Labo Unit Cost	74.00 T Cost Total 24.00 50.00 74.00 T Cost Total	Mate Unit Cost 150.00 67.00 Mate Unit Cost	70.00 rial Cost	Subcont Unit Cost Subcont Unit Cost	0.00 tractor Total - 0.00 tractor Total - 0.00	Equi Unit Cost - - - Equi Unit Cost	Doment Total	Unit Cost Unit Cost Unit Cost	Other Total O.00 Other Total O.00 Other Total O.00 Other Total O.00	0.00 TOTAL 324.00 117.00 441 TOTAL 0.00

													Page 29 of 30
Division 12 - Furnishings													
Not Used	1	ea	-	-	-	-	-	-	-	-	-	-	0.00
TOTAL FURNISHINGS				0.00		0.00		0.00		0.00		0.00	0
Division 13													
ITEM DESCRIPTION	Quan Number	tity Unit	Labo Unit Cost	r Cost Total	Mate Unit Cost	erial Cost Total	Subcont Unit Cost	tractor Total	Equi Unit Cost	ipment Total	Unit Cost	Other Total	TOTAL
Division 13 - Special Construction	Number	Oilit	Offic Cost	Total	Onit Cost	Total	Offic Cost	Total	Unit Cost	Total	Offic Cost	Total	
Not Used	1	ls	-	-	-	-	-	-	-	-	-	-	0.00
TOTAL SPECIAL CONSTRUCTION		1		0.00		0.00		0.00		0.00		0.00	0
Division 14													
ITEM DESCRIPTION	Quan	tity	Labo	r Cost	Mate	erial Cost	Subcont	tractor	Equi	ipment		Other	TOTAL
Division 14 - Conveyors	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
Not Used	1	ea	-	-	-	-	-	-	-	-	-	-	0.00
TOTAL CONVEYORS				0.00		0.00		0.00		0.00		0.00	0
Division 21													
ITEM DESCRIPTION	Quan Number	tity Unit	Labo Unit Cost	r Cost Total	Unit Cost	erial Cost Total	Subcont Unit Cost	tractor Total	Equi Unit Cost	ipment Total	Unit Cost	Other Total	TOTAL
Division 21 - Fire Protection													
None Required	1	ea	-	-	-	-	-	-	-	-	-	-	0.00
TOTAL MECHANICAL				0.00		0.00		0.00		0.00		0.00	0
Division 22													
ITEM DESCRIPTION	Quan Number	tity Unit	Labo Unit Cost	r Cost Total	Mate Unit Cost	erial Cost Total	Subcont Unit Cost	tractor Total	Equi Unit Cost	ipment Total	Unit Cost	Other Total	TOTAL
Division 22 - Plumbing	Number	Onic	Clift Gost	10101	Oline Good	10101	Olik Gost	Total	Olik Gost	Total	Onit Gost	Total	
See Demolition in Division 2 Assembly													
				\$0.00		\$0.00		\$0.00		\$0.00		\$0.00	\$0.00
Plumbing Contractor Overhead Profit	8% 8%					-				-		-	-
TOTAL PLUMBING	070			0.00		0.00		0.00		0.00		0.00	0.00
Division 23													
ITEM DESCRIPTION	Quan Number	tity Unit		r Cost Total	Mate Unit Cost	erial Cost Total	Subcont Unit Cost	tractor Total	Equi Unit Cost	ipment Total	Unit Cost	Other Total	TOTAL
Division 23 - Mechanical - HVAC	Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Offit Cost	Total	
See Demolition in Division 2	1	ls	-	-	-	-	-	-	-		-	-	0.00
HVAC Contractor Overhead	8%			\$0.00		\$0.00		\$0.00 -		\$0.00	-	\$0.00	\$0.00
Profit	8%			-		-		-		-		-	-
TOTAL HVAC				0.00		0.00		0.00		0.00		0.00	0.00
Division 26													T07**
ITEM DESCRIPTION	Quan Number			r Cost Total	Mate Unit Cost	erial Cost Total	Subcont Unit Cost	tractor Total	Equi Unit Cost	ipment Total	Unit Cost	Other Total	TOTAL
Division 26 - Electrical													
Grounding	1	ls		-	-	-	8,200.00	8,200.00		-	-	-	8,200.00
												-	

TOTAL ELECTRICAL 0.00 0.00 8,200.00 0.00 0.00 8,200.00

ITEM DECODIDATION		Quant	ity	Labor	Cost	Material Cost		Subcontractor		Equipment		Other		TOTAL
ITEM DESCRIPTION		Number	Unit	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	Unit Cost	Total	
ivision 31 - Earthwork														
Building interior pit structural fill		12	су	10.00	118.52	24.00	284.44	-	-	-	-	-	-	402.9
Sub Total Earthwork				-	118.52	-	284.44	-	-	-	-	-	-	402.9
ivision 32 - Exterior Improvements														
Sidewalks		0	lf	-	-	-	-	-	-	-	-	-	-	0.0
Parking		0	ea	-	-	-	-	-	-	-	-	-	-	0.0
Landscaping		0	ls	-	-	-	-	-	-	-	-	-	-	0.0
Sub Total Exterior Improvements					-		-		-		-		-	0.0
ivision 33 - Utilities														
Water	None	1	ls	-	-	-	-	-	-	-	-	-	-	0.0
Sanitary	None	1	ls	-	-	-	-	-	-	-	-	-	- 1	0.0
Electric	Hook up to existing	1	ls	-	-	-	-	10,000.00	10,000.00	-	-	-	-	10,000.0
Sub Total Utilities					-		-		10,000.00		-		-	10,000.0

Labor	\$	881
Material	\$	2,732
Subcontract	\$	33,818
Equipment	\$	-
Other	\$	-
Total Cost	\$	37,431
	•	27 /21

Diesel Plant BLDG 5 BWS